

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 2296972 2. Type of incident*: OIL SPILL
3. Name of Location: 36" NKPOKU - BOMU PIPELINE
4. Name of nearest community ELELEND 5. State: RIVERS 6. LGA OBIO/AKPOR
7. Type of Production facility/Installation OIL PIPELINE
8. Asset owner/District THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED / PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident
a. Date of incident: 20TH MARCH, 2019
b. Start date/time of investigation: 21ST MARCH 2019 / 12 05 HRS
c. Investigation End date: 21ST MARCH 2019 Actual investigation duration, days: ONE (1) DAY
d. Description of spill point environment

- | | | |
|---|--|---|
| <input type="checkbox"/> Firm soil | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | <input type="checkbox"/> Drill Rig | |

Additional observations around the spill point: THE JOINT INVESTIGATION TEAM OBSERVED TAMPERED CLAMP AND MULTIPLE CRUDE OIL THEFT POINTS INSTALLED BY UNKNOWN PERSONS.

e. Description of leak point (tick as applicable);

- | | | |
|---|--|--|
| <input type="checkbox"/> Drilled hole | <input type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____) |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve | <input type="checkbox"/> Failed Clamp | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input checked="" type="checkbox"/> Crude oil theft (illegal bunkering) point | <input type="checkbox"/> Saver-pit over flow | <input checked="" type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting | <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Third party tampering with flange |
| <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Cold vent | <input type="checkbox"/> Surge vessel overflow |
| <input type="checkbox"/> Valve Failure | <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Accidental 3 rd party equipment impact |
| <input type="checkbox"/> Corrosion | <input type="checkbox"/> Others(specify) _____ | |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Mystery spills Others(specify) _____

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

g. Spill point coordinates

Measuring unit WGS84

	Northing: <u>LATITUDE</u>	Easting: <u>LONGITUDE</u>
SPILL POINT NON LEAKING POINT	4.85718	7.09969
	4.85718	7.09972
	4.85714	7.09974
	4.85713	7.09975
	4.85711	7.09977

C. RISK ASSESSMENT

10. Type of environment:

- Land
 Swamp
 Water
 Seasonal swamp
 Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land
 Swamp
 Water
 River (identify) _____

ii. Weather condition

- Rain
 Sunny
 Dry
 Wet
 Windy
 Hot
 Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [] ,m
- Drinking water source [] ,m
- Built up area [] ,m
- Farmlands NONE SEEN [] ,m
- Fish Farm/Pond WITHIN VICINITY [] ,m
- Fishing net [] ,m
- Others (specify) [] ,m

12. Containment measures put in place;

- Booms
 Trench
 Dyke
 Natural depression
 Pit
 None
- Others: _____

13. Any pictures or video coverage?

[N]

14. Further response/repair initiated as at the time of JIV?

[N]

If yes to item 14, give brief description:

RECOVERY AND REPAIR ACTIVITIES ARE ONGOING

15. Was there any disruption to the investigation?

[Y] [N]

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

If yes to item 15 give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						

18. Fishing Nets/Fish Ponds


S/N	Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detailed report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 36" NKPOKU - BOMU PIPELINE AT ELELENWIO
SHOWING POSITIONS OF TAMPERED CLAMP AND MULTIPLE CRUDE OIL THEFT POINTS.

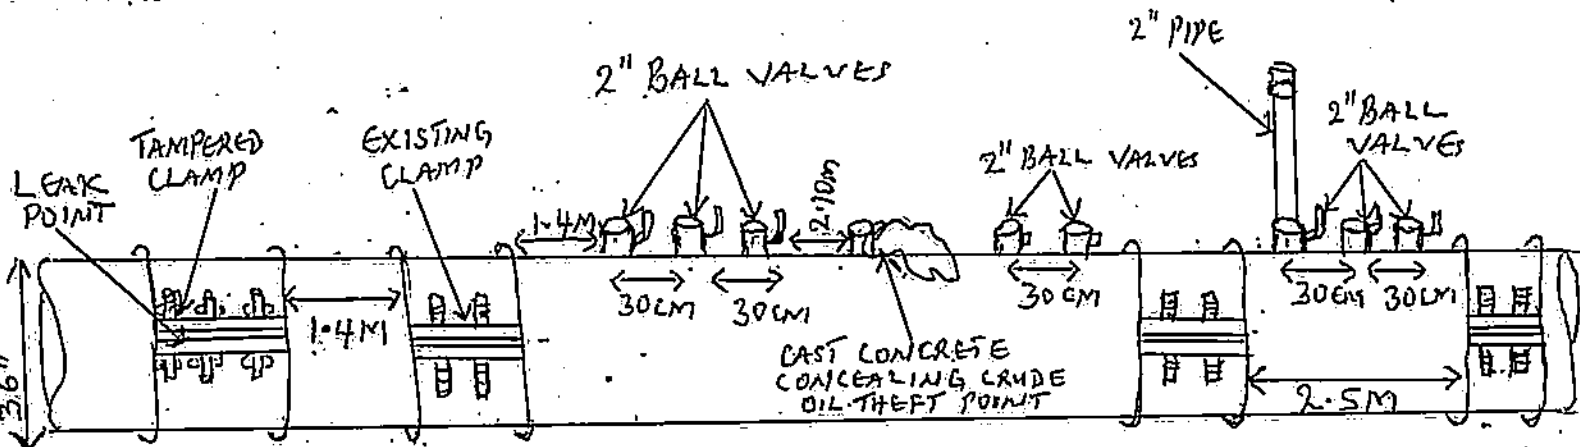

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

WGS 84

S/N	Northing LATITUDE	Easting LONGITUDE
1.	4.85725	7.09968
2.	4.85722	7.09970
3.	4.85724	7.09973
4.	4.85719	7.09986
5.	4.85706	7.10003
6.	4.85698	7.10005
7.	4.85696	7.10007
8.	4.85699	7.10007
9.	4.85699	7.10009
10.	4.85690	7.10001
11.	4.85691	7.10005
12.	4.85690	7.10009
13.	4.85693	7.10011
14.	4.85680	7.10017
15.	4.85680	7.10020
16.	4.85692	7.10000
17.	4.85689	7.09995
18.	4.85704	7.09972
19.	4.85712	7.09970
20.	4.85705	7.09961
21.	4.85707	7.09959
22.	4.85713	7.09963
23.	4.85718	7.09965
24.	4.85723	7.09962

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

G. INCIDENT INFORMATION:

a. Impacted Area Details

- Total calculated area of impact 0.11 Ha
- Impact within R.O.W YES
- Impact outside R.O.W NO

b. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil (V_{rec}):	<u>163</u>	Barrels
------------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

c. Net Estimated Spilled Volume V_{Est} (bbls)* =	<u>175.17 BARRELS</u>
Estimated Reported Volume** V_{rep} (bbls) =	<u>176 BARRELS.</u>

***Notes:**

- Volume estimation was done using an excel based tool (see attached for details on the calculation).
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled volume in the box below:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl — Reported volume = 16 bbl
 Calculated volume = 0.35 bbl — Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl — Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for volume estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

d. General Status of the site

i. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out

ii. Investigation of the incident site showed that there is residual impact on site requiring further works

e. Representatives

This report was filled, agreed and signed by the following joint investigation team representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Asset Owner:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT

INCIDENT NO: 2296972 JIV report S/N: 0255

f. Appendix 1: Overview sketch of the site

