

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: Nº 0000059

(Note: As practicable as possible the JIV report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1484078 2. Type of incident* OIL SPILL
3. Name of Location 20" Rummekepe - Nkpoku PIPELINE
4. Name of nearest community OMUKPOBU 5. State: RIVERS 6. LGA EMOHUA
7. Type of Production facility/Installation OIL PIPELINE
8. Asset owner/District SPDC / PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident
a. Date of incident: 11TH SEPTEMBER, 2015
b. Start date/time of investigation: 16TH SEPTEMBER, 2015 / 11:00 HOURS
c. Investigation End date: 19TH SEPTEMBER, 2015, Actual investigation duration, days: FOUR (4) DAYS
d. Description of spill point environment

- | | | |
|--|-------------------------------------|---|
| <input type="checkbox"/> Firm soil | <input type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water | <input type="checkbox"/> DrillRig | |

Additional observations around the spill point:

JOINT INVESTIGATION TEAM OBSERVED THAT THE CONTAINMENT EARTH BUND WALL AROUND THE SPILL POINT WAS BROKEN BY UNKNOWN PERSON(S) TO APPARENTLY AID THE SPREAD OF CRUDE OIL TO THE ENVIRONMENT

e. Description of leak point (tick as applicable):

- | | | |
|---|--|--|
| <input type="checkbox"/> Drilled hole | <input checked="" type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____). |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve | <input type="checkbox"/> Failed Clamp, | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, | <input type="checkbox"/> Saver-pit over flow | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting | <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Cold vent | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Valve Failure | <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Accidental 3 rd party equipment impact |
| <input type="checkbox"/> Others(specify) _____ | | |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: N° 0000059

g. Spill point coordinates

h. Measuring unit

WGS 84

Northing:	Easting:
4.954519°	6.808028°

C. RISK ASSESSMENT

10. Type of environment:

Land
 Swamp
 Water
 Seasonal swamp
 Shoreline/Waterfront

i. Type of environment to which oil has spread:

Land
 ^{SEASONAL} Swamp
 Water
 River (identify) _____

ii. Weather condition

Rain
 Sunny
 Dry
 Wet
 Windy
 Hot
 Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [.m]
- Drinking water source [.m]
- Built up area [.m]
- Farmlands [.m]
- Fish Farm/Pond [.m]
- Fishing net [.m]
- Others (specify): RAPHA PALM IMPACTED BY SPILL

12. Containment measures put in place:

Booms
 Trench
 Dyke
 Natural depression
 Pit
 None

Others: BUND WALL BUILT AROUND SPILL POINT.

13. Any pictures or video coverage?

N [N]

14. Further response/repair initiated as at the time of JIV?

N [N]

If yes to item 14, give brief description:

REPAIR ON THE AFFECTED SECTION OF PIPELINE WAS DONE BY CLAMPING.

15. Was there any disruption to the investigation?

[Y] N

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: N^o 0000059

If yes to item 15 give brief description:

NOT APPLICABLE.

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
<u>NONE WITHIN AREA OF IMPACT</u>					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	<u>RAPHIA PALM</u>	✓	✓	✓	<u>Many</u>	<u>IMPACTED BY</u>
2	<u>BAMBOO TREE</u>	✓	✓	✓	<u>Few</u>	<u>SPILL WITHIN SEASONAL SWAMP.</u>

18. Fishing Nets/Fish Ponds


S/N	Nets/Ponds	Description	Quantity/Size	Comments
<u>NONE WITHIN AREA OF IMPACT</u>				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
<u>NONE WITHIN AREA OF IMPACT.</u>				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)


SECTION OF 20" RUMUKPE - NKPOKU PIPELINE AS OBUKPOBU IBRA SITUATING POSITION OF HACK SAW CUT (LEAK POINT) AT 2 O'CLOCK POSITION.

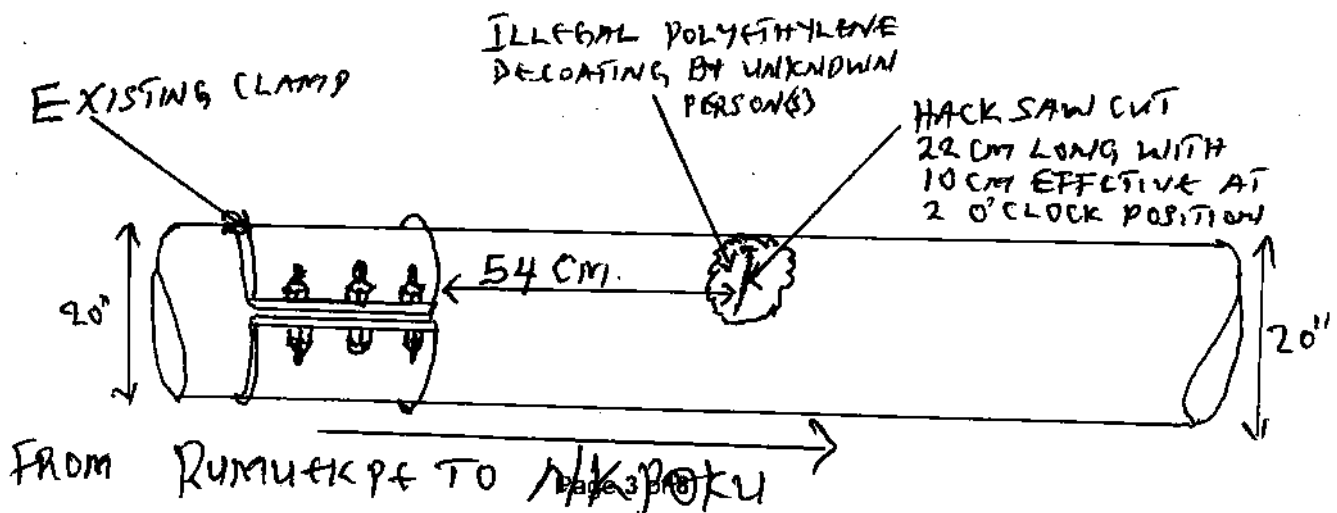

APPENDIX.

1484078_20"RUMU-NKPOKU P/L SPILL@ IBAA.

NAME	EAST	NORTH
1	6.807361	4.954694
2	6.807778	4.954583
3	6.807972	4.954583
4	6.808111	4.954583
5	6.808167	4.954444
6	6.808167	4.95425
7	6.8075	4.95425
8	6.807496	4.95419
9	6.8085	4.953806
10	6.809053	4.953031
11	6.808367	4.95206
12	6.807901	4.949814
13	6.807901	4.948282
14	6.807722	4.947417
15	6.807694	4.947333
16	6.80775	4.947861
17	6.807667	4.948444
18	6.807722	4.948556
19	6.807444	4.949667
20	6.808	4.951972
21	6.807889	4.95225
22	6.807444	4.953111
23	6.807306	4.953083
24	6.807056	4.953444
25	6.806889	4.953639
26	6.807	4.954111
27	6.807482	4.954195
28	6.807486	4.954252
29	6.807222	4.954278
30	6.807194	4.954528
31	6.807278	4.954611
32	6.808	4.9545


23-09-2015

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: **Nº 0000059**

G. INCIDENT INFORMATION:

a. Impacted Area Details

- Total calculated area of impact 5.38 Ha
- Impact within R.O.W YES
- Impact outside R.O.W YES

b. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>NIL</u>	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

c. Net Estimated Spilled Volume V_{Est} (bbls)* =

636.98 BARRELS


Estimated Reported Volume V_{rep} (bbls) =**

637 BARRELS

***Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

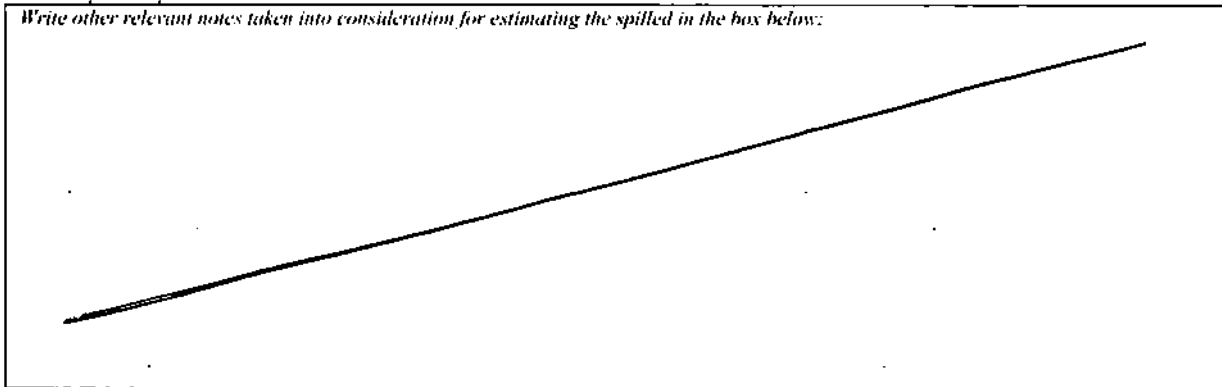

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for volume estimation, record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: N^o 0000059

d. General Status of the site

i. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
ii. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

e. Representatives

This report was filled, agreed and signed by the following joint investigation team representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Asset Owner:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings:

Tick as applicable

JOINT INVESTIGATION REPORT

INCIDENT NO: 1484078 JIV report S/N: Nº 0000059

f. Appendix 1: Overview sketch of the site

