THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED 0230 825366 JOINT INVESTIGATION REPORT FOR INCIDENT NO: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 2.Type of incident * 011 3. Name of Location 4. Name of nearest community RERA 5. State: RIVERS 6. LGA GOKANA 7. Type of Production facility/Installation DI PIPELINE 8. Asset owner/ District NPE **B. INCIDENT INFORMATION:** 9 Details of incident a. Date of incident:__ b. Start date/time of investigation: 2012. c. Investigation End date: 974 d. Description of spill point environment Firmed soil Loose soil Previously excavated area Under water □ Swampy ☐Exposed pipe surface Well Plateform (on Water) \square Rig e. Description of leak point (tick as applicable); Drilled hole Hack saw cut ☐Explosive tear, Complete Rupture ☐ Inward dent, ☐ Well head tampering ☐Failed Weld-on illegal hot tap valve, ☐ Missing Pipeline/Flowline) □Crude oil theft (illegal) bunkering) point, ☐ Third party tampering with Clamp ☐Third party tampering with valve setting, ☐ Third party tampering with flange, □Corrosion ☐Saver-pit over flow, ☐ Surge vessel overflow Outward dent ☐Flare System/Bund wall failure □Valve Failure Com unit failure ☐ Cold vent Relief valve failure Others (specify) f. Incident caused by: Third party interference ☐ Operational ☐Mystery_ g. Spill point coordinates IN - BELT (MMN4) Measuring unit METER Northing: Easting: 75885.04

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1230 825366

Ç.	RISK ASSESSM	IENT					•	
	10. Тур	pe of environment:						
	√ Land	☐ Swamp	□ Water	□ Seaso	nal swai	mp		
	і. Турс	e of environment to	which oil has sp	oread:				
	✓ Land	□ Swamp	☐ Water	□ River	(identify	y)		
	ii. Wea	ther condition						
	☐ Raining	Sunny n the nearest sensiti	ve habitat					
	☐ Drinking ☐ Built up : ☐ Farmland ☐ Fish Farm ☐ Fishing r ☐ Others (s	ds m/Pond net	ice;		[[[N]]_ [[,m] ,m] ,m] ,m] ,m]	FARMIAND BURNT BY FIRE	
	☐ Others:			,				
	13. Any pictures	or video coverage?			[Y]	[N]	1	
	14. Was there any	y disruption to the i	nvestigation?		[Y]	[N]	/	
Ify	yes give brief descri	iption:						
	No	T	API	PLI	\mathbb{C}^{p}	4 [3LE	-

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
+		13	 , , , , , ,	OT A CE	5 L. DAGT
			IN A	KEA U	- IMPACI
H					

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0230 825366

16. Crops/Economic Trees

S/N ⁷	Type of crops	Young	Medium	Matured	Quantity	Comments
	AVA	1				IMPACTED
7	YAM	~			NUMBROW	DUE TO
3	PALM TREES		•			FRE
4	MELON	/				INCIDENT
5.	7. Fish/Nets/Por	nde	✓			·


S/N	Fish/Nets/I	Ponds	Description		Quantity/	Size	Comments
M	ONE	ΓW	HIN /	REA	OF	M	PACT

18. Others (Specify) i.e. Animal Traps

S/N Others		Description			Quantity/Size		Comments	
i \	<u> </u>	\		 		4	<u> </u>	
	THE	$\Delta \Delta D$	HIN	AKE	A OF		APA CT	
1		, A A		7 11 1				

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 24" NKPOKU-BOMU PIPELINE AT BERA SHOWING POSITION OF HACKSAW CUT.

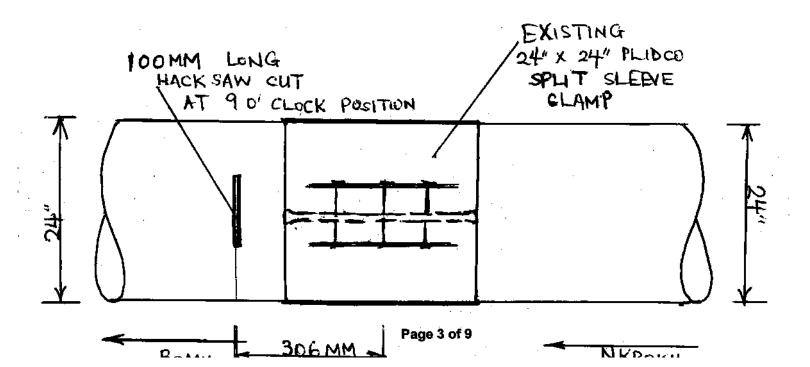

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO:__

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19.	Impacted area boundar	y Coordinates (If more than I	2 points, Attach as an appendix 2)
1/.	mibacas area commen	,	- position,

19.	Impacted area boundary Coordina	tes (If more than 12 points, Attach as an appendix 2) 1 ETERS (110-6ELT) 1	م∛د دا
S/N	Northing	Easting	******
Ĺ	758\$5.84	535031.40	
2	75888 - 13	535028.34	<u>.</u> ا
3	75894.26	535034.51	ı
4	15906.56	535031.45	
5	75 900 · 39	535043.77	
6	75891.17	535046 .83	
7	75872.75	535043.72	
8	75872.76	535037.55	
9	75903.48	535034.53	
10	75897.32	535040.68	
[]	75888-12	535034.50	
12	75885.05	535034.49	
13	75 888-12	53 <i>5</i> 037.50	

G. INCIDENT INFORMATION:

20. Impacted Area Details

Total calculated area of impact O:04HA	
Impact within SPDC R.O.W	
Impact outside R.O.W	
21. Volume of oil recovered before completion of JIV (V _{rec.J}):	
Recovered oil Viecr	barrels
20. Computation of the residual volume on site	
a. Computation of volume of pool of free phase oil (on land or confined water bod i. Area (m²) occupied by pool of free phase oil	ly).
# Average Death (m) of pool of free phase oil 020	

		_			IY OF NIGERIA LIMIT	
	JOINT INVES	STIGATION REF	ORT FOR INCIDE	NT NO:_	<u>0230 825</u>	366
	iii. Emulsification	4	11L			
•	iv.	Volume of	pool of free phase oil	V poor	25.16	barrels
<u>-</u>	b. Computation i		trated oil in the soil (V _{inf}).	140	
10	IAL ii	i Area of the po	ool of free phase oil i	in touch w	rith soil: 26	
AREA	I BURNT ii					0.05
BY 1	FIRE = i	v Soil type:	CLAY		0.1	
400	_	P _e (effective	porosity of the soil).		<u> </u>	
Tot		v. Volume	of infiltrated oil. V_t	nf.	4.03	barrels
•		-61		ad an ata	•	
	21. Computation i. Total area of	of volume of on of oil on open wat		sed on sta	indard coloradon.	
BURN.	# Table of ave	-	on water based on color	ation **		
OIL-			·	_		
	rrated	Thickness (mm)	Percentage coverage		Volume (m3)	
ARE	Barely Visible	0.00004				_
15	Silvery	0.00008	1 1	_		_
ABou	Slight Color	0.00015) 		4
_	· Dright Color	0.0003	. * •	1		\dashv
40%	oF Dull	0.001	1551	 d		-
4001	Dark Blackoil	0.002 0.1	 AYY 	1 (1	ARIF	\dashv
• -	Emulsion (30% Oil)		 	<u></u>	/ \ \ \ \	
= 16	€ M ² ,	Percent Total		100%	Total Volume	ьы
, C		Volume of o	il on open water. V	wat	Nii	barrels
	22. Calculation o	f evaporated vo	lume:	<u> </u>		
	i. Oil t	ype: BONN	Y MEDIUM			
	ii. E-Fa	actor: 15%	<u></u>			
	iii.	Volume of e	vaporated oil. V evap:	2 5.15	5.15	barrels
			> C CDD-C C - 1	_:1		
	Evapora Oil Type	Days on site	tor) for SPDC Crude Bonny Light	Oil Bonny		
	On Typo	Days on site	Domy Digit	Medium		
	Period Since Oil Spill	< 1 day	10%	5%		
		1-7 days	25%	15%	5	

40%

Раде	5	ωf	9	

25%

>7 days


^{*}If area is not same as the total area of impact, please indicate in the overview sketch

** Spill Factor from USCG FOG (2000 Edition)

JOINT INVESTIGATION REPORT FOR INCIDENT NO:	0239	82536	6
			
23. Gross Total Estimated Spilled Volume $V_{\text{Est}}(bbls) = V_{\text{evap}}(bbls) + V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{\text{pool}}(bbls) + V_{\text{rec}}(bbls)$	는 호텔 25 (bbls) .	>+ NIL+	ት 23ተ የሀንሱ
- (bble)		<u></u>	= 34.34
24. Net Total Estimated Spilled Volume			
24. Net lotal Esumateu Spineu Volume	راند <u>ج</u> (bble) با	52-16+ Ni 54 NIF+ 4	TOST Lakan
$V_{Est}(bbls) = V_{evap}(bbls) + 0.6*V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{$	· • reci (0015)		- 3+-3+
VEst(bbls)= 34.3 BARRELS *Calculation of the respective estimated volume is to be done on site as far as pro-			
estimation software on site			
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oi	1.		
25. GENERAL STATUS OF THE SITE			
A. Joint investigation of the incident site found that there	is no resid	dual impact	after the
initial response and therefore recommend that the site be			
B. Investigation of the incident site showed that there is re	 esidual imi	act on site	requiring
further works			, -
26 REPRESENTATIVES			
	20 12 at i	ncident site	by joint
investigation representatives from			
Host Community ✓			
• Department of Petroleum Resources [DPR]:			
National Oil Spill Detection and Response Agency	NOSDR	A]: 🗤	
State Ministry of Environment [SME]:			
Nigeria Police Force [NPF]:□			
• Shell Petroleum Development Company [SPDC]: 5	y		
	-		
		Tick as	applicable_

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0230 825366

27. Appendix 1: Overview sketch of the site

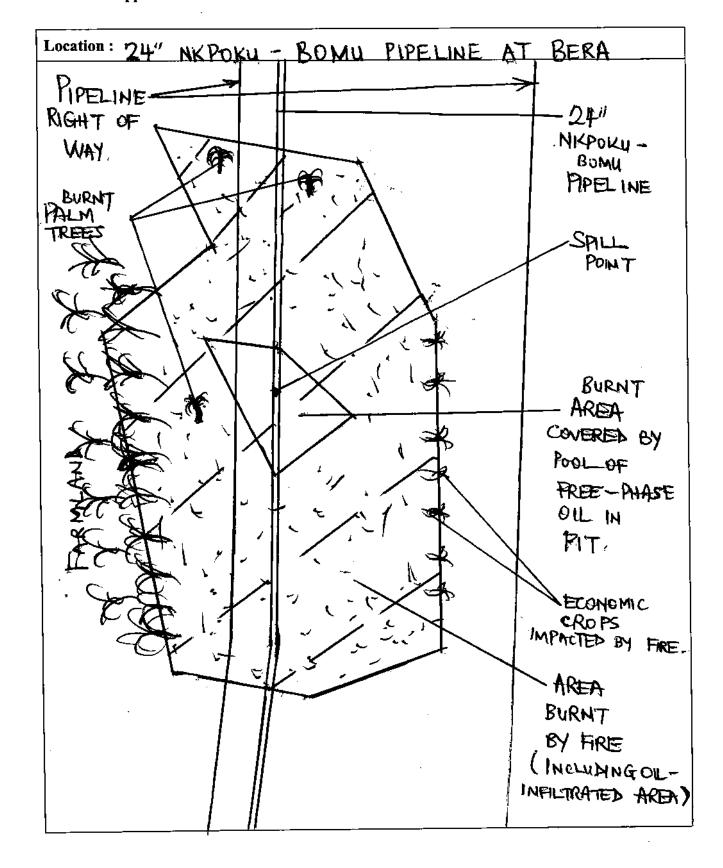

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0230 8 25366

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING
JIV FOR AREA CALCULATION

THETERS (1) WORTH

		THETERS (VI)-DELTIMIN
S/N	Northing	Easting
14	75 855 04	535040.66
15	75 855 · 04 75 881 · 97	535040·66 535037·57
·		
-		
$\overline{}$		
/		