### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)				
A. GENERAL INFORMATION:				
l. Spill incident Number: 8741	16 2.Type	of incident * TL SPILL		
3. Name of Location 28" Bomy -	- BONNY TRANS	NIGER PIPELINE!		
4. Name of nearest community OK	5. State: R	Asset owner/ District NESP SWAMP		
7. Type of Production facility/Installation	OIL PIPELING 8	Asset owner/ District NESP SWAMP		
B. INCIDENT INFORMATION:				
a. Date of incident:  a. Date of incident:  b. Start date/time of investigation:  c. Investigation End date:  d. Description of spill point environn  Firmed soil  Under water  Well Plateform (on Water)  e. Description of leak point (tick as a Drilled hole  Complete Rupture  Failed Weld-on illegal hot tap of Crude oil theft (illegal) bunker  Third party tampering with val  Corrosion  Outward dent  Valve Failure	mbbl, 2012 THE (70bbl, 2012) THE (70bbl, 2012) Thent  Loose soil Swampy  pplicable);  Hack saw cut Inward dent, valve, ing) point,	Previously excavated area □Exposed pipe surface □Rig □Explosive tear, □ Well head tampering □ Missing Pipeline/Flowline) □ Third party tampering with Clamp □ Third party tampering with flange, □ Surge vessel overflow wall failure		
Relief valve failure  f. Incident caused by:	☐Others (specify)			
Third party interference	☐Operational	□Mystery		
g. Spill point coordinates  Measuring unit METER  Northing:  LEAKING 5584	(MINNA MIS- 37.36	6E(7) Easting: 528931-00 528939.62		

Page 1 of 9

<sup>. \*</sup>This can be a) Oil spill b) Drilling fluid/Chemical c) siltation d) construction e) Encroachment f) Fire,

### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED 0359-874116 JOINT INVESTIGATION REPORT FOR INCIDENT NO: C. RISK ASSESSMENT 10. Type of environment: Water Swamp ☐ Land ☐ Seasonal swamp i. Type of environment to which oil has spread: Water Swamp □ Land ☐ River (identify) ii. Weather condition **⊠** Raining Sunny 11. Distance from the nearest sensitive habitat ☐ Government reserved and designated protected area ,m] ☐ Drinking water source ,m] ☐ Built up area ToM ,m] ☐ Farmlands ,m] ☐ Fish Farm/Pond ,m] ☐ Fishing net ☐ Others (specify). 12. Containment measures put in place; Booms ☐ Trench □ Dyke \_ ToN APPLICABLE 13. Any pictures or video coverage? $[Y] \checkmark [N]$ 14. Was there any disruption to the investigation? [Y] [N]If yes give brief description: D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL 15. Structures / Properties Type of Structures S/N Description Size Number Comments

### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO:\_\_\_

0359-874116

### 16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
		A 1 2 7 . (			× (10 6 6	<i>f</i>
	MONE -	MI (TTIN	ARCA		IXIVAC	<u> </u>
<b>·</b>				-	( , ( ,	
1			_		<u> </u>	

#### 17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	ENE WITH	IEN AREA	ET IMPA	et

### 18. Others (Specify) i.e. Animal Traps


S/N Others	Description	Quantity/Size	Comments
NONE V	LITTIN AREA	of IMP	ieT-

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

GRAPHIC SKETCH OF LEAK POINT ON 28" BOMU- BONNY TRANS NIGHE

# PIPELINE AT OKOLO SHOWING LEAK CAUSE. FOUR (4) 6" BUNKERING FITTING INSTALLED ON

TOUR (4) 6" BUNKERING FITTING INSTALLED OF 28" BEMU-BONNY TRANS NIGER PIPELINE AT DKELE LAUNCH AT 12 CLOCK PESITION.

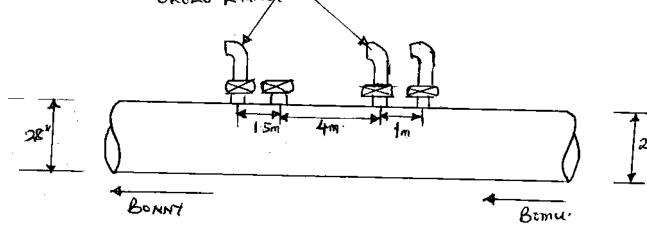

# THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0359 - 87416

# F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2) M. D. D. D. T. M. D. D. T.

	MINNA I	MID-BELT
S/N	Northing (METREE)	MID-DELT Easting (METRE)
PT1	55866.55	528736.74
PT2	55854.71	528787.09
PT3	55 888 77	528833.01.
P14	55888.77	528902.62
PTS	55882.85	528945.57
P16_	<i>5</i> 5833.97	528961.86
P77	55 731 . 78	528881.88
PT8	55708.08	52888633
179	55511.95	529049.89
1710	55450.66	528966 <i>5</i> 5
PTII	55751.03	528714.52
PT12	56087.62	528329.55
P713	55992.37	528462.74

### G. INCIDENT INFORMATION:

<ol><li>Impacted</li></ol>	Area	Detail	lş
----------------------------	------	--------	----

	626 Hg.	<del></del>
Impact outside R.O.W	TES.	<u> </u>
21. Volume of oil recovered before completion of JIV	(V <sub>rec.j</sub> ):	_
Recovered tall Y <sub>ne</sub> I	25	barrels
20. Computation of the residual volume on site		
<ul> <li>a. Computation of volume of pool of free phase oil (on lar         i. Area (m²) occupied by pool of free phase</li> </ul>	nd or confined water body). oil2 o 7 m	
ii. Average Depth (m) of pool of free phase	oil <u>C 6 1 11</u>	_

#### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED 0359 - 874116 JOINT INVESTIGATION REPORT FOR INCIDENT NO: 30 T~ iii. Emulsification factor: ív. Volume of pool of free phase oil. V pool: II barrets Computation of volume of infiltrated oil in the soil (V<sub>inf</sub>). 19.847 m2 Area \*(m²) covered by the oil:\_\_\_ ii NIL Area of the pool of free phase oil in touch with soil: iii Average Depth (m) below ground surface of infiltration of oil: C · C 2 Soil type: CLAY 8 70 $P_{\rm c}$ (effective porosity of the soil). Volume of infiltrated oil. Vinf 19 · 97 barrels 21. Computation of volume of oil on open water based on standard coloration. i. Total area of oil on open water: 86, 190 m<sup>2</sup> Table of average depth of oil on water based on coloration \*\* ii. **Thickness** Percentage <u>(mm)</u> coverage Volume (m3) **Barely Visible** 0.00004 Silvery 80000.0 Slight Color 0.00015 **Bright Color** 0.0003 0.001 Dull 80 % 0·138 m3 Dark 0.002 20% ∙724 ო<sup>3</sup> Blackoil 0.1 Emulsion (30% Oil) 1 u 100% Total Volume bЫ Percent Total Volume of oil on open water. Vwas 71 barrels 22. Calculation of evaporated volume: Oil type: BONNY LIGHT 25% E-Factor: ii. iii. Volume of evaporated oil. V evap: barrels

Evaporation Factors (E-Factor) for SPDC Crude oil				
Oil Type	Days on site	Bonny Light	Bonny Medium	
Period Since Oil Spill	< 1 day	10%	5%	
	1-7 days	25%	15%	
· <u>-</u>	> 7 days	40%	25%	

### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

 $\frac{V_{\text{Est}}(\text{bbls}) - V_{\text{evap}}(\text{bbls}) + 0.6*V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{recl}}(\text{bbls})}{V_{\text{Est}}(\text{bbls}) - 23 \cdot 28 + (11.71 \times 0.6 \text{ GeV}) + (4.4 + 19.97) + 9.11 + 25 = 88.41 \text{ Backely}}$ 

\*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site

\*Conversion of m3 to barrels is Total volume VT (m3) x 6.29

\*Emulsification factor for spill on water to consider is 60% of volume of oil.

### 25. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
- B. Investigation of the incident site showed that there is residual impact on site requiring further works

#### 26 REPRESENTATIVES

This report was filled and signed on the investigation representatives from

- Host Community ☑
- Department of Petroleum Resources [DPR]: ☑
- National Oil Spill Detection and Response Agency [NOSDRA]: 

  ✓
- State Ministry of Environment [SME]: ☑
- Nigeria Police Force [NPF]:


  ✓
- . Shell Petroleum Development Company [SPDC]: ☑

Tick as applicable

### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGHTING LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 87411 6

27. Appendix 1: Overview sketch of the site

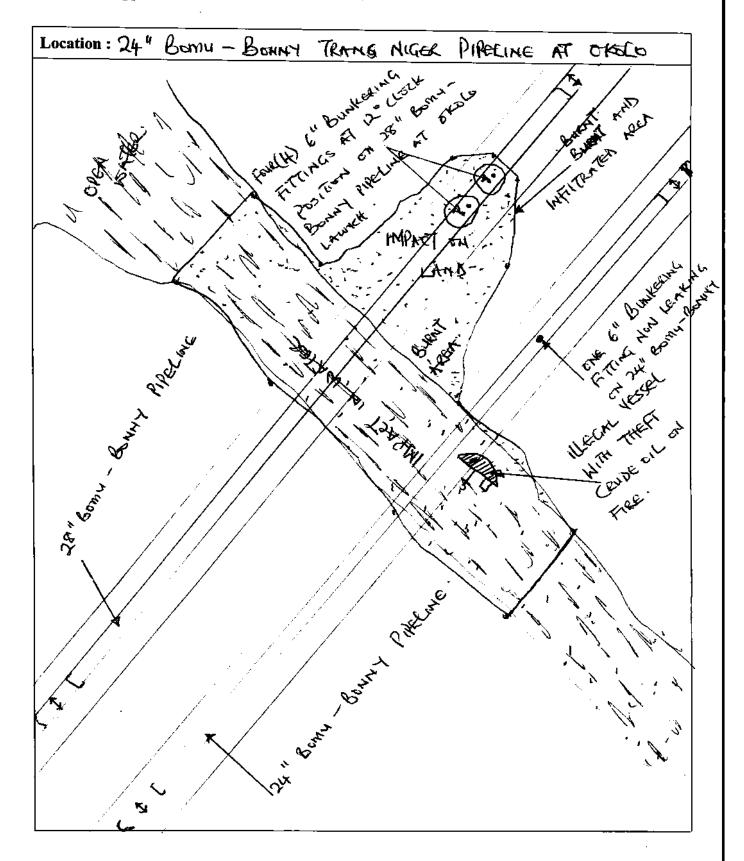

# JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0359 -874116

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

	<u></u>	-Bert)
S/N	Northing (netter)	Easting (METCEL)
P114	56161-24	5)8388.25
<u> </u>	-	·