JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1054 978 3. Name of Location 6" OBIGBO NORTH - EBUBU 5. State: RIVERS 6. LGA ELEME 4. Name of nearest community OROLO 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE **B. INCIDENT INFORMATION:** 9. Details of incident a. Date of incident: 127H DCTOBER b. Start date/time of investigation: 13TH c. Investigation End date: 14TH of TOBER Actual investigation duration, days: TWO (2) DAYS d. Description of spill point environment 2013 Firmed soil Loose soil Recently excavated area MB. PIPE COATING DESERVED TO BE INTACT AROUND SPILL POINT. Under water □ Swampy Exposed pipe surface □Well Platform (on Water) ☐Drill Rig e. Description of leak point (tick as applicable); ☐Drilled hole Hack saw cut Tear (Complete Rupture ☐Inward dent, ☐Well head tampering ☐ Failed Weld-on illegal hot tap valve. ☐ Failed Clamp ☐Missing Pipeline/Flowline

☐ Third party interference (Sabotage☐; crude theft☐; Line theft☐; Accidental 3 rd party damage☐) ☐ Others (including Mystery spills)							
g. Spi	ll point coordinates Measuring unit	Minna -	Mid belt				
	Northing:		Easting:				
	SP						
ı	86733.80		520530.51				

Saver-pit over flow.

Others (specify)

□Valve Failure

□Flare System/Bund wall failure □Accidental

☐ Third party tampering with Clamp

☐ Third party tampering with flange,

party

Cold vent

☐Surge vessel overflow,

Com unit failure

Crude oil theft (illegal bunkering) point,

Third party tampering with valve setting,

Corrosion

Bulging Outward

Relief valve failure

equipment impact

f. Incident caused by:

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

C. KI	コレ せうりこうう	MENI					
	10. T	ype of environment:					
	Land	□ Swamp	□water	□Se	asonal swamp	Shoreline/Wa	terfront
	i. Ty	pe of environment to	which oil has	spread:			
	Land	☐ Swamp	□Water	□Ri	ver (identify)		
	ii. Wo	eather condition					
11	☐Rain . Distance fro	Sunny om the nearest sensit	□Dry ive habitat	□Wet	□Windy	□Ḥot	□cool
17	Drinkin Built up Farmlan Fish Fa Ofthers	nds rm/Pond	AIN TREES		[,m] [,m] [3 ,m] [,m] [,m]	М сте) (sy spill,
12	Booms Others:	Trench	_	□Na	ntural depression	Pit	
13	. Any picture	s or video coverage?	•		[N] [N]		
14	. Was there a	ny disruption to the	investigation?		[Y] [N]		
If yes g	give brief desc	ription:					
	1	T	A	PPL	_10/	ABL	E
D. TY	PE/NUMBE	RS OF PROPERTI	ES, IF ANY, I	OUND WI	THIN THE ARE.	A OF SPRE	AD OF OIL
15	. Structures	/ Properties					
e/NI	Type of Street	inturne Docarie	tion Size	Maren	·h	1 Campani	

S/N	Type of Structures	Structures Description		Number	Comments
1	JONE	WIT	HIN	AREA	OF MPACT
Ľ				<u> </u>	

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
Ц.	PLANTAIN				9 No.	WITHIN
	<u></u>					SPILL-IMPACTED
2.	COCONUT			/	_ INO_	REGION
3.	PAWPAW				INO	

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments			
	JO NE	WITHIN	ARE	+ OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	_	Quantity	/Size	Comm	ents	
	\	\	4					-
	DVE		Δo	A	0		MPACT	
	*OTYL	PETTURE	770	C/1			HYLITC L	

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 6" OBIGBO-NORTH PIPELINE AT BUBY OBOLO SHOWING CORROSION LEAK AT 30' CLOCK POSITION.

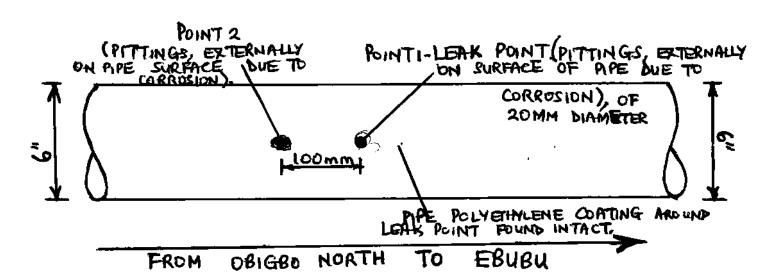

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

19. Impacted area boundary Coordinate (If more, Print and attach as an appendix)

	, , , , , , , , , , , , , , , , , , ,	ng-Mad belf.
S/N	Northing (M)	Easting (M)
691	86739.92	520 539.77
692	86733.79	520 533 . 59
693	86730.74	520 524.34
694	86743.03	520524.37
695	86746.07	520 539. 78
6960	86746.07 86745.11 86746.96	520543.17
6961	86746.96	520 542 - 16
6970	86756.22	520 573 · 54
6971	86 754.37	520573.91
698	86743.01	520533.61
699	86 739.96	520521.28
700	86739.97	520518.20
761	86 739.92	520 539.77
		G/V1

G. INCIDENT INFORMATION:

20. Impacted Area Details

•	Total calculated area of impact_	0.02568/hg (0.03hg)
•	Impact within SPDC R.O.W_	Jes
•	Impact outside SPDC R.O.W	No


21. Volume of oil recovered before completion of JIV (Vrect):

				Recovered	d oil V _{rec} j:	2			Barrels
22 1	Computati	on of	ectimated rea	sidual volume	a on site				
				ne of pool of fi		(on land or	confined	water bod	v).
	i.	Area	(m²) occupied	by pool of fre	e phase oil _		12		2,7*
	ii.	Aver	rage Depth (m	ı) of pool of fro	ee phase oil_		0.006)	
	iii.	Emul	sification fact	or: N	IJ <u></u>				
	iv.	Γ	Estimated V	olume of pool	l of free phas	e oil.			barr
				V _{pool} :			0.4	-5	
b. •				ne of infiltrated iltrated oil at s				_	
	i.	Area*	* (m²) of soil of	covered by the	oil:	1			
	ii.	Avera	age Depth (m)	above leaking	g facility i.e.	pipeline/flo	wline:	1	
	iii.	Soil t	ype: 211	iv.	P_{ϵ} (effective	porosity of	f the soil).		
	v.			erational			· •		
	vii.			on site, day:_				D	
	viii.			nfiltration belo			peline/flov	wline: 🏚	. nnl
	ix.			infiltration arc		_	064	_	
		х							_
		E	Estimated Volu	ume of infiltra	ted oil at spil	l point. V _{in}	Cai 1	• .33	ba
	2. Esti	mated V	Volume of inf	iltrated oil at s	econd spill p	oint [if app	licable] (V	/inf b)	
	i.	Area*	(m²) of soil o	covered by the	M:				
	ii.	Avera	ige Depth (m)	above leaking	facility i.e.	oipeline/flo	wline:	ا م	
	iii.	Soil t	ype:	<u>(</u>	P _e (effective	porosity of	the Gil).	40	<u></u> _
	v.	Cause	of spill:	110	vi. Oil ho pe	$L\Omega\alpha$	→		
	vii.	Oil R	esidence time	on site, day:_	\	٠ (۲			
	viii.	Avera	ige depth of in	ifiltration belo	w leaking a	cility i.e. pi	peline/flov	vline:	
	ix.			infiltration aro					
		Estima	ted Volume o	f infiltrated oil	at spill poin	t. V _{inf h} :			barrels
	3. E		<u>.</u>				Nir	<u>, </u>	
	stim	ated Vo	olume of infilt	trated oil outsid	de immediate	spill point	(s) region	(Vinf c)	
	i.			overed by the o		24	4	. ,	
	ii.		_	ol of free phas		with soil:	1	2	
	iii.		_	below ground		-	f oil:	0- pot	<u></u>
	iv.		ype: ζ_1	_				 	<u></u>
	v.	_	-	ity of the soil).	21%	4			
		vi.		d Volume of i		At Vinf:	_		Ъ
								0.31	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

ii. Table of average depth of oil on water based on coloration (

**Spill Factors from USCG FOG (2000 Edition)

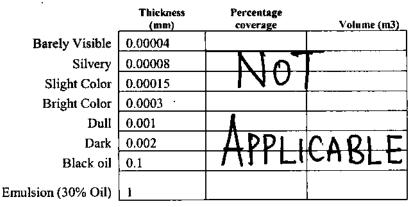

Percent Total 100%

Estimated Volume of oil on open water. V_{wat}: N1L Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 4-09 BARRELS
- ii. E-Factor: 15%

iii. EstimatedVolume of evaporated oil. V_{evap}: Barrels

Evaporation Factors (E-Factor) for SPDC Crude oil							
Oil Type	Days on site	Bonny Light	Bonny Medium				
Oil Residence time	< 1 day	10%	5%				
	1-7 days	25%	15%				
	> 7 days	40%	25%				

25. Net Estimated Spilled Volume
$$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls) = 6.72 + NIL + 1.64 + 0.45 + 2 = 4.81$$

Estimated Reported Volume** $V_{rep}(bbls) = 5$ BARRELS

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of | l bbl | is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 14/10/2013 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]: S
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: 5
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

28. Appendix 1: Overview sketch of the site

Location :	6"	OBIGBO	NORTH	PIPELINE	AT	OBOLO
				·	•	
					<u>.</u>	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1054978 JIV report S/N: 0284

