JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1057935 2. Type of incident\* OIL SYILL 3. Name of Location 14" OKORDIA - RUMUELEPE PIPELIME 4. Name of nearest community Alcaravirul 5. State: RIVERS 6. LGA AHORDA WEST 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE **B. INCIDENT INFORMATION:** tails of incident

a. Date of incident: 19<sup>TH</sup> OCTOBER 2013

b. Start date/time of investigation: 23<sup>RD</sup> OCTOBER 2013 / 10:03 AVO 9. Details of incident c. Investigation End date: 23 RA OCTUBER 2 AGual investigation duration, days: UN + 1 d. Description of spill point environment Loose soil Recently excavated area ☐Firmed soil ☐Under water □ Swampy Exposed pipe surface Well Platform (on Water) Drill Rig e. Description of leak point (tick as applicable); Drilled hole ☐ Hack saw cut Tear ( Complete Rupture ☐Inward dent, ☐Well head tampering Failed Weld-on illegal hot tap valve, DFailed Clamp ☐Missing Pipeline/Flowline Crude oil theft (illegal bunkering) point, ☐ Third party tampering with Clamp Third party tampering with valve setting, Third party tampering with flange, Corrosion ☐ Saver-pit over flow. ☐ Surge vessel overflow. ☐Bulging Outward Flare System/Bund wall failure Accidental party Cold vent equipment impact ☐ Valve Failure Com unit failure Relief valve failure Others (specify) f. Incident caused by: Third party interference (Sabotage□; crude theft☑; Line theft□; Accidental 3<sup>rd</sup> party damage□) Others (including Mystery spills)\_ ☐ Operational g. Spill point coordinates Measuring unit Northing: Cm)

<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: 0292

C.	RISK ASSE	SSMENT						
	10.	Type of env	rironment:					
	<b>L</b> an	d 🗖 :	Swamp [	∃Water	Seasonal sv	vamp <b>\</b> S1	noreline/Wate	erfront
	i.	Type of envi	ronment to which		ıd:			
	<b>Z</b> Lan	d 🗖 S	Swamp [	Gipter division	☑River (iden	tify)_ <b>()</b> }	278H1	RIVER
	ii.	Weather con	dition					
	□Rain 11. Distance		unny [ rest sensitive ha	•	Wet □W	indy	□Hot	□cool
	□ Drir □ Buil □ Farn □ Fish	nking water so It up area	rved and design ource	ated protected	i ~ [<1: [< / [<4	7 ,m] 7 ,m] 0 ,m] 18 ,m]		
	12. Contains	ment measure	s put in place;					
	⊠Boo □Othe	ms 🔲 7	Trench	Dyke	₩ Natural dep	ression	□Pit	
	13. Any pict	tures or video	coverage?		W	[N]		
	14. Was then	re any disrupt	ion to the invest	tigation?	[Y]	<b>W</b> T		
If ye	s give brief d	lescription:						
_	1/07	A	1771	CAB	LE.			
D. 1	TYPE/NUME	BERS OF PR	OPERTIES, II	F ANY, FOUN	D WITHIN TH	IE AREA	OF SPREAD	D OF OIL
		es / Properti						
S/N	Type of S	Structures	Description	Size	Number		Comments	
<u> </u>	REGIDE		- Description	IQDM	3	-	LM PACT	TE 354
	2541L			137			<b>A</b>	1440
			-	<del> </del> -	<u> </u>	<u></u>		
			1		-r			I

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: 0292

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	CASSAVA			1	Ftw	ALL
2	PARM TREE			1/	3	INPACTED
3	DHANGE TAKE			1	2	By 012
4	BAN/AMA GUANA TRH	\ \_	1		Fent	SPILLED
5	GUAWA TREE	,		1	1	<u> </u>

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
1	PONID AND FISH	FISH POND	33.2M2	IMPACTED BY OIL
<u> </u>				SPIRLED.
<del></del>			<del> </del>	
_	<u> </u>			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
<u> </u>				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

ECTION OF 14" OKORDIA - RUMWEKTE PIPELINE ATAXARAMINI SHOWING OSITION OF CRUDE OIL THEFT POINT INSTALLED AT 12 O'CLUCK POSITION.

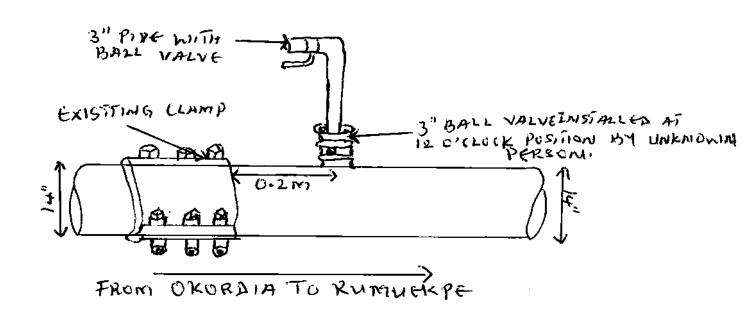

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: 0292

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	Mininu	A MID BELT
S/N	Northing (m)	Easting (m)
55	123956.85	447496 36
56	123972 - 20	447502.57
57	123975 · 31	447490 25
58	123972 · 13	447524 · 14
59	123981. 35	447524 · 17
60	123975.08	447564 20
61	123922 03	447822 . 85
62	123928 - 23	447804. 38
63	123930 . 90	447826 09
64	123987 49	447524. 18
65	12-3978 · <u>33</u>	447505-67
66	123981 . 43	447499 · 52
67	123984 . 51	447496.45
E&	123987 · 62	447484.13
ଣ	123993 81	447471.83
76	124006.09	447474.95
71	124015 · 41	447491-08
72	123993 93	447431-77
73	124003-18	447422.56
74	124006.24	441425.65
75	124006 - 25	447422.57
76	129003.22	447410 . 23
77	124015.67	447357 89
78	124084.18	447336 - 38

ATTACHED IS COMPLETE COORDINATE -

## 20. Impacted Area Details

•	Total calculated area of impact_	0.56Hq
•	Impact within SPDC R.O.W	168
	Impact outside SPDC R O W	VES

21. Volume of oil recovered before completion of JIV (V<sub>reci</sub>):

14" OKORDIA-RUMUEKPE TRUNKLINE SPILL @ AKARAMINI				
INCIDENT NUM		<u> </u>		
IMPACTED AREA	COORDINATE			
MINNA MID BELT				
POINT	NORTHING(m)	EASTING(m)		
55	123956.85	447496.36		
56	123972.20	447502.57		
57	123975.31	447490.25		
58	123972.13	447524.14		
59	123981.35	447524.17		
60	123975.08	447564.20		
61	123922.03	447822.85		
62	123928.23	447804.38		
63	123930.90	447826.09		
64	123987.49	447524.18		
65	123978.33	447505.67		
66_	123981.43	447499.52		
67	123984.51	447496.45		
68	123987.62	447484.13		
69	123993.81	447471.83		
70	124006.09	447474.95		
71	124015.41	447441.08		
72	123993.93	447431.77		
73	124003.18	447422.56		
74	124006.24	447425.65		
75	124006.25	447422.57		
76	124003.22	447410.23		
77	124015.67	447357.89		
78	124034.18	447336.38		
79	124015.76	447330.16		
80	124015.71	447345.57		
81	124003.24	447404.07		
82	124000.16	447404.06		
83	123997.08	447407.13		
84	123987.79	447431.75		
85	123975.45	447447.12		
86	123953.95	447443.97		
87	123944.66	447465.51		
88	123963.04	447484.05		
91	123969.13	447502.56		
92	123962.99	447499.46		
94	123981.70	447413.25		
95	123984.75	447419.42		
96	123993.97	447419.45		
97	123966.30	447422.44		
98	123978.59	447425.56		

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: Recovered oil V<sub>recf</sub>: Barrels M1 $^{\prime\prime}$ 22. Computation of estimated residual volume on site a. Computation of estimated volume of pool of free phase oil (on land or confined water body). Area  $(m^2)$  occupied by pool of free phase oil  $1, 2 \infty$ Average Depth (m) of pool of free phase oil 0.018 iii. Emulsification factor: ίv. Estimated Volume of pool of free phase oil. barrels 135-86 V<sub>pool</sub>: Computation of estimated volume of infiltrated oil in the soil (Vint). 1. Estimated Volume of infiltrated oil at spill point (Vinf a) Area\*  $(m^2)$  of soil covered by the oil: i. ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: iv.  $P_e$  (effective porosity of the soil). 8 % iii. Cause of spill: WERTCRENCHI. Oil type: BUNNY MEDIUM v. Oil Residence time on site, day: 4 DAY vii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.0011 147 viii. 2.0011M Estimated depth of infiltration around spill point: ix. Estimated Volume of infiltrated oil at spill point. Vinf a: 03 barrels 2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b) i. Area\* (m2) of soil covered by the oil: \_\_\_ ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: (effective porosity of the soil). iii. ٧. vii. Oil Résidènce time on site, day: viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: ix. Estimated depth of infiltration around spill point: Estimated Volume of infiltrated oil at spill point. Vinf b: barrels  $M_{i}$ L 3.  $\mathbf{E}$ stimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c) Area (m2) of soil covered by the oil: i. Area (m<sup>2</sup>) of the pool of free phase oil in touch with soil: 1200ii. iii. Average Depth (m) below ground surface of infiltration of oil: 0.001L Soil type: (ムA-/ iv.  $P_{\rm e}$  (effective porosity of the soil). Estimated Volume of infiltrated oil, At Vinf. barrels - 09 23. Computation of estimated volume of oil on open water based on standard coloration.


i.

Total area of oil on open water:

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057-935 JIV report S/N: 0292

ii. Table of average depth of oil on water based on coloration (

\*\*Spill Factors from USCG FOG (2000 Edition)

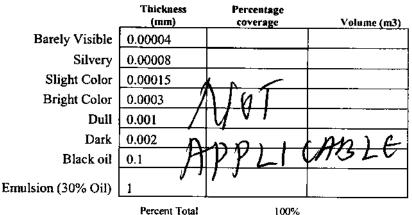

iii. Percent Total 100%

Estimated Volume of oil on open water. V<sub>wat</sub>: M/L Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 142-98 BARRELS
- ii. E-Factor: 15 %

iii. EstimatedVolume of evaporated oil. Vevap: 25.23 Barrels

Evaporation Factors (E-Factor) for SPDC Crude oil					
Oil Type	Days on site	Bonny Light	Bonny Medium		
Oil Residence time	< 1 day	10%	5%		
	1-7 days	25%	15%		
	> 7 days	40%	25%		

25. Net Estimated Spilled Volume 
$$V_{\text{rec}}(bbls) = V_{\text{evap}}(bbls) + V_{\text{wat}}(bbls) + V_{\text{mir}}(bbls) + V_{\text{pool}}(bbls) + V_{\text{rec}}(bbls) + V_{\text{rec}}(bbls$$

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of nt<sup>3</sup> to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

### 26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: 0292

B. Investigation of the incident site showed that there is residual impact on site requiring further works

#### 27. REPRESENTATIVES

This report was filled, agreed and signed on the 23/10/20/3 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: \*
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings 2

Tick as applicable

#### 28. Appendix 1: Overview sketch of the site

Location: 14" OKORDIA	- RUMUEKPE	PIPELINE	AT ALLARAKINI
			•
			. • •
			•

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1057935 JIV report S/N: 0292

