| JOINT INVESTI | GATION REPORT FO | OR INCIDENT NO: 1059 | /07/ JIV report S/N: 0326 |
|----------------|---|---|--|
| (Note: As pr | acticable as possible th | e JIT report is to be signed in | the field by all the participating parties) |
| A. GENER | AL INFORMATION: | | |
| 1. Spill incid | dent Number: 105 | 7071 2.T | ype of incident* OIL SPILL FIRE |
| 3. Name of l | Location 24"T | RANS NIGER P | IPELINE (NKPOKU-BOMU) |
| 4. Name of | nearest community BIA | RAKPITE 5. State: | RIVERS 6. LGA TAI/GOKHAN |
| 7. Type of P | roduction facility/Instal | lation DIL PIPELINE | ype of incident* OIL SPILL/FIRE IPELINE (NKPOKU-BOMU) RIVERS 6. LGA TAI/GOKHAN 8. Asset owner/District PIPELINE |
| | NT INFORMATION: | | |
| d. Des | incident te of incident: 23,6 rt date/time of investiga estigation End date: 2 scription of spill point e Firmed soil | OCTOBER 2013 ation: 257H OCT 2013/1 57H OCTOBER 2013 environment | 210 HR S investigation duration, days: ONE DAY |
| | | | _ |
| | Under water | ☐Swampy . | Exposed pipe surface |
| | Well Platform (on Wate scription of leak point (| | □Drill Rig |
| | Drilled hole | Hack saw cut | ☐ Tear (), |
| _ | Complete Rupture | □Inward dent, | □Well head tampering |
| | | t tap valve, DFailed Clamp | Missing Pipeline/Flowline |
| _ | Crude oil theft (illegal 1 | | ☐ Third party tampering with Clamp |
| _ | Third party tampering | . | ☐ Third party tampering with flange, |
| | Corrosion | Saver-pit over flo | _ |
| <u></u> | Bulging Outward | | ad wall failure Accidental 3 rd party |
| | ipment impact | □Valve Failure | Com unit failure Cold vent |
| | Relief valve failure | Others (specify)_ | |
| | | abotageLif, crude thertLif, Line Others (including Mystery spil | e theft□; Accidental 3 rd party damage□) ls) |
| g. Spi | ill point coordinates Measuring unit Northing: | MINNA CI | MID BELT) Easting: |
| POINT A | 78903 | 92mN | 535351.07ME |
| POINT B | 78848. | | 535338 64ME |
| OINTC | 78802 - | 58mN | 535335.48ME |

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

| | TITE OTTEC | LILINGELON | II DEVELOT III | | | | | |
|----------------|------------------------|-----------------------------|-------------------|----------|-------------------|-------------------------------|----------------------------------|----|
| 'NI TAIOL | VESTIGATION F | REPORT FOR IN | ICIDENT NO:_ | 10590 | 7/ JIV rep | ort S/N: 0 | 326 | |
| C. R | RISK ASSESSM | ENT | | | | | | |
| | 10. Тур | e of environment: | | | | | | |
| | Land | □Swamp | □Water | Sea | sonal swamp | Shoreline/Wat | erfront | |
| | i. Type | of environment to | which oil has sp | read: | | | | |
| | Land | □Swamp | □Water | □Riv | er (identify) | | | |
| | ii. Weat | ther condition | | | | | | |
| . 1 | Rain 11. Distance from | Sunny the nearest sensit | • | □Wet | □Windy | □Hot | □cool | |
| | | s n/Pond et | esignated protect | ed area | [,m] | PALM RUBBER PARTL BY | TREES TREES TIMPAT FIRE | AN |
| 1 | 12. Containment | measures put in pla | ace; | | | _ | | |
| | □Booms □Others:_ | □Trench | □Dyke | □Nat | ural depression | Pit | | |
| ! | 13. Any pictures o | or video coverage? | • | | [Y] [N] | | | |
| : | 14. Was there any | disruption to the | investigation? | | [Y] [N- | _ | | |
| If yes | s give brief descrip | ption: | | | | | | |
| _ _ | | 07 | \rightarrow | | PL | 1 (1 | ABL | £ |
| | YPE/NUMBERS | S OF PROPERTI Properties | ES, IF ANY, FO | OUND WIT | HIN THE ARE | A OF SPREA | AD OF OIL | |
| S/N | Type of Struc | tures Descri | ption Size | Num | per | Comment | s | |
| | | | | | | <u></u> | | |
| 7 | t in | - A | 1001 | | CA | P / - | / | |

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1059071 JIV report S/N: 0325

| S/N | Type of crops PALM TREES | Young | Medium | Matured | Quantity | Comments |
|-----|--------------------------|---------|--------|---------|----------|--------------------------|
| 01 | PALMTREES | | | | 9 | AARILY IMPACTED |
| 02 | RUBBER | <u></u> | | | 1 | PARILY IMPACTED BY FIRE. |
| | | | | | | |
| | | | | | | |
| | | | | | | _ |
| L | | | | | | 1 |

17. Fish/Nets/Ponds

| S/N Fish/Nets/Ponds | Description | Quantity/Size | Comments |
|---------------------|-------------|---------------|----------|
| X/07 | APPLI | CA | BLE |


18. Others (Specify) i.e. Animal Traps

| S/N | Others | Description | Quantity/Size | Comments |
|-----|--------|-------------|---------------|----------|
| 7 | 101 | APPL | ICA | BLE |

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 24" NKPOKU-BOMY TRANS NIGER PIPELINE AT BIARA/KPITE SHOWING HACKSAW CUTS AT SEVERAL POSITIONS

> 160MM LONG HACKSAN CUT AT 30 CLOCK POSITION

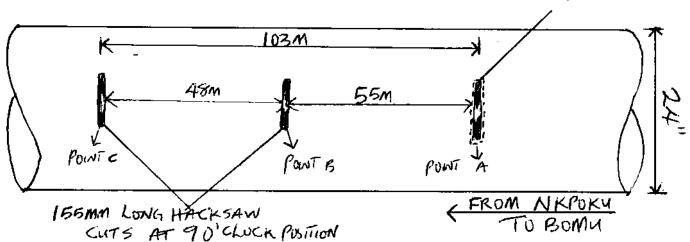

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1059071 JIV report S/N: 0326

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

| | MINNA (M | WBELT) |
|---------|--------------|--------------------|
| S/N | Northing (M) | Easting (m) |
| | 78913.13 | 535354.16 7 |
| | 78910.07 | 535344.91 |
| | 78894.72 | 535344.89 Y Area A |
| | 78888.56 | 535351.04 |
| | 78894.70 | 535354.13 |
| | 78854.77 | 535354.06 7 |
| | 78851 . 71 | 535344.81 |
| | 78845.57 | 535344.80 Area B |
| | 78842.49 | 535350.96 |
| | 78811.77 | 535350.90 |
| | 78808.73 | 535332.41 |
| | 78799.52 | 535329.31 Area C |
| | 78796.43 | 535338,55 |
| | | |
| | | |
| | | |
| | | |
| <u></u> | | |
| | | |
| | | |
| | | • |
| | | |
| | | |
| | | |

G. INCIDENT INFORMATION:


- 20. Impacted Area Details
 - Total calculated area of impact 0 045 Hq
 - Impact within SPDC R.O.W YES
- 21. Volume of oil recovered before completion of JIV (Vrect):

| JOINT INVESTIGAT | ION REPORT FOR INCIDENT NO: 10590 |)7/JIV re | eport S/N: 0 | 3 26 |
|--|---|--------------------------------|---|---------------|
| | Recovered oil V _{reci} : | NI | L | Barrels |
| | tation of estimated residual volume on site ation of estimated volume of pool of free phase oil i. Area (m²) occupied by pool of free phase oil | | |). |
| | ii. Average Depth (m) of pool of free phase oil _ | 0.450 | 2M | |
| | iii. Emulsification factor: | | | |
| | iv. Estimated Volume of pool of free phas | se oil. 4 | 25 | barrels |
| | V _{poot} : | | | |
| | ation of estimated volume of infiltrated oil in the so Estimated Volume of infiltrated oil at spill point (Vi | | | |
| THARA SPILL POINT . | . Area* (m²) of soil covered by the oil: |).50m2 | | |
| Three SPILL POINT $_{i}$ Area(m^{2}) $\rightarrow 0.50m^{2}$ $_{ii}$ | Average Depth (m) above leaking facility i.e. | <u> </u> | : 1.000M | |
|) (100(m) / > 0.50m | . Soil type: $\bigcirc \frown \bigcirc \bigcirc$ iv. P. (effective | porosity of the s | 01). 86 | |
| ITNEKAGE DETIH | - "HIKP PIK! / | BONNYLIC | SHT | _ |
| BOVE LEAKING VII | Oil Pasidamas sima an sita days 2 MX | | | |
| オビルバクラ 1:077 M | Average depth of infiltration below leaking fac | cility i.e. pipeline | e/flowline: D'O | 1005M |
| SOIL TYPE > GLAY ix | . Estimated depth of infiltration around spill poi | | | |
| THE SOIL) -> 82 | Estimated Volume of infiltrated oil at spil | ll point. V _{in(a} : | 0.25 | barrels |
| • | Estimated Volume of infiltrated oil at second spill p | oint [if applicabl | le] (Vinf b) | |
| <u>.</u> | Area* (m²) of soil covered by the oil: | 50M2 | | |
| IRD PART / INTERFERENCE | Average Depth (m) above leaking facility i.e. | | : 1 · 000 m | |
|) OIL TYPE > " | . Soil type: <u>CLAY</u> iv. P _e (effective | porosity of the s | oil). <u>88</u> | <u> </u> |
| BONNY LIGHT V | Soil type: CLAY iv. Pe (effective THRD PART) Cause of spill: INTERFERENCE vi. Oil type | :BONNYL | 1GHT | |
| BONNY LIGHT V OIL RESIDENCE TIME VIII | Oil Residence time on site, day: 2 DAYS | · | | |
| NSITE, DAY! 2 DAY | . Average depth of infiltration below leaking fac | cility i.e. pipeline | e/flowline: <u>() </u> | 005m |
| ANGERGE KETTU | Estimated depth of infiltration around spill poi | int: 1.000@ | 5M | |
| i) AVERIAGE DEPTH INPUTRATION BELOW | Estimated Volume of infiltrated oil at spill poin | TYWES O | · 25 b | arrels |
| | E stimated Volume of infiltrated oil outside immediate | | -1 (57/0-2 | |
| | | | _ | |
| 0.000.2 | | | . 7 | |
| X) ESTIMATED DEPTH | | | | n |
| -INFILTRATION iv | Soil type: CLAY | uuuuvion oi oil. | <u> </u> | <u>-</u> |
| = INFILTRATION iv | $P_{\rm e}$ (effective porosity of the soil). | 8 | | |
| 0005M | vi. Estimated Volume of infiltrated oil | | 0.12 | barrels |
| 22 - 22 | | | | !! |
| i Total | ation of estimated volume of oil on open water area of oil on open water: | r oased on stand | uard coloration | l. |
| STIMMED Y DRUME | | | | |
| FINFIETRATED OIL | | | | |
| TPOINT C> | Page 5 of 9 | | | |

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 105/07/ JIV report S/N: 0326

ii. Table of average depth of oil on water based on coloration (

**Spill Factors from USCG FOG (2000 Edition)

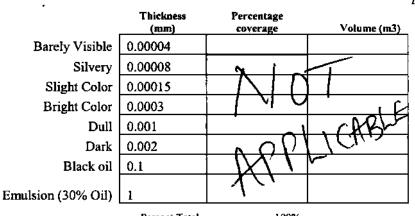

iii. Percent Total 100%

Estimated Volume of oil on open water. V_{wat}: NL Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 5.13BBLS
- ii. E-Factor: 25%

iii. EstimatedVolume of evaporated oil. V_{evap}: 1.71 Barrels

| Evaporation Factors (E-Factor) for SPDC Crude oil | | | | | | |
|---|--------------|-------------|--------------|--|--|--|
| Oil Type | Days on site | Bonny Light | Bonny Medium | | | |
| Oil Residence time | < 1 day | 10% | 5% | | | |
| | 1-7 days | 25% | 15% | | | |
| | > 7 days | 40% | 25% | | | |

25. Net Estimated Spilled Volume
$$V_{ert}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{rest}(bbls) = 6.83 \Rightarrow 1.71 + NV + 0.88 + 4.25 + NV + 0.88$$

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of | l bbl | is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 105907/ JIV report S/N: 1326

B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 25/10/20/3 by joint investigation representatives from

- Hest Community:

 ✓
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]: D
- Nigeria Police Force [NPF]: 2
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
 ✓
- Separate DPR form has been filled out with same findings□

*

Tick as applicable

28. Appendix 1: Overview sketch of the site

LOCATION: 24" NKPOKU - BOMY TRANS NIGER PIPELINE @BIARA/APTE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 109907/ JIV report S/N: 0326

| JOINT INVESTIGATION RE | PORT FOR INCIDENT NO: 109707 | | s/N: U326 |
|--|---|---------------------------------|-------------------------|
| THE STANTANIS AT THE PRINCENS OF THE PARTY P | Spirt POINTE FOR Spirt POINT A Spirt POINT A | TRANSPORTERS AND RUBBERTREE | HA HA HARASER PLATITION |
| A CASSAND FORMANDE AND | Area UF SMARCI | HREA OF IMPRE FOR SPILL FOUN | The CASSAWA FARMLAND |

Page 8 of 9