JOINT INVESTIGATION REPORT FOR INCI	DENT NO: 1060 (611 JIV report S/N: 0323
(Note: As practicable as possible the JIT rep	ort is to be signed in the f	
A. GENERAL INFORMATION:		
1. Spill incident Number: 106061	/ 2.Type o	of incident* 0/1 SPILL
3. Name of Location 12" Iran RIVE	2 - OGALE	Piperine
4. Name of nearest community OKOHI	A 5. State: AB	1A 6. LGA VIKHIA WEST
7. Type of Production facility/Installation O	IL PIPELINAE 8. A	sset owner/District PIPELIME
B. INCIDENT INFORMATION:		
d. Description of spin point environme	BER, 2013 OTH OCTOBER, 2 OBER, 2012 Actual invessent OLoose soil	tigation duration, days: OME(1) DAY
Well Platform (on Water) e. Description of leak point (tick as appoint) Drilled hole Complete Rupture Failed Weld-on illegal hot tap valve, Crude oil theft (illegal bunkering) Third party tampering with valve	☐ Hack saw cut ☐ Inward dent, ☐ Failed Clamp (3) point, c setting, ☐ Saver-pit over flow, ☐ Flare System/Bund wa	□ Exposed pipe surface □ Drill Rig □ Tear (
	luding Mystery spills)	- ,
g. Spill point coordinates Measuring unit METERS Northing: (EASTING) 52475		Mp-BELT ting: (NORTHING) # 102889.23
		PIPELINE DOCUMENT CENTRE
		0.6 NOV 2013

THE SHELL	PETROLEUM	DEVELOP	MENT CO	MPANY OF NIC	GERIA LII	MTED.
OINT INVESTIGATION RE	PORT FOR IN	CIDENT NO:	1060	<u>61) </u>	ort S/N:	03 23
C. RISK ASSESSMEI	NT					
10. Type	of environment:					
Land	☐Swamp	□Water	□Se	asonal swamp	horeline/Wa	terfront
i. Type o	f environment to	which oil has	spread:			
Land	Swamp	□Water	□Ri	ver (identify)		
ii. Weathe	er condition					
☐Rain 11. Distance from the	☑Sunny he nearest sensiti	□Dry ve habitat	□Wet	□Windy	□Hot	□cool
☐ Governmen ☐ Drinking w ☐ Built up are ☐ Farmlands ☐ Fish Farm/I ☐ Fishing net ☐ Others (spe	ea Pond cify).		ected area	[Mr, m] [Mil, m] [220, m] [Mil, m] [Mil, m] [Mil, m]		
Booms Others:	_	□Dyke	Ø Na	tural depression	□Pit	
13. Any pictures or	video coverage?					
14. Was there any d	isruption to the in	nvestigation?		[Y] (Y)	•	
If yes give brief descripti	on:					
<u> </u>	APPL	ICA	310			

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
<u> </u>	•		ļ		
$\vdash \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \! \!$	TINIC LA	174171	1270	DA OF TR	mart
HM	VIU ~ WII	 	() / 4 √	<u> </u>	1

<u> </u>					
<u> </u>					

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1060611 JIV report S/N: 0323

S/N Type of	crops	Young		Medium	Matured	Quantity	Comments
Nor	J-C	1	ITH	N)	TREA	OF I	MAPRÉS

17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description		Quan	itity/Size	Comments
N	ome h	LITHIM	ARE	A	OF	IMPACT

18. Others (Specify) i.e. Animal Traps

S/N Others	Description		Quantity/Size	Comments	
NOME L	MATHIN	A	LEA O	TRIVAST	

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)


HOWING POSITION OF CHUDE OIL THEFT POINTS AT 12" O CLOCK POSITION

3 MOS OF 2" BALL VALVE WITH

2" PIPE AND MIPPLES

ATTACHED AT 12 O'CLOCK

POSITION.

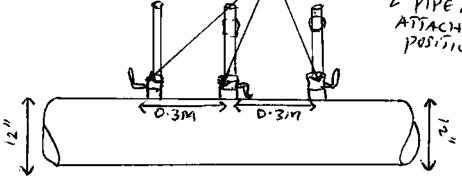

FROM IMORIVER TO OGALE.

 $F\colon$ TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1060 671 JIV report S/N: 0323

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	MUNNA	MO-BELT
S/N	Northing METERS	Easting METERS
	102879 98	524771 48
	102922.99	524768.48
	102913.78	5247 65 38
	102910.74	5 247 53 05
	102901.52	524753.03
	102898.46	524746.87
	102898.55	524700.65
	102898.57	524691 . 41
	102892.43	524691.40
	102892.41	524700.64
	102889 - 25	524743.77
	102876 95	524752.98
•		. /
\angle		
		<u> </u>

G. INCIDENT INFORMATION:

20. Impacted Area Details

•	Total calculated area of impact	0.12 Ha	
•	Impact within SPDC R.O.W	YES	
•	Impact outside SPDC R.O.W	YES	


21. Volume of oil recovered before completion of JIV (Vrect):

		Recovered oil V _{rect} : M/L	Barr	els
22	Communication			
22. a.	-	on of estimated residual volume on site n of estimated volume of pool of free phase oil (on land or confined wat	er hody)	
٠.		Area (m²) occupied by pool of free phase oil		
	ii.	Average Depth (m) of pool of free phase oil D · \	. <u></u>	
	iii.	Emulsification factor:		
	iv.	Estimated Volume of pool of free phase oil.	Ь	arrels
		V _{pool} : 13.2	1	
b.		on of estimated volume of infiltrated oil in the soil (V_{inf}). mated Volume of infiltrated oil at spill point (Vinf a)		
	i.	Area* (m²) of soil covered by the oil:		
	ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline:	<u>3</u>	
	iii.	Soil type: CLAY iv. P. (effective porosity of the soil).	81/2	
	v.	Soil type: CLAY iv. P. (effective porosity of the soil). Cause of spill AFFERENCY. Oil type: BOWNY MEDI	um	
	vii.	Oil Residence time on site, day: 4 DAYS	• •	
	viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowling	ne: 0-00	LIIN
	ix.	Estimated depth of infiltration around spill point: 1.3011 KI		
		Estimated Volume of infiltrated oil at spill point. V _{inf.a.}	98	barre
	2. Esti	mated Volume of infiltrated oil at second spill point [if applicable] (Vini	fb)	
	i.	Area* (m²) of soil covered by the oil:		
	ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline:		
	iii.	Soil type: iv. Pe (effective porosity of the soil)		
	v.	Cause of Sfill: vi. Oppper 1 vi. Opper 1 vi. Oppper 1 vi. Oppper 1 vi. Oppper 1 vi. Oppper 1 vi. Opper 1 vi. Oppper 1 vi. Oppper 1 vi. Oppper 1 vi. Oppper 1 vi. Opper 1 vi. Oppper 1 vi. Opper 1 vi.		
	vii.	Oll Residence hand on sile, days		
	viii.	Average depin of infiltration below leaking facility i.e. pipeline/flowling	ne:	_
	ix.	Estimated depth of infiltration around spill point:		
		Estimated Volume of infiltrated oil at spill point. Vinta: MIL	barrel	s
	3. E	Pope 17 - \$6 - 86 - 1 - 1 - 1 - 2 - 2 - 2 - 2 - 2 - 2 - 2	L	
	stim	ated Volume of infiltrated oil outside immediate spill point(s) region (V	inf c)	
	i.	Area (m2) of soil covered by the oil:		
	ii.	Area (m²) of the pool of free phase oil in touch with soil: 2		_
	iii.	Average Depth (m) below ground surface of infiltration of oil: 💍 🖰 .	2011	
	iv.	Soil type: CLAY		
	v.	Pe (effective porosity of the soil).		
		vi. Estimated Volume of infiltrated oil. At Vinf.	0.66	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1060 JUNE 11 JIV report S/N: 0323

Table of average depth of oil on water based on coloration (

**Spill Factors from USCG FOG (2000 Edition)

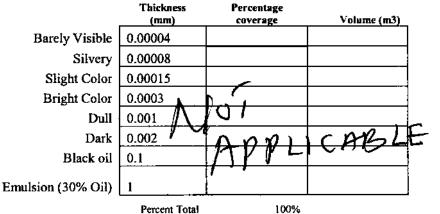

iii. Estimated Volume of oil on open water. Vwai: Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 14 85 BARRELS
- ii. E-Factor: 15 %

iii. EstimatedVolume of evaporated oil. V_{evap}: 2.62 Barrels

Evaporation Factors (E-Factor) for SPDC Crude oil						
Oil Type	Days on site	Bonny Light	Bonny Medium			
Oil Residence time	< 1 day	10%	5%			
	1-7 days	25%	15%			
	> 7 days	40%	25%			

25. Net Estimated Spilled Volume
$$V_{\text{Est}}(bbls) = V_{\text{evap}}(bbls) + V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls) = 2.62 + MIL + 1.64 + 13.21 + MIL

= 17.47 BARACLE

Estimated Reported Volume** $V_{\text{rep}}(bbls) = 18$ BARRELS.$$

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of I bbl is rounded up to the next whole number.
- Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl

Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1060611 JIV report S/N: 03	23
------------------------------------------------------------------------	----

B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 30 / 10 /2017 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
 □
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings: <a>In
- Separate DPR form has been filled out with same findings

Tick as applicable

28. Appendix 1: Overview sketch of the site

Location: 12" IMORIVER .	-OGALE PIPELINE AS	OKOHIA.
		_ · · · · ·
		;

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1060611 JIV report S/N: 0323

