THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297185 __ JIV report S/N: 00788 (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1297185 2. Type of incident* 011 SPILL 3. Name of Location 28" BOMU - BONNY PIPELINE 4. Name of nearest community OLOMA 5. State: RIVERS 6. LGA BONNY 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE **B. INCIDENT INFORMATION:** 9. Details of incident 29TH MOVEMBER, 2914 b. Start date/time of investigation: 29TH NOVEMBER, 2014 9:52 Am c. Investigation End date: 2914 NOVEMBERGIA investigation duration, days: ONE (1) DAT. d. Description of spill point environment Loose soil Recently excavated area ☐Firmed soil **Swampy** Exposed pipe surface ☐Under water ☐Well Platform (on Water) □Drill Rig Additional observations around the spill point: 2" HOSE WIMS OBSERVED TO HAVE BGEN CONNECTED TO 4" ELBONI PIPE CONNECTION TO THE ILLEGABURIKERING FITTING. IMPACTED SOIL IS SILTY CLAY. e. Description of leak point (tick as applicable); Hack saw cut ☐ Tear (______), Drilled hole Complete Rupture ☐Inward dent, ☐Well head tampering Failed Weld-on illegal hot tap valve, Failed Clamp ☐Missing Pipeline/Flowline Crude oil theft (illegal bunkering) point, ☐ Third party tampering with Clamp

f. Incident caused by:

☐Third party interference (Sabotage□; crude theft☐; Line theft☐; Accidental 3rd party damage□)

☐Operational ☐Others (including Mystery spills)______

Others (specify)

☐Saver-pit over flow,

☐ Third party tampering with flange,

Cold vent

Surge vessel overflow,

□Flare System/Bund wall failure □Accidental 3rd party equipment

com unit failure

☐ Third party tampering with valve setting,

☐Valve Failure

Corrosión

☐Bulging Outward

Relief valve failure

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

	<u> </u>	юπ S/N: [0788
g. Spill point coordinates Measuring unit MINNA	D BELT)		
Northing: (m)	Easting: (m)	
50083.75	5240	81.80)
	<u>.</u>		
C. RISK ASSESSMENT		-	_
10. Type of environment:		•	
□Land ☑Swamp □Water □Sea	sonal swamp□S	horeline/Wat	erfront
i. Type of environment to which oil has spread:			
□Land □Swamp □Water □Rive	er (identify)	<u> </u>	
ii. Weather condition			
☐Rain ☐Sunny ☐Dry ☐Wet 11. Distance from the nearest sensitive habitat	□Windy	□Hot	□cool
Government reserved and designated protected area Drinking water source Built up area Farmlands Fish Farm/Pond Fishing net Others (specify).	[m,] [m,] [m,] [m,] [m,]		
12. Containment measures put in place;			
□Booms □Trench □Dyke ☑Nati	ural depression	□Pit	□None
13. Any pictures or video coverage?	[N]		
14. Further response/repair initiated as at the time of JIV?	[N]		
If yes to item 14, give brief description: REPAIR WORK	1-125	Donte	BY
CLAMPING.	M/N-	<u>μ 0/αγ</u>	
15. Was there any disruption to the investigation?			
If yes to item 15 give brief description:	ا اسماق د ا		
NIOT APPLICABLE			

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297485 JIV report S/N: 00783

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Struct	ures	Description	Size	Number		Comments
1	lone	1/2	LITHIN	AR	CA	OF	IMPACT
	7 Crons/Ficanom						

Crops/Economic Trees

S/N	Type of crops	Young Ge	 Medium	Matured	Quantity 1	Comments INTPRETED !	37 SPILL


18. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description		Quantity/Size	Comments
17	ONE	HITHM	AR	ta (F TMPACT
				-0//	1 2 1

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quan	tity/Size Con	iments	
1	In Nic	1-15771	ARP	AME	TIMA	+cT
	10145		V 1 V - V	· • • • • • • • • • • • • • • • • • • •	<u> </u>	<u> </u>
	A PHILO PECCENTE	FION OF LEAVE BOTHER				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the

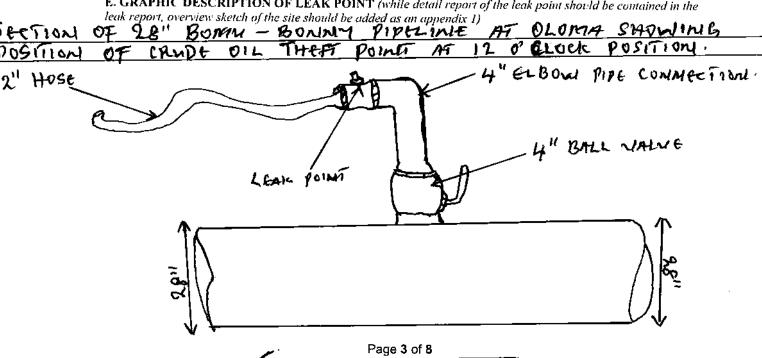

FROM BOMY TO BONNY.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297185 JIV report S/N: 00788

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

20.	MINNA (MI	D BELT)
S/N	Northing (m)	Easting (m)
1	50109.93	524095.50
2	50081.50	524109.70
3	50047.21	524067.40
4	50053 - 35	524035.20
	50094.56	524051.90
· · · · · ·		
		1500
		20/10-11
		2911/2014

ESTIMATION OF OIL SPILL VOLUME

	OFFSHORE (Leak stopped a	t source)		
npacted Area Details				
Total Calculated Area of I	mpact			2,700.00 m²
i Impact within SPDC R.O.V	/		•	m²
li Impact outside SPDC R.O.	W			m²
olume of oil recovered before	completion of JIV (V _{rsc.i})			
i Estimated Recovered oil (N				bbls
Estimated Recovered oil	Net1 V	_		elde 09.0
	A MACA	-	<u> </u>	0.00 0018
omputation of estimated resi				
Computation of volume of	f free phase oil (on land or confined	i water body)		
i Total area occupied by pod	•			4.00 m ²
ii Average depth of pool of fro	ee phase oil			0.001 m
iii Emulsification factor (If applicable, else 0%)			O%
Estimated Volume of poo	of free phase oil. V			0.00 m³
Estimated Volume of poo				0.03 bbls
				····
	i volume of infiltrated oil in the soll	(V _{int})		
1 Volume of infiltrated oil a				
i Total area covered by the o	•			3.00 m²
	above leaking facility i.e. pipeline/flow	viine		1.200 m
iii Soil type				Silty or sandy day ▼
iv P _e (effective porosity of the	soil)			12 %
v Cause of spill				Third party interference
			Ī	
	infiltration below the leaking point on p			
Incident Date	JIV Date	Days on Site		
11/30/2014 13:45	12/2/2014 11:25	2		
	ational, use 1 week as worst case here 'days on site' exceeds 7.	7		
			·	_
	Infiltration of oil types in various soil t	ypes vs time.	_	
Soil type	Approximate time to reach	1m depth below grou	nd level	_}
Oil type	Sand	Loam	Clay	_
Bonny Medium	3 weeks	3 years	> 10 years	_
Bonny Light	2 days	2 months	> 10 years	
/ii Oil type				Bonny Light ▼
	below leaking facility i.e. pipeline/flow	dine		0.001 m
ix Total depth below ground s	urface of infiltration of oil			1.201 m
Estimated Volume of Infili	iradad all 17			0.43 m³
Estimated Volume of Infili				
Ladinated Folding Of Initial	Salan on, # Ma			2.72 bbis
2 Volume of infittrated oil at	second spill point [if applicable] (V	(ma)		
i Total area covered by the o	ll (infiltration)			m²
ii Average depth of infiltration	m			
iii <u>Şoil type</u>				- Select - ▼
iv P. (effective porosity of the	soil)			0 %
v Average depth of infiltration	below leaking facility i.e. pipeline/flow	dine		0.000m
	- , ,,			
vi Total depth below ground s	urrace of infiltration of oil			0.000 m
Estimated Volume of Infile				0.00 m³
Estimated Volume of infili	rated off. V			0.00 bbls

3

3 Volume of infiltrated oil	outside immediate spill point(s) regio	on (V _{MFc})		
! Total Area covered by the	2,696.00 m²			
i Total Area of the pool of fi	m²			
i <u>Soil type</u>	Silty or sandy day			
P _e (effective porosity of th		12 %		
Average depth below grou	0.001 m			
Estimated Volume of Inf	litrated oil, V _{infe}			0.18 m³
Estimated Volume of Inf	iltrated oil, V _{infe}			1.12 bbls
i Total Area covered by the ii Total Area of the pool of fr	ree phase oil in touch with soil and surface of infiltration of oil litrated oil, V _{lot d}	on (superficial impac	i, V _{ind d})	0.001 m 0.00 m³ 0.01 m² 0.00 bbis 0.61 m³ 3.83 bbis
i Total area of oil on open w ii Table of average depth of	oil on water based on coloration	Link to Coverage Visual		m _x
Spill Factors from USCG FOG	(2000 Edition)	Ald Percentage coverage		1
	Thickness (mm)	(%)	Volume (m3)	
Barely Visible	0.00004		0.0000	
<u>Silvery</u>	0,0000,0		0.0000	
Slight Color	0.00015		0,0000	
Bright Color	0.0003		0.0000	
Dult	0.001		0.0000	
Dark.	0.002		0.0000	
Black oil	0.1		0.0000	
Emulsion (30% Oil)	1		0.0000	
	Percent Total:	0%	0.0000	
Estimated Volume of oil	an anan wetar V			0.00 m³
Estimated Volume of oil			<u>-</u>	0.00 hble
ulation of evaporated vol	nute			0.00 0010
	Evaporation Factors (E-Factor) for S			
Residence time	e of spilled oil (days on site)	Oil ty	,	
	z 1 dm	Bonny Light	Bonny Medium	
· 	< 1 day 1-7 days	10% 25%	5% 15%	
	> 7 days	40%	25%	
Was oil recovery before Ji Estimated volume available E-factor	V completion done before JIV date?			3.86 bbls
Estimated Volume of eve	programmed all V			4 MR LL*-
Estinated Adinitie of 8A8	ibruared oil' A ^{eleb}			1.29 bbls
M-4 = 4-1 = 0	A.W. 311.3 37			
Net Total Estimated	Spilled Volume, V _{Est}			5.14 bbls

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297185 JIV report S/N:	00788
G. INCIDENT INFORMATION:	


	_		
20,	Impacte	d Area	Details

•	Total calculat	ed area of impact_	0.27	Ha	
•	Impact within	SPDC R.O.W	YES		
•	Impact outsid	e SPDC R.O.W	YES		· ·•
21. <u>Volume o</u>	f oil recover	ed before complet	ion of JIV (V	recf):	
		Reco	vered oil V _{rect} :	NIL	Barrels
Controlled r	ecovery/eva	cuation from sour	ce with no im	pact to environment:	•
		MIL	Barrels		

22: Net Est	imated Spilled V	olume V _{Ke} (bbls)*	=			1,75	****
			BA	MRELS	.4		
Estimated Rep	ported Volume** V	(ren(bbls)=	6	BARREL	5 -		

*Notes:

Valume estimation was done using an excel based tool.(see attached for details on the calculation)

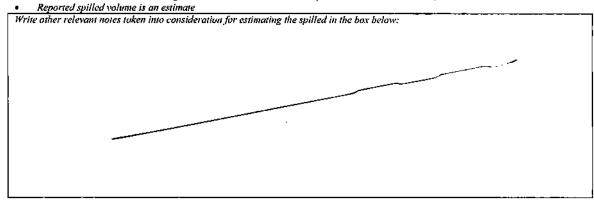

Calculation of the respective estimated volume is to be done on site as for as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

Any spill volume in excess of 1 bbl is rounded up to the next whole number.

Any spill volume in less than I bbl is rounded up to the next 0,1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297185 JIV report S/N: 00788

23. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Department of Petroleum Resources [DPR]: 12
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1297185 JIV report S/N: 00788

25. Appendix 1: Overview sketch of the site

