JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1342901 JIV report S/N: 00616
(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)
A. GENERAL INFORMATION:
1. Spill incident Number: 134290/ 2. Type of incident* O/L SP/LL
3. Name of Location 8" ASSA - RUMUEKPE BULKLINE
4. Name of nearest community IMOGU 5. State: RIVERS 6. LGA EMOHUA
4. Name of nearest community IMOGU 5. State: RIVERS 6. LGA EMOHUA 7. Type of Production facility/Installation FLOWLINE 8. Asset owner/District LAND (1) ONE
B. INCIDENT INFORMATION:
9. Details of incident 21 ST FEBRUARY 2015.
b. Start date/time of investigation: 02ND MARCH 2015/14!SDHRS
c. Investigation End date: 67# MARCH 2015 Actual investigation duration, days: FIVE (5) DAYS
d. Description of spill point environment
Firmed soil Loose soil Recently excavated area
Under water
Well Platform (on Water) . Drill Rig
Additional observations around the spill point:
NOT APPLICABLE
e. Description of leak point (tick as applicable);
Drilled hole
Complete Rupture
Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline
Crude oil theft (illegal bunkering) point,
☐ Third party tampering with valve setting, ☐ Third party tampering with flange,
Corrosión Saver-pit over flow, Surge vessel overflow,
☐Bulging Outward ☐Flare System/Bund wall failure ☐Accidental 3rd party equipment
impact
Relief valve failure Others (specify)
f. Incident caused by:
Third party interference (Sabotage , crude theft □; Line theft □; Accidental 3 rd party damage □)

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTI	GATION RE	PORT FOR INC	CIDENT NO:	<u> 13429</u>	<u>101 </u> JIV i	report S/N:	00616
g. Spi	Il point coord Measuring	inates (M)	Mini	na N	Aid 4	elt	
	Northing:	•			Easting:		
	11	4779.	14		4712	213.14)
							$\overline{}$
			12	Sh		15	SV
C. RISK A	SSESSMEN	IT				_	
10.	Туре	of environment:					
VE.	Land	□Swamp	□water	□se	asonal swamp	Shoreline/Wa	iterfront
i	i. Type of	environment to	which oil has	spread:			
VZ	Kand	□Swamp	□Water	□Ri	ver (identify)_		
i	i. Weathe	r condition					
		Sunny e nearest sensitiv	Dry ve habitat	□Wet	□Windy	□Hot	□cool
	Drinking wa Built up area Farmlands Fish Farm/P	reserved and de ter source AROUN and AS AT cify)-INVES	NE DE D THE	SERY SPIL	L POIN] T	
		asures put in plac		•			
	Booms Others:	Trench	√ Dyke	□Na	atural depressio	n √⊿ Pit	□None
13. Any	y pictures or	video coverage?				١)	
14. Fu	rther respons	e/repair initiated	as at the time	of JIV?	11 - 12	1]	
If yes to item	14, give brief o	lescription:	A COM	IMENC	ES L	EAK R	EPHR
IMMED	MATEL	у.					
15. Wa	s there any d	sruption to the in	vestigation?	-	ا] الإل	1]	
If yes to iten	n 15 give brie	f description:) / ハフ / ハ	VEST	19A7	-10N]	WAS DI	SRUPTED
FOR .	FHREE	(3)DAXS	DUE	10	COMMU	NITY I	SSUES.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1342901 JIV report S/N: 00616

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N Type of Structures	Description	Size	Number	Comments
NONE WI	7-7+ /K	AR	EA OF	MPACT
17. Crops/Economic Trees	<u> </u>			<u>.</u>

S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONEY	JITH/N-A	REA	OF	IMPA	CT

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description		Quantity/Size	Comments
A	ONE H	SITH/N	AR	TA (OF IMPACT

19. Others (Specify) i.e. Animal Traps

S/N Others	Description	Quantity/Size Comments
NON	EWITHIN A	REA OF IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1) A SECTION OF 8" ASSA— PLINIUE KPE BULKLINE AT IMOGU RUMUEXPE SHOWING DRILLED

BETWEEN 9 AND 10°CLOCK POSITION. HOLE

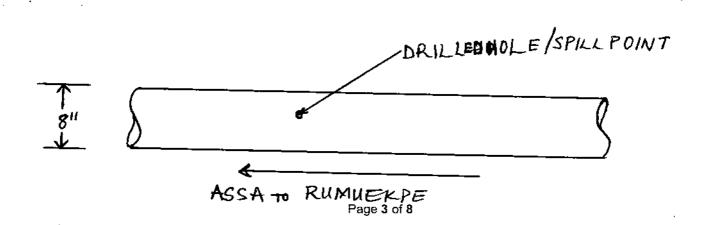

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1342901 JIV report S/N: 00616

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 20. Impacted area boundary Coordinates (Iffine, Print and attack is an appendix)

20	Northing Northing	linna Mid belt
S/N	Northing (M)	Easting (M)
	114797.77	471215.34
	114782.41	471 215 30
	114776.26	471215.28
	114767.04	471218.34
	114745.53	47/218.28
	114739.41	471209.02
	114739.39	471215.18
	114739.42	471205.94
	114 733.26	471209.00
	114730.19	471208.99
	114720.97	471208.97
	114714.82	471212.03
	114711.77	471202.78
	114724.07	471199.73
	114736.37	471196.69
	114751.72	471199.81
	114773.22	471202.95
	114779.38	471199-89
	114782 42	471209.14
	114791.64	471209.16
	114776.23	471227.61
	114770.09	471224.51
		100
		102 02 03 N

	_		T/L SPILL @ IMOGU(RU	INIUENPE	<u>' </u>		T	
		NC.NO=1342901				$\overline{}$	 	
		MINNA-MID BELT			<u> </u>	 	-	 -
TS_	!		NORTHINGS		<u> </u>	┼	<u> </u>	
	276	471215.343	114797.768				- 	-
	277	471215.3	114782.406		 -	 	 -	
	278	471215.283	114776.261		<u> </u>	 	 	-
	279	471218.339	114767.035		 	+		
	280	471218.28	114745.527		 			
	281	471209.019	114739.408		<u> </u>		 	
	282	471215.181	114739.391					
	283	471205.938	114739.417		<u> </u>	 		-
	284	471209.002	114733.263		<u> </u>			_
	285	471208.994	114730.191		<u> </u>			
	286	471208.968	114720.973		 		_	
	287	471212.032	114714.82					
	288	471202.781	114711.773				_	
_	289	471199.734	114724.071				<u> </u>	
	290	471196.686	114736.37		<u> </u>			
	291	471199.81	114751.724		<u> </u>			
	292	471202.951	114773.222		<u> </u>			
_	293	471199.887	114779.376					
	295							
	296		114791.64					
	297		114776.227		<u> </u>			
	298							
_		COORDINATE LIST	ADDITIONAL IMPACTED	AREA BY	BURST GI	TANK.		
		INC.NO=1342901						
		MINNA MID BELT						
PTS		EASTINGS	NORTHINGS					
713	3021	 			_			
	3022							
	3022	<u> </u>		·				
<u> </u>					1			
	30:	4/1203.13	224,00.000		 			
<u> </u>		 	 					
<u> </u>		 	 	 				
 		 	 	 	_			
<u> </u>		-	 	-	+-		\neg	

6/03/2015

ESTIMATION OF OIL SPILL VOLUME

OIL SPILLED ONSHORE	/OFFSHORE (Leak stopped at	t squrce)			
mpacted Area Details					
Total Calculated Area of	impact			1,300.00 m²	
i Impact within SPDC R.O.	v			m²	
il Impact outside SPDC R.C	.w			m²	
Volume of oil recovered before					
i Estimated Recovered oil (Net)			14.00 bbls	
Estimated Recovered oil	(Net) V _{recJ}			14.00 bbls	
Computation of estimated res	idual volume on site				
Computation of volume	of free phase oil (on land or confined	i water body)			
i Total area occupied by po	ol of free phase oil			200.00 m²	
ii Average depth of pool of f	ree phase oil			0.005 m	
iii Emulsification factor	(If applicable, else 0%)			<u></u> %	
				3	
Estimated Volume of po		_		1.00 m ³	
Estimated Volume of po	ol or free phase oil, V _{pool}			6.29 bbls	
Computation of estimate	d volume of inflitrated oil in the soil	WI			
Volume of infiltrated oil		t = knt)			
i Total area covered by the				2.00 m²	
		dian		1.500 m	
	n above leaking facility i.e. pipeline/flov	vine		· · · · · · · · · · · · · · · · · · ·	
iil Soil type	in			Gravel (coarse)	
iv P. (effective porosity of th	e son)			20 %	
v Cours of soill				Third party interference	
v Cause of spill				The party state and	
vi Calculation of days fo	r infiltration below the leaking point on p	nineline or flowline			
Incident Date	JIV Date	Days on Site			
2/21/2015 12:00	3/2/2015 14:00	9			
	rational, use 1 week as worst case	·			
	rhere 'days on site' exceeds 7.	7			
 	J-Ellentian of all frage in contago pail	hanna va tima		1	
Call 6 ma	Infiltration of oil types in various soil	u.	ari laval	1	
Soil type	Approximate time to reach		_	1	
Oil type	Sand	Loam	Clay	1	
Bonny Medium	3 weeks	3 years 2 months	> 10 years > 10 years	₹	
Bonny Light	2 days	2 inoners	> to years	J	
vii Oil type				Bonny Medium	
	on below leaking facility I.e. plpeline/flow	vline		0.008 m	
am vacioRe debut di mundan	in below leaking laciny i.e. pipeline not	TIVIAG		3.000 m	
ix Total depth below ground	surface of infiltration of oil			1.508 m	
-					
Estimated Volume of Int	iltrated oli, V _{infa}			0.60 m ³	
Estimated Volume of int	litrated oil, V _{irts}	_		3.79 bbis	
2 Volume of Inflitrated oil	at second spiil point [if applicable] ('	V _{iet b} }			
i Total area covered by the	oil (infiltration)			m²	
ii Average depth of infitration	<u>]m</u>				
ili <u>Soil type</u>					
iv P. (effective porosity of the	e soil)			0%	
				0.000	
v Average depth of infiltration	on below leaking facility i.e. pipeline/flow	viine		0.000 m	
vi Total depth below ground	surface of infiltration of oil			0.000 m	
vi тока аерито вом дгоило	Surface of Alliander of Off				
Estimated Volume of in	litrated oil, V _{laf b}			0.00 m ³	
Estimated Volume of in				n no tybia	

	outside immediate spill point(s) regi	on (V _{isfe})		4 555 2		
Total Area covered by the	• •			1,050.00 m ²		
	ee phase oil in touch with soil	•		m ²		
Soil type P _a (effective porosity of the	n toil)			Gravel (coarse)		
r a (enocure porosity or air	s autij			20 %		
Average depth below grou	nd surface of infiltration of oil			0.008 m		
	stimated Volume of inflitrated oil, V _{kef c}					
Estimated Volume of infi	Itrated oil, V _{erf c}			10.86 bbis		
Volume of infiltrated oil :	outside immediate spill point(s) regi	on feunerficial impa	urt V)			
Total Area covered by the		ou fankamen mike	or a fixed)	m²		
•	ee phase oil in touch with soil			m²		
Average depth below grou	nd surface of Infiltration of oil			0.002 m		
- , -						
Estimated Volume of Infl				0.00 m³		
Estimated Volume of Infl	icraced Oil, V _{bil d}			0.00 bbls		
Estimated Total Volume				2.33 m ³		
Estimated Total Volume	of Infiltrated oil, V _{inf}			14.65 bbls		
Computation of volume of Total area of oil on open w	of oll on open water based on stand: rater	ard coloration				
• '	oil on water based on coloration			<u> </u>		
• •		Link to Coverage Visu	퇸			
Split Factors from USCG FOG	(2000 Edition)	Ald Percentage coverage	· · · · · · · · · · · · · · · · · · ·	n		
	Thickness (mm)	(%)	Volume (m3)			
Barely Visible	0,00004		0.0000	5		
Silvery	0.00008		0,0000	5		
Stight Color	0.00015	i	0.0000			
Bright Color	0.0003		0.0000	D		
<u>Duil</u>	0.001		0,000	<u>의</u>		
<u>Dark</u>	0.002		0.0000	2		
Black oil	0.1		0.0000			
Emulsion (30% Oil)	1		0.0000	-1		
	Percent Total:	<u> </u>	<u>%.</u> 0.0000	<u> </u>		
Estimated Volume of oil				0.00 m³		
Estimated Volume of oil	on open water, V _{est}			0.00 bbls		
utation of evaporated vol	ume					
	Evaporation Factors (E-Factor) for S	SPDC Crude oil	<u> </u>]		
Residence time	of spitled oil (days on site)		type	1		
		Bonny Light	Bonny Medium	4		
	< 1 day	109		1		
	1-7 days > 7 days	25°		1		
				<u>.</u>		
-	V completion done before JIV date?			Yes		
Estimated volume available	e for evaporation			20.94 bbis		
E-factor				25]%		
Estimated Volume of eva	porated oil, V _{even}			6.98 bbls		
Net Total Estimated	Spilled Volume, V _{est}			41.92 bbls		
	- Eur					

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 13/12901 JIV report S/N:	00616
G. INCIDENT INFORMATION:	

- 20. Impacted Area Details
 - Total calculated area of impact D·/3HA
 Impact within SPDC R.O.W YES
 Impact outside SPDC R.O.W YES
- 21. Volume of oil recovered before completion of JIV (Vreel):

Recovered oil V_{recI}: //4 Barrels

Controlled recovery/evacuation from source with no impact to environment:

N/L Barrels

22. Net Estimat	ted Spilled Volume V	it(bbls)* =	:	
		41.92	BARRELS	"
Estimated Reporte	d Volume** V _{ren} (bbls)=	H2 BA	KRELS	

*Notes:

- Volume estimation was done using an excel based tool.(see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of I bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1342901 JIV report S/N: 00616

23. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:

 ✓
- Department of Petroleum Resources [DPR]: □
- State Ministry of Environment [SME]
- Nigeria Police Force [NPF]
- Shell Petroleum Development Company [SPDC]
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1342901 JIV report S/N: 00616

25. Appendix 1: Overview sketch of the site

