JOINT INVESTIGATION REPORT FOR INCIDENT NO:__

□ Drilled hole

□ Complete Rupture

☐ Failed Weld-on illegal hot tap valve,☐ Crude oil theft (illegal bunkering) point,

☐ Third party tampering with valve setting,

(Note: As practicable as possible	the JIT report is to be signed	l in the field by all the	participating parties)
A. GENERAL INFORMATION	l:		
1. Spill incident Number:	752366	2.Type of incident*	OIL SPILL
3. Name of Location AK	ASO WELL	35 FLOW	LINE
4. Name of nearest community	LOMATORU 5. State	RIVERS 6.1	ga Bonny
7. Type of Production facility/Ins	tallation OU FLOWLIN	E 8. Asset owner/Di	strict_NESI/CAWTHORNE
B. INCIDENT INFORMATIO			CHANNEL
9. Details of incident a. Date of incident:	TH DECEMB		
b. Date/Period of investiga	tion: 12TH DECE	MBER, 2011	
c: Description of spill poir	t environment		
☐ Firmed soil	Loose soil	✓ Previous	ly excavated area
☐ Under water	Swampy	☐ Exposed	pipe surface
☐ Well Platform (on W	•	□ Rig	

☐ Hack saw cut

☐ Inward dent,

	☐ External Corrosion		☐ Internal Corrosion	
	☐ Saver-pit over flow,	☐ Surge vessel overflow	, D Outward dent	
	☐ Flare System/Bund wall Failure	☐ Valve Failure	com unit failure	
	□ Cold vent	☐ Relief valve failure	□ Others (specify) No T	APPLICABLE
e.	Incident due to:			
	Third party interference	☐ Operational	□ Others (specify NoT	APP LICABLE
f.	Spill point coordinates Measuring unit (METLER)	MINNA M	D-BELT	
	Northing:		Easting:	
٠	60507.00)	509369.82	
			·.	

□ Explosive tear,

☐ Well head tampering

✓ Missing Pipeline/Flowline)

☐ Third party tampering with Clamp

☐ Third party tampering with flange,

Page 1 of 9

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0174 752366

O. 1410	V HOOEOOIAI	ENI			
1	0. Type	e of environment;			
	□ Land	∡ Swamp	□ Water	☐ Seasonal swamp	
	i. Type	of environment to	which oil has sp	pread:	
	□ Land	Swamp	□ Water	□ River (identify) NOT APPL	CABLE
	ii. Weatl	ner condition			
11.	☐ Raining Distance from	Sunny the nearest sensitive	ve habitat		
12.	☐ Drinking v ☐ Built up as ☐ Farmlands ☐ Fish Farm ☐ Fishing ne ☐ Others (sp	rea ; /Pond	APPLICA	[,m] [,m] [,m] [,m]	
	□ Booms	☐ Trench	□ Dyke		
	Others:	NONE			
13.	Any pictures of	r video coverage?		[Y] [N]	
14.	Was there any	disruption to the in	nvestigation?	[Y] [N]	
If yes giv	ve brief descrip	tion:	,		
	1)	A	PPLICABLE	17

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

JOINT INVESTIGATION REPORT FOR INCIDENT NO:

16. Crops/Economic Trees

S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONE	WITHM	AR	EA OF	IMP	ACT

17. Fish/Nets/Ponds

S/N Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE W	THIN A	REA OF	IMPACT

18. Others (Specify) i.e. Animal Traps

S/N Other	s Descriptio	n Qı	uantity/Size	Comn	ents
NONE	WITHIN	AREA	OF	LMPA (21

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix 1)

SECTION OF AKASO WELL 35 FLOWLINE LOMATORY SHOWING FLOWLINE

A CROSS SECTION OF AKASO WELL 35 FLOWLINE INDICATING FLOWLINE <u> उत्तम</u>्

CAWITHOR ROWSTATION.

AKASO

Page 3 of 9

JOINT INVESTIGATION REPORT FOR INCIDENT NO:_

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

	MINNA M	ID-BELT	
S/N	Northing (METER)	Easting (METER)	
RI	60487.61	509364.43	
P. 2	60486.85	509361.75	•
p.3	60535.723	509378.85	
P.4	60534.34	509379.70	
	,		
Z			
			-

G. INCIDENT INFORMATION:

20. Impacted A	rea Detail:	S
----------------	-------------	---

iii. Emulsification factor:

	Total calculated area of impact	Ha		
	Impact within SPDC R.O.W			
	Impact outside R.O.W			
21.	Volume of oil recovered before completion of JIV (V _{recJ}):			
	Recovered oil V _{recJ} .	NIL	barre	ls
20.	Computation of the residual volume on site			
a.	Computation of volume of pool of free phase oil (on land or con i. Area (m²) occupied by pool of free phase oil	nfined water body).		
	ii. Average Depth (m) of pool of free phase oil	0.001		

0.13

barrels

iv. Volume of pool of free phase oil. V pool:

THE SHELL PET	ROLEUM DE	VELOPMENT COMPA	NY OF NIGERIA LI	MITED			
JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0174 752366							
b. Computation of volume of infiltrated oil in the soil (V_{inf}) .							
i	. Area (m ²) cov	ered by the oil:	69				
ii	. Area of the po	ol of free phase oil in touch	with soil:N				
iii		(m) below ground surface					
iv	. Soil type:						
v		porosity of the soil).	24 .				
iv		f infiltrated oil. V _{inf}	- 0.7				
	- Volume o	I militated oil, Vini	0-47	barrels			
21. Computation	of volume of oil	on open water based on	standard coloration.				
		r: NIL					
		on water based on coloration	*				
	Thickness (mm)	Percentage coverage	Volume (m3)	•			
Barely Visible	0.00004						
Silvery	0.00008	No	•				
Slight Color	0.00015	140-1					
Bright Color	0.0003	•					
Dull	0.001	100					
Dark	0.002	APPLI	CABLE				
Black oil	0.1	•					
Emulsion (30% Oil)	1						
	Percent Total	100%	Total Volume	NIL bbi			
	iii. Volume of oi	l on open water. V _{wat} :	NiL	barrels			
22. Calculation of	f evaporated vol	ume:	7 (-				
	0						
i. Oil ty	pe: <u>BONNY</u>	LIGHT					
ii. E-Fac	tor: <u>95%</u>	_					
iii.	. Volume of ev	aporated oil. V evap:	0.37	barrels			
		· ·		•			

Evaporation Factors (E-Factor) for SPDC Crude oil							
Oil Type Days on site Bonny Light Bonny Medium							
Period Since Oil Spill	< 1 day	10%	5%				
	1-7 days	25%	15%				
	> 7 days	40%	25%				

23. Gross Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pol}(bbls) + V_{recJ}(bbls) = 0.37 + NIL + 0.97 + 0.13 + NIL = 1.47$

JOINT INVESTIGATION REPORT FOR INCIDENT NO: U174 752366

V _{Est} (bbls)= 1.5 BARRELS						
24. <u>Net</u> V _{po}	Total Estimated Spilled Vol. (bbls) + VrecJ (bbls) =	Volume V Est $0.37 +$	(bbls) = \ 	V _{evap} (bbls) + O:97+	0.6*V _{wat} (bbls) + 0.13 + NIL=	V _{inf} (bbls) + 1-4-7
VEst(bbls)=	1.5 BARRE	عـــ				

25. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact. After the initial response and therefore recommend that the site be closed out □
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

26 Signatories

This report was filled and signed on the investigation representatives from

Host Community

Department of Petroleum Resources [DPR]:

National Oil Spill Detection and Response Agency [NOSDRA]:

State Ministry of Environment [SME]:

- Nigeria Police Force [NPF]:□
- Shell Petroleum Development Company [SPDC]: 🔍

Tick as applicable


^{*}Calculation of the respective estimated volume is to be done using the new spill estimation software on site

^{*}Conversion of m3 to barrels is Total volume VT (m3) x 6.29

^{*}Emulsification factor for spill on water to consider is 60% of volume of oil.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: U174 752366

20. Appendix 1: Overview sketch of the site

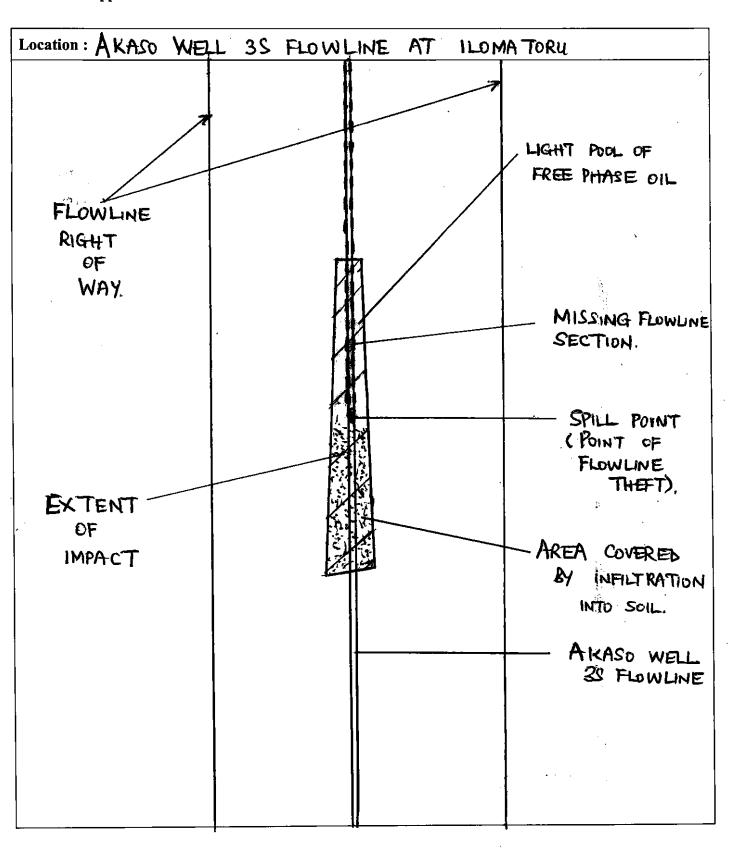

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0174 75236

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
· <u>-</u>		
-		
<u></u> .		
		1-