JOINT INVESTIGATION REPORT FOR INCIDENT NO:	0128 725931

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:		
1. Spill incident Number: 72593	2.Type o	f incident* OIL SPILL
3. Name of Location <u>CAWTHOR</u>	WE CHANNEL	IT WELL SIT FLOWLINE
4. Name of nearest community MBIA	MA 5. State: RIV	ERS 6. LGA DEGEMA
7. Type of Production facility/Installation D		/ CAMTHAO.in
B. INCIDENT INFORMATION:		
9. Details of incident  a. Date of incident: 1174  b. Date/Period of investigation: 17	OCTOBER 20 TH OCTOBER	•
c: Description of spill point environm	ent	
☐ Firmed soil	<b>∠</b> Loose soil	☐ Previously excavated area
☐ Under water	<b>✓</b> Swampy	☐ Exposed pipe surface
☐ Well Platform (on Water)  d. Description of leak point (tick as approximately)	mlicable):	□ Rig
□ Drilled hole	☐ Hack saw cut	□ Explosive tear,
□ Complete Rupture	☐ Inward dent,	☐ Well head tampering
☐ Failed Weld-on illegal hot tap vo	•	☐ Missing Pipeline/Flowline)
☐ Crude oil theft (illegal bunkering		☐ Third party tampering with Clamp
☐ Third party tampering with valv	• •	☐ Third party tampering with flange,
✓External Corrosion	<i>3,</i>	□ Internal Corrosion
☐ Saver-pit over flow,	☐ Surge vessel overflow,	
☐ Flare System/Bund wall Failure		□ com unit failure
□ Cold vent	☐ Relief valve failure	Others (specify) PIN HOLE
e. Incident due to:		
☐ Third party interference	Operational	□ Others (specify NOT APPLICABLE
f. Spill point coordinates (MIN) Measuring unit M	NA MID-BELT)	
Northing:	F	Easting:
61290.45		504824.32
•	, i	ı

Page 1 of 9

<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0128725931

C.	RISK ASSESSM	ENT					
	10. Typ	e of environment:					
	□ Land	Swamp	□ Water	□ Seas	onal swamp		
	i. Type	of environment to	which oil has sp	pread:			
	☐ Land	Swamp	Water	□ Rive	r (identify)		
	ii. Weat	her condition					
	☐ Raining  11. Distance from	Sunny the nearest sensit	ive habitat				
	☐ Drinking☐ Built up a☐ Farmland☐ Fish Farm☐ Fishing n	area s n/Pond et pecify). <b>FISH</b> 1	NG SETTL		[ ,m] ,m] ,m] ,m] ,m] ,m]		·
	Booms	☐ Trench	□ Dyke				
	☐ Others:	NOT A	PPLICABLE	<u> </u>	<u></u>		
	13. Any pictures of	or video coverage	?		[Y <b>]</b> [N	]	
	14. Was there any	disruption to the	investigation?		[Y] [N,	<b>V</b>	
If y	ves give brief descri	ption:	10	DI	10-1	\ <u></u>	
			<u> </u>		11 /	7KT	1
_	1 X '	$\cup$ 1	/ / /	<u> </u>	· · ·	IUL	

#### D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

#### 15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
X	ONE	VITH	IN A	REA OF	IMPACT

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0128725931

#### 16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
N	ONE	WITHIN	ARE	A OF	IMPA	C
				<del></del>		

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description		Quantity/Size	Comments
No	NE WIT	HIN /	REA	0F	IMPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others		Descripti	on	Quantity/S	ize	Comments
Nic	(K)E	115	Fliki	\ D \ \	$\nabla \Gamma$		ADA OT
110	DIVE	AA!	MIN	MKEA	U <del>l</del>	117	TIPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix 1)

SECTION OF CAWTHORNE CHANNEL II WELL SIT FLOWLINE AT MBIAMA SHOWING POSITION OF PINHOLE DUE TO CORROSION.

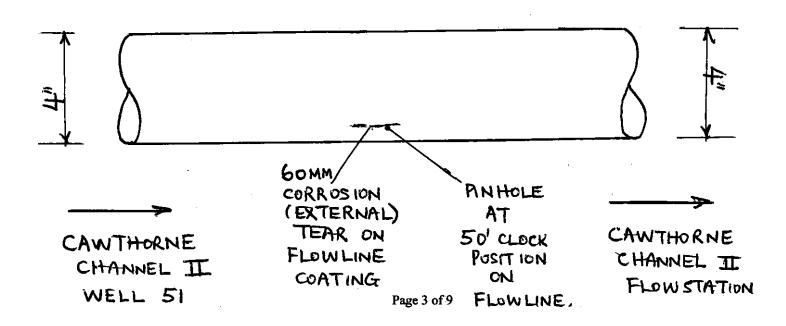

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0128 725931

# F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2) (MINNA MID-BELT)

S/N	Northing (M)	Easting (M)
586	61311-98	504812.04
587	61311.96	504 824. 37
588	61299.65	504833.59
589	61281-21	504836.64
590	61275.07	504836.62
591	61275.12	504811.96
592	61313-32	504820.37
593	61331-44	504814.96
594	61332 - 21	504803.29
595	61328.92	504766.10
596	61334.87	504765.03
597	61335.05	504816.13

#### G. INCIDENT INFORMATION:

	20.	Impacted	l Area	Detail	S
--	-----	----------	--------	--------	---

• T	otal calculated area of impact	11 Ha	_
• Ir	mpact within SPDC R.O.W	11 Ha	
• In	mpact outside R.O.W	NIL	<u>_</u>
21. <u>Volume o</u>	of oil recovered before completion of JIV (V <sub>rec</sub>	j):	
	Recovered oil V <sub>rec,f</sub> .	NIL	barrels
20. <u>Computat</u>	tion of the residual volume on site		
a. Computati	on of volume of pool of free phase oil (on land or on.  Area (m²) occupied by pool of free phase oil	confined water body).	_
ii	. Average Depth (m) of pool of free phase oil	0.001	
iii.	Emulsification factor: N1	_	
	iv. Volume of pool of free phase oil. V <sub>poo</sub>	0.02	barrels

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED	
JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0128725931	
b. Computation of volume of infiltrated oil in the soil $(V_{inf})$ .	
i. Area (m²) covered by the oil:95	
ii. Area of the pool of free phase oil in touch with soil:	
iii. Average Depth (m) below ground surface of infiltration of oil: p. 003	_
iv. Soil type: Cl AY	
v. $P_{\rm e}$ (effective porosity of the soil).	
iv. Volume of infiltrated oil. V <sub>inf</sub> l-5	πels
21. Computation of volume of oil on open water based on standard coloration.  i. Total area of oil on open water:  ii. Table of average depth of oil on water based on coloration  Thickness Percentage	
(mm) coverage Volume (m3)	
Barely Visible 0.00004	
Silvery 0.00008	
Slight Color 0.00015	
Bright Color 0.0003	
Dull 0.001	
Dark 0.002	
Black oil 0.1	
Emulsion (30% Oil) 1 1 100%	
Percent Total 100% Total Volume (): 63	obl
iii. Volume of oil on open water. Vwat: 8-63 barrels	
22. Calculation of evaporated volume:	
i. Oil type: BONNY LIGHT	
ii. E-Factor: 25%	
iii. Volume of evaporated oil. V <sub>evap</sub> : 0.72 barrels	

Evapor	ration Factors (E-Fa	actor) for SPDC Crue	de oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
-	> 7 days	40%	25%


23. Gross Total Estimated Spilled Volume  $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat} (bbls) + V_{inf} (bbls) + V_{pool} (bbls) + V_{recJ} (bbls) = 0.72 + 0.63 + 1.5 + 0.03 + N/L = 2.88$ 

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0128-725931

V <sub>Est</sub> (bbls)= 2.9 BARRELS
24. Net Total Estimated Spilled Volume V Est(bbls) = Vevap(bbls) + 0.6*Vwat (bbls) + Vinf (bbls) +
$V_{pool}$ (bbls) + $V_{recJ}$ (bbls) = 0.72+ (0.6 x 0.63)+ 1.5+ 0.03+ NIL =
2.63
VEst(bbls)= 2.6 BARRELS
*Calculation of the respective estimated volume is to be done using the new spill estimation software on site
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29
*Emulsification factor for spill on water to consider is 60% of volume of oil.
25. GENERAL STATUS OF THE SITE
A. Joint investigation of the incident site found that there is no residual impact After the
initial response and therefore recommend that the site be closed out
B. Investigation of the incident site showed that there is residual impact on site requiring
further works
26 Signatories
This report was filled and signed on the investigation representatives from
Host Community
• Department of Petroleum Resources [DPR]: □
National Oil Spill Detection and Response Agency [NOSDRA]:
State Ministry of Environment [SME]:
Nigeria Police Force [NPF]:□
Shell Petroleum Development Company [SPDC]:
Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: U128 725931

20. Appendix 1: Overview sketch of the site

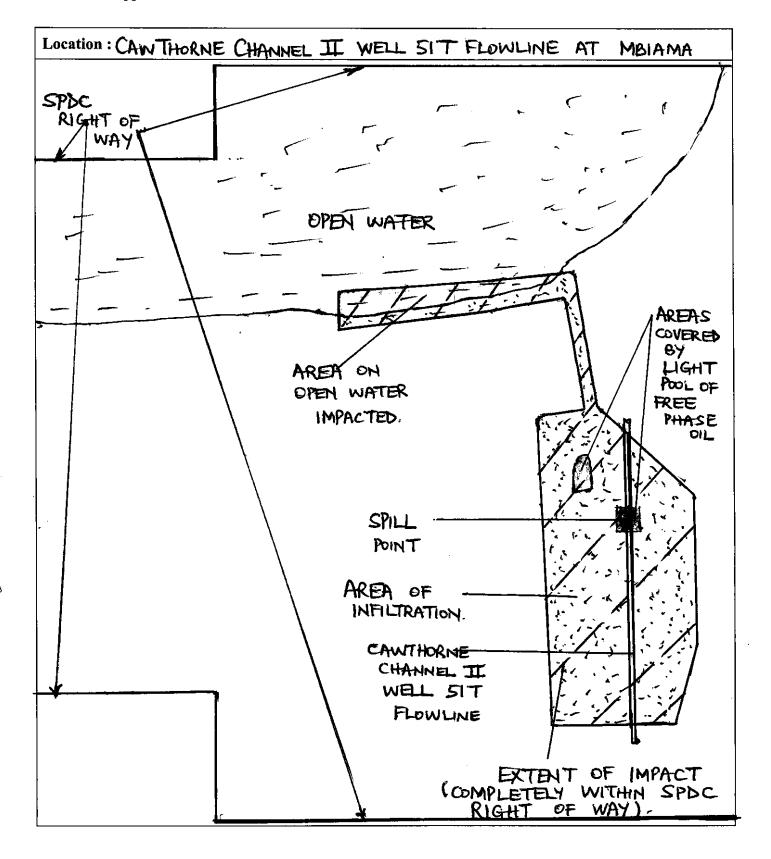

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 72593128

# 21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

Northing	Easting
-	
/	
<b>/</b>	
	Northing