THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0336/854331(862158)

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

	AL INFORMATION:	•	
l. Spill incid	dent Number: 8543	3 1 (862/152) Type	of incident * OIL SPILL
3. Name of	Location MORIVER W	ELL 445 FLOWL	INE (BEHIND IMORIVER WED 5)
4. Name of	nearest community [GIRIUK	WUOWAZIS. State: AB	JA 6. LGA UKWA -WEST
7. Type of P	roduction facility/Installation		
B. INCIDE	NT INFORMATION:	NOTE: JIV CONFIG	amed that the Spill impact was from Mber 854331. The current impacted
		AREA WAS	NOT ACCESSED DURING PREVIOUS JIV
), Details of	te of incident: 3074 AUG	10-2012	THIS ASSED DURING PREVIOUS JIV
a. Da	te of incident:	131 ACT 20	THIS ASSESSMENT SUPERSEDES
D. Sta	rt date/time of investigation:	A SENIEWER VO	FOR 854331
	scription of spill point environm		FOR 854331. " " " " " " " " " " " " " " " " " " "
	scription of spiri point environit Firmed soil	_	programme districts
_		Loose soil	Previously excavated area
	Under water	Swampy	Exposed pipe surface
	Well Plateform (on Water) scription of leak point (tick as a	oplicable):	$\square_{ m Rig}$
	Drilled hole	Hack saw cut	☐Explosive tear,
_	Complete Rupture	☐ Inward dent,	☐ Well head tampering
_	Failed Weld-on illegal hot tap v	ŕ	☐ Missing Pipeline/Flowline)
	Crude oil theft (illegal) bunkeri		☐ Third party tampering with Clamp
_	Third party tampering with val		☐ Third party tampering with flange,
_	Corrosion	Saver-pit over flow,	☐ Surge vessel overflow
_	Outward dent	☐Flare System/Bund v	•
	Valve Failure	Com unit failure	□ Cold vent
	Relief valve failure	Others (specify)	— Cold Yelli
	ident caused by:	_	_
	Third party interference	☐Operational	∐Mystery
g. Spi	Il point coordinates	Min A	SELT (MINNA)
	Measuring unit W CIERS	1110-6	
	Northing:	l	Easting:
			\
	108908) I	5 24050 29
		^	
			1

THE SHELL PETROLEUM DÉVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0336/854331(862158) C. RISK ASSESSMENT

o. 1110/170	occomic.	••					
10.	Туре	of environment:					
₽ ′L	and	□ Swamp	□ Water	☑ Sea:	sonal sw	amp	
i.	Type of	f environment to	which oil has sp	oread:			
₽ Z'L	and	Swamp	□ Water	□ Rive	er (identi	ify)	_
ii.	Weathe	r condition					
		☑Sunny ne nearest sensiti	ve habitat				
□ D □ F □ F □ F □ C	Orinking was built up are armlands lish Farm/P lishing net Others (spec	ater source a ond	esignated protect	ed area]]] []	,m] ,m] ,m] ,m] ,m]	APPLI CABLE
⊠ ′B	ooms	☐ Trench	☑Dyke				
□ o	thers:						
13. Any p	oictures or v	video coverage?			M	[N]	
14. Was t	here any di	isruption to the i	nvestigation?		[Y]	(X)	
If yes give brie	f description	on:					
- NE	T	APPLI	CABL	E			
D TVDE/NIII	MDEDSO	E DDADEDTII	EC LEANVEO	* ('A/EA SE/E/E)		CADEA OF CRD	

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	41	1			
_	NONE !		N AK	EA OF IM	HCK
			-		

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	MANIE	Llogina) a v	$\cap c$	6.4.0 A	
	NUME	$N \cap H \cap N$	AKEN	UF I	MYHCI	

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
		THU ADEL	AT LADA	
	IN ONE WI	NITIN AKER	104 11 17 HC	<i>-1</i>
[l

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description		Quantity/Size	Comments
	MOUL	1.1171111	1051		101 -
	NONE	<u> </u>	<i>HKF#</i>	+ OF IM	1411

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF THE 4" IMORIVER FLOWLINE AT IGIRIUM BEHIND
IMOR WELL 5 SHOWING HACKSAW CUT AT 3 O'CLOCK POSITION

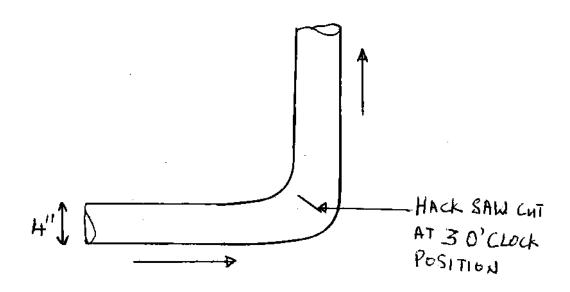

Page 3 of 9

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: $0336/85\mu331(862158)$

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

S/N	Northing Mark	Easting METERS
	108908-25	524062.61
	108905.17	524065.68
	108 892.91	524053.34
	10888 9.87	524034.85
	108889-88	524031.77
	108880 67	524025 59
	108874.52	524028.65
	108865.33	524016.31
	108859 22	524000.90
	108856-16	523994.73
	108853:12	523981.40
	10840.87	523960.8
	108853-18	52395160

G INCIDENT INFORMATION:

20	Impacted	Aran	Dataile
711	impacied	ATEX	DEIAHS

Total calculated area of impact	0.54 HA	
Impact within SPDC R.O.W	·	
Impact outside R.O.W		
21. Volume of oil recovered before completic	on of JIV (V _{rec.J}):	
Recovered	doil/mot NIL	barrels
 20. Computation of the residual volume on si a. Computation of volume of pool of free phase i. Area (m²) occupied by pool of free phase 	oil (on land or confined water body). 351	0_

THE SHELL PE	TROLEUM DE	EVELOPMENT COM	//PANY	0330/8543	71/8621
JOINT INVE	STIGATION REP	ORT FOR INCIDENT	NO:	<u> </u>	3/1000.
iii, Emulsification	factor:N1	<u>L</u>			
iv.	Volume of	pool of free phase oil. V	ool:	22.1	barrels
h Committee	of volume of infile	rated oil in the soil (V _{int}	3		
-		vered by the oil:	1890	ý _	
	•	ool of free phase oil in to			
	iii Average Dept	h (m) below ground sur	face of in	filtration of oil: 0.01	25
	iv Soil type: 5	AND (MEDIUM)			
		porosity of the soil).	257		
		of infiltrated oil. V _{inf}		1.0 =	barrels
	iv. Volume	or minutated on white		42.5	
	of oil on open wate			ard coloration.	
ii. Table of av	erage depth of oil o	n water based on coloratio	N **		
	Thickness (mm)	Percentage coverage		Volume (m3)	7
Barely Visible	0.00004				-
Silvery					-
Slight Color		1 1 1	A 100	1.1.6.1.0.1.0	-
Bright Color		HALLET .	AVY.	 	-\
Duil	0.001	 	/ 	LIUTIONE_	-
Dark Blackoil	0.002				1
Emulsion (30% Oil	,			-	1
	Percent Total	1:	00%	Total Volume	bbl
· iii. [Volume of o	il on open water. Vwa	-	NIL.	barrels
L. 22. Calculation	of evaporated vo	lume:		<u> </u>	
i. Oil type: BONNY MEDIUM					
	actor: 15/6				
iii.	iii. Volume of evaporated oil V evap: L				
					
Oil Type Evapor	Days on site		lonny Iedium		
	4-	<u> </u>	TOUTHIII		

Evapor	ration Factors (E-Fa	actor) for SPDC Crue	de oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
_	> 7 days	40%	25%


^{*}If area is not same as the total area of impact, please indicate in the overview sketch ** Spill Factor from USCG FOG (2000 Edition)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED (862158) JOINT INVESTIGATION REPORT FOR INCIDENT NO: 23. Gross Total Estimated Spilled Volume $V_{\text{Est}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{recJ}}(\text{bbls})$ $V_{Est}(bbls)=$ 11.4+ NIL+42.5+22.1+ NIL = 76 24. Net Total Estimated Spilled Volume $V_{\text{fst}}(bbls) = V_{\text{evap}}(bbls) + 0.6*V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{\text{pool}}(bbls) + V_{\text{recJ}}(bbls)$ 11.4 + NIL + 42.5+22.1 + NIL *Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site *Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oil. 25. GENERAL STATUS OF THE SITE A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out B. Investigation of the incident site showed that there is residual impact on site requiring further works 🗹 **26 REPRESENTATIVES** 06/09/2012 at incident site by joint This report was filled and signed on the investigation representatives from Host Community ☑ Department of Petroleum Resources [DPR]: • National Oil Spill Detection and Response Agency [NOSDRA]:√∑ State Ministry of Environment [SME]: □ Nigeria Police Force [NPF]:□ • Shell Petroleum Development Company [SPDC]: ✓

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0336/854331 (862158)

27. Appendix 1: Overview sketch of the site

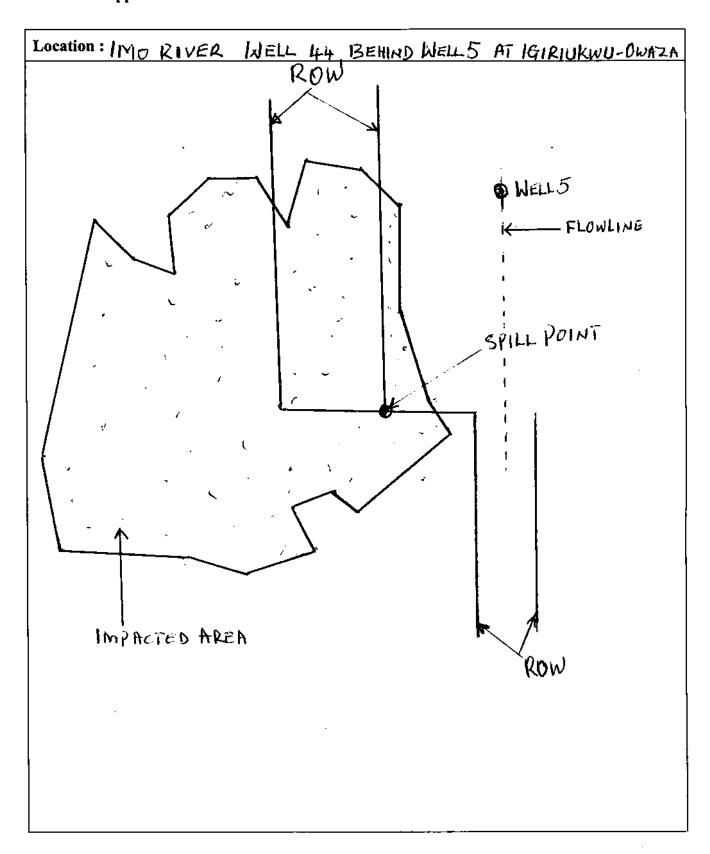

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0336/854331(862158)

JOINT INVESTIGATION REPORT FOR INCIDENT NO:

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING MID-DELT (MINNA) JIV FOR AREA CALCULATION

		11119-15ELF (11111NA)
S/N	Northing M ETER>	Easting METERS
	10893 H	523936. 27
	108886-95	52395 7 .82
	108880.79	523967-05
	108877.69	523982.45
	108893.04	523985.56
	108908-38	523997.92
	18917 59	524001.02
	108923.72	524004.11
	198 932 91	524019.53
	10892367	524031.83
	108945.17	524031.85
	108945.14	524044.20
	108942.05	524053.44
	108923.62	524056.48
	108908.25	524562.61
-		