JOINT INVESTIGATION REPORT FOR INCIDENT NO: 109 6930 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1096730 2. Type of incident* OU SPILL
3. Name of Location 4" NELL 675 FLOWENS 4. Name of nearest community UANO KWA 5. State: RIVERS 6. LGA 7. Type of Production facility/Installation OU TLOW LINE 8. Asset owner/District LAND B. INCIDENT INFORMATION: 9. Details of incident tails of incident

a. Date of incident: 3151 DECEMBER 2013

b. Start date/time of investigation: 320 JANUARY 2014 ! 11:15 Hours

c. Investigation End date: 32 JANUARY 2014 Actual investigation duration, days: 1 204 d. Description of spill point environment Firmed soil Loose soil Recently excavated area Under water □ Swampy Exposed pipe surface □Well Platform (on Water) Drill Rig e. Description of leak point (tick as applicable); Hack saw cut Drilled hole Tear (☐Inward dent. Complete Rupture ☐Well head tampering ☐Failed Weld-on illegal hot tap valve, ☐Failed Clamp ☐ Missing Pipeline/Flowline Crude oil theft (illegal bunkering) point, ☐ Third party tampering with Clamp ☐ Third party tampering with valve setting, ☐ Third party tampering with flange, Corrosion ☐Saver-pit over flow, ☐Surge vessel overflow, ☐Bulging Outward □Flare System/Bund wall failure □Accidental □ Valve Failure Com unit failure equipment impact □Cold vent Relief valve failure Others (specify) f. Incident caused by: ☐Third party interference (Sabotage☐; crude theft☐; Line theft☐; Accidental 3rd party damage☐) Operational Others (including Mystery spills)_ g. Spill point coordinates Measuring unit Easting: (M) Northing: [Jun] 103303.57

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1996930 JIV report S/N:	0376
o Dick accesment	

. RI	SK ASS	ESSMENT		•				
	10.	Type of env	ironment:					
	□ La	and \square s	wamp [lWater	Season	nal swamp 🗆 Sho	reline/Waterfro	ont
	i.	Type of envir	onment to which	h oil has spread	1:			
		and \square_S	wamp [Water	River	(identify)		
	ii.	Weather cond	lition					
13	□Rai I. Distan	in 🔼 Ši ice from the nea]Dry □V bitat	Vet	□Windy	N Hot C	lcool
	0 D 0 B 0 F 0 F 0 F	overnment reservinking water so uilt up area armlands ish Farm/Pond ishing net thers (specify).		ated protected a	rea	[,m] [,m] [,m] [,m] [,m]		
13	2. Conta	inment measure	s put in place;					
		ooms 🔲	Trench [Dyke	□Natur	al depression	□ Pit	
1	3. Any p	oictures or video	coverage?			[N]		
1	4. Was t	here any disrupt	ion to the inves	tigation?		[Y] [W]		
If yes	give brie	of description:					_	
	\bigwedge	107	- 	TP.	PJ	10	1BI	
D. T	YPE/NU.	MBERS OF PI	ROPERTIES, I	F ANY, FOUN	D WITH	IN THE AREA	OF SPREAD	OF OIL
1	5. Struc	ctures / Propert	ies					
S/N	Type of	f Structures	Description	Size	Numbe	er	Comments	
							# 1 m 1	000
	⊺/1x /	: ا ن ت ا	. 1	: - + <i>! ! كسو</i> ها [, /\	∧ -: <u>*</u> L	<u></u>	211

1	6	Cron	s/Ecc	nom	ic	Tree	S

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1896930 JIV report S/N: 0376

S/N Type of crops Young	Medium Matured	Quantity	Comments
NONE	ITH IN AREA	of in	MACS

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments	
	VONE	WITHIN	AREA	OF	IMPACT
<u> </u>					

18. Others (Specify) i.e. Animal Traps

S/N O	thers	Description	Quantity/Size	Comments
	SMOP	WITHIN	AREA	of impact

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

A SECTION OF 4" WELL 695 FROMING AT UMUDENA SHOWING FAILED CHAMP.

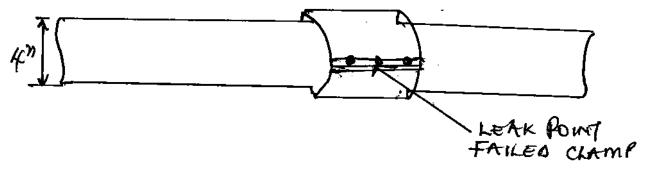

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1096930 JIV report S/N: 0376

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

		CINNED-MIN DELT
S/N	Northing (W)	Easting Com
301	103318 - 91	510/84-01
302	103297 42	510184-01
303	103303 - 58	510168-57
	· · · · · · · · · · · · · · · · · · ·	
,		
r .		
	/	
		·

G. INCIDENT INFORMATION:

20. Impacted Area Details

•	Total calculated area of impact_	0.01Ha
	Impact within SPDC R.O.W	YES
•	Impact outside SPDC R.O.W	<u></u>


21. Volume of oil recovered before completion of JIV (V_{recI}):

	Recovered oil V _{recl} :	Barrels
22 Commutat	tion of estimated residual volume on site	
	ion of estimated volume of pool of free phase oil (on land or confined water bo	dy).
i.	i. Area (m²) occupied by pool of free phase oil	-
ii.		-
iii.		
iv.	25 cm area volume or poor or reco planse one.	barr
	V _{proof} : U-S	
	ion of estimated volume of infiltrated oil in the soil (V_{inf}) . timated Volume of infiltrated oil at spill point (V_{inf}) .	
i.	Area* (m²) of soil covered by the oil: 2m²	
ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline:	
iii.	Soil type: $Clay$ iv. P_e (effective porosity of the soil).	
v.	Cause of spill: CRERATIONAL Oil type: BONNY LIGHT	
vii.	Oil Residence time on site, day: THREE BAYS	
viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline:	r 0019
ix.	Estimated depth of infiltration around spill point: 1-0019 m	_
2. Est	Estimated Volume of infiltrated oil at spill point. Violational Infiltrated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	ba
i.	Area* (m²) of soil covered by the oil	
ii.	Average Depth (m) above leaking facility i.e. pipeline/flowline:	
iii.	Soil type: iv. P_e (effective porosity of the soil)	
v.	Cause of spill: Oil type; A	
vii.	Oil Residence time on site, day:	_
viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline:	
ix.	Estimated depth of infiltration around spill point:	
	Estimated Volume of infiltrated oil at spill point Vacan	barrels
3. E		
	mated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)	
	mated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c) Area (m2) of soil covered by the oil: 76 m²	
stir	C'	
stin	Area (m2) of soil covered by the oil: 96 m2	
stin i. ii.	Area (m2) of soil covered by the oil: $\frac{96 \text{ m}^2}{2 \text{ m}^2}$ Area (m²) of the pool of free phase oil in touch with soil: $\frac{2 \text{ m}^2}{2 \text{ m}^2}$	
stir i. ii. iii.	Area (m2) of soil covered by the oil: 96 m² Area (m²) of the pool of free phase oil in touch with soil: 2 m² Average Depth (m) below ground surface of infiltration of oil: 0.000	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1896930 JIV report S/N: 0376

ii. Table of average depth of oil on water based on coloration (

**Spill Factors from USCG FOG (2000 Edition)

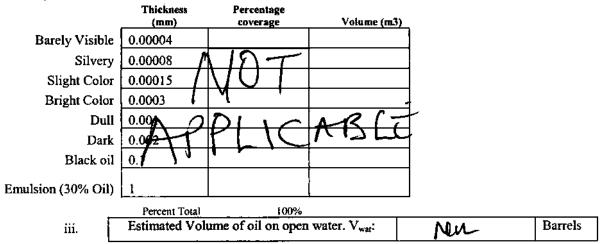

24. Calculation of evaporated volume:

i. Estimated Volume available for evaporation within surface area: 3.558

ii. E-Factor: 25 %

Evap	oration Factors	(E-Factor) for SPD	C Crude oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25% 🗸	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume
$$V_{psi}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{rec}(bbls) = 1.18 + MLL + 1.05 + 0.5 + 2 = 4.74$$

$$4.74 = 58 \text{ Arres 8}$$
Estimated Reported Volume** $V_{rep}(bbls) = 58 \text{ Arres 1.8}$

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than | I bbl | is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1096930 JIV report S/N: 0376

	Investigation of the incident site showed that there is residual impact on site requiring further works
27.	. REPRESENTATIVES
his represe	report was filled, agreed and signed on the 3/01/2014 by joint investigation entatives from
•	Host Community:
•	Department of Petroleum Resources [DPR]:
•	National Oil Spill Detection and Response Agency [NOSDRA]:
•	State Ministry of Environment [SME]:
•	Nigeria Police Force [NPF]: □
•	Shell Petroleum Development Company [SPDC]: 🖸
•	Signatories agree with reported findings:
•	Separate DPR form has been filled out with same findings
	Tick as applicable
28.	Appendix 1: Overview sketch of the site
ion :	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1076930 JIV report S/N: 0376

