JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000834 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1000884 2. Type of incident* OIL SPILL 3. Name of Location IMO RIVER 3 WZZS 4. Name of nearest community IGIRIKWU 5. State: ABIA 6. LGA UKWA - WEST 7. Type of Production facility/Installation FLOW LINE 8. Asset owner/District LAND 1 EAST **B. INCIDENT INFORMATION:** 9. Details of incident a. Date of incident: 1ST JULY, 2013 a. Date of incident: 1 34-7, 2013

b. Start date/time of investigation: 3RD JULY 2013 / 14-80 HFS

c. Investigation End date: 03 - JULY 2013 Actual investigation duration, days: DNF(1) DAY d. Description of spill point environment Firmed soil Loose soil Recently excavated area Swampy Exposed pipe surface ☐Under water Drill Rig ☐Well Platform (on Water) e. Description of leak point (tick as applicable); ☐ Tear (______), ☐ Drilled hole Hack saw cut ☐Well head tampering Complete Rupture ☐Inward dent. Missing Pipeline/Flowline ☐ Failed Weld-on illegal hot tap valve, ☐ Failed Clamp ☐ Third party tampering with Clamp ☐ Crude oil theft (illegal bunkering) point, Third party tampering with flange, Third party tampering with valve setting, ☐ Surge vessel overflow, ☐ Saver-pit over flow. ☐Corrosion □Flare System/Bund wall failure □ Accidental 3rd party equipment ☐Bulging Outward Cold vent ☐Valve Failure Com unit failure Others (specify)_ Relief valve failure f. Incident caused by: ☑Third party interference (Sabotage□; crude theft□; Line theft☑; Accidental 3rd party damage□) Others (including Mystery spills)_ g. Spill point coordinates Measuring unit CP1: 108593.8 CP2: 108421-8

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000884 JIV report S/N: 0159

C. F	RISK ASSESSMEI	NT						
	10. Type	of environment:			:			
	☑ Land	□Swamp	□water	₽	Seasonal swar	mp□Shore	line/Wate	erfront
	i. Type o	of environment to	which oil has	s spread:				
	□ Land	☑ Swamp	□water		River (identify	y)		
	ii. Weath	er condition						
	☐Rain 11. Distance from t	Sunny he nearest sensitiv	□Dry ve habitat	□wet	□. Wind	dy C]Hot	⊠ cool
	☐ Governmer ☐ Drinking w ☐ Built up are ☐ Farmlands ☐ Fish Farm/ ☐ Fishing net ☐ Others (spe	ea Pond t	signated prot	tected area	[[[[,m] ,m] ,m] ,m] ,m] ,m]	NES	EEN ICIHITY
	12. Containment m	easures put in pla	ce;					
	□Booms □Others:	Trench	□Dyke	12	Natural depre	ssion []Pit	
	13. Any pictures or	video coverage?			[X]	[N]		
	14. Was there any o	disruption to the is	nvestigation?	•	[Y]	M		
If ye	es give brief descript	tion:						
	NOT	APP	LIC	A BL	E			
	TYPE/NUMBERS		es, if any,	FOUND	WITHIN THI	E AREA OI	F SPREA	AD OF OIL
S/N	Type of Structs	ures Descri	iption Size		Number		Comme	ents
					• .			
	NONE	WITHI	# 	REA	OF	/Mf	AC.	T
	 							

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000884 JIV report S/N: 0159

				-	
Crops/Economic Trees	s		-	1	

Type of crops	Young	Medium	Matured	Quantity	Comments
				-	
MAUE	الملكات والم	10-	۸r	IMPAGE	
NUNE	יין נותונאו	AKEA	UP	TITIT HCI	
				-	
_	NO NE				

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
-			i	
	Maur He	7/111 AOF A	OIZ IM	DART
	NUNE WI	IHIN AKEH	OF IM	TACI
<u>├</u>				

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE I	NITHIN ARE	A OF	MPACT
	140111-		<u> </u>	

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF WELL 22S IMO RIVER 3 FLOW LINE AT IGIRIKWU SHOWING THE ISSING (STULEN) PURTION OF THE LINE

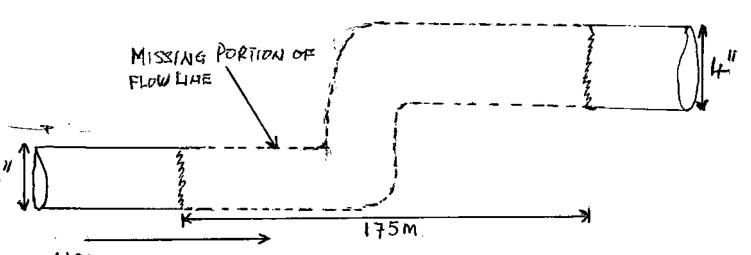

W228 TO IMORIVER 3 FLOW STATION Page 3 of 9

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000 884 JIV report S/N: 0159

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

S/N	Northing	Easting
<u> </u>		
CP1	108593-8	524604.2
£602	108559.9	524662.6
P603	108578.4	524662·6 524659·6
1604	108569-1	524681.1
1605	/68 <i>58</i> 7·5	524699.7
9606	108421.6	524699.3
P607	108409.4	524693-1
P607 P608	108412.4	524680.8
1609	108409.4	5246654
CP2	108421.8	524637.7
	•	
	 	
		<u> </u>
		·

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000884 JIV report S/N:	0159
G. INCIDENT INFORMATION:	
20. Impacted Area Details	
Total calculated area of impact 1 24 Ha	
Impact within SPDC R.O.W	_
Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V _{reci}):	
Recovered oil V _{recJ} : NIL	Barrels
22. Computation of estimated residual volume on site a. Computation of estimated volume of pool of free phase oil (on land or confined water body)	
 a. Computation of estimated volume of pool of free phase oil (on land or confined water bod i. Area (m²) occupied by pool of free phase oil 7440 h² 	(y).
ii. Average Depth (m) of pool of free phase oil 0.002 M	
iii. Emulsification factor: AlL	
iv. Estimated Volume of pool of free phase oil. V _{pool} : 93.6	barrels
 b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}). 1. Estimated Volume of infiltrated oil at spill point (Vinf a) 	
. ሂ	
i. Area* (m²) of soil covered by the oil: 124 M	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline:	
iii. Soil type: $CLAY$ iv. P_e (effective porosity of the soil). 8%	
v. Cause of spill: HTER PARTY vi. Oil type: BONNY MEDIUM	
vii. Oil Residence time on site, day: 2 MYS	ana5M
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:	ויי כ <u>יטטע</u>
ix. Estimated depth of infiltration around spill point: D. DOD5 M	_
Estimated Volume of infiltrated oil at spill point. V _{inf_a} : O.O	ス barrels
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipeline flowline:	
iii. Soil type: iv. P. (effective corosity of the soil)	
v. Cause of spill:	
vii. Oil Residence time on site, day:	
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:	
ix. Estimated depth of infiltration around spill point:	_
Estimated Volume of infiltrated oil at spill point. V _{inf_b} :	barrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

i.	Area (m2) of soil	covered by the oil:	4860	M ²	
ii. A	Area (m²) of the I	oool of free phase o	oil in touch with	soil: 620	N2
		n) below ground si			
	Soil type: CLA		mace of minimal	on or on. O - OC	<u> </u>
			07		
		osity of the soil)	016		
`	vi. Estima	ted Volume of infi	Itrated oil. At V	of ²	5 f barrels
23. Computation	of estimated v	olume of oil on o	nen water hace	on standard cal	oration
	of oil on open wa		pen water baset	on standard cor	oration.
	-	oil on water based o	on coloration (— **Coill Eastonn fo	UECC EOC (2000
	-		,	Edition)	om USCG FOG (2000
	Thickness (nun)	Percentage coverage	Volume (m3)		
Barely Visible		to the age	· oranie (urz)	1	
Silvery				1	
Slight Color	0.00015	11 00		1	
Bright Color	0.0003	NOT		1	
Dull	0.001			1	
Dark	0.002	ADPICA	ABIE	1	
Black oil	0.1	71774	/ V ~ ~ ~	1	
Emulsion (30% Oil)	1				
_	Percent Total	100%			
iii.	Estimated Volu	me of oil on open	water. V _{wat} :	NIL	Barrels
24. Calculation of	of evaporated vo	olume:			
i. Estir	nated Volume a	vailable for evap	oration within	surface area: 9	<u>5-15</u> RBLS
ii. E-Fa	actor: 15 %				
iii.	EstimatedV	olume of evaporate	ed oil. V _{evap} :	16.79	Barrels
Evar	oration Factors	(E-Factor) for SI	PDC Crude oil		
Oil Type	Days on site	Bonny Light	Bonny Med	lium	
Oil Residence time	< 1 day	10%		5%	
	1-7 days	25%		15%	
	> 7 days	40%		25%	
	- / Guys				
25 Not Fetimal		lume V. (bble)	= V (bble) ±	V = (bble) + V	(bbls) + V -
25. Net Estimat	ted Spilled Vo	lume V _{Est} (bbls)	= V _{evap} (bbls) +	V_{wat} (bbls) + V_{mat}	inf (bbls) + V _{pool}
25. <u>Net Estimat</u> (bbls) + V _{recl}	ted Spilled Vo	lume V _{es} (bbls) 79 + NIL +	= V _{evap} (bbls) + - 1.55 + 1	V_{wat} (bbls) + V_{d}	(inf (bbls) + Vpool 111-9481
25. Net Estimat (bbls) + V _{rec}	ted Spilled Vo	79 + NIL +	= V _{evap} (bbls) + - 1.55 十 ¹	V _{wat} (bbls) + V 13-60 + N	(inf (bbls) + Vpool 111-9481

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000884 JIV report S/N: 0159

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume $(m3) \times 6.29$; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl

Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
 - B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 03/07/2013 by joint investigation representatives from

- Host Community:

 ✓
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]: □
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: □
- Shell Petroleum Development Company [SPDC]: 🔽
- Signatories agree with reported findings: VZ
- Separate DPR form has been filled out with same findings□

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000884 JIV report S/N: 0159

28. Appendix 1: Overview sketch of the site

