JOINT INVESTIGATION REPORT FOR INCIDENT NO: 100 60 60 JIV report S/N: 0144

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)
A. GENERAL INFORMATION:
1. Spill incident Number: 1506060 2. Type of incident* OIL SPILL
3. Name of Location 24" Bomu - BONNY TRAN NIGER PIPELINE
4. Name of nearest community OWOKIN/BODS. State: RIVERS 6. LGA GOKANA ANDONE
4. Name of nearest community OWOKIN/BODS. State: RIVERS 6. LGA CIT KANA AND NOT Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE SKIMP
B. INCIDENT INFORMATION:
9. Details of incident a. Date of incident: 10 TH JuLY, 2013 b. Start date/time of investigation: 13 TH JuLY, 2013 c. Investigation End date: 14 TH JuLY, 2013Actual investigation duration, days: 14 TH JuLY, 2013Actual investigation duration duratio
Firmed soil
☐Under water ☐Exposed pipe surface
□Well Platform (on Water) □Drill Rig
e. Description of leak point (tick as applicable);
Drilled hole Hack saw cut Tear (),
☐Complete Rupture ☐Inward dent, ☐Well head tampering
Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline
Crude oil theft (illegal bunkering) point, Third party tampering with Clamp
☐Third party tampering with valve setting, ☐Third party tampering with flange,
□Corrosion □Saver-pit over flow, □Surge vessel overflow,
□Bulging Outward □Flare System/Bund wall failure □Accidental 3 rd party equipment
impact
□Relief valve failure □Others (specify)
Difference varve faithte Domers (specify)
f. Incident caused by:
Third party interference (Sabotage□; crude theft□; Line theft□; Accidental 3 rd party damage□)
Operational Others (including Mystery spills)
g. Spill point coordinates Measuring unit METER (MINNA MIN - EETT) Northing: Easting:
62076.83 532159.38

OINT INVESTIGATION RI	EPORT FOR IN	ICIDEN	T NO: 100	6060 <u> </u>	JIV report	s/N: 0	144
C. RISK ASSESSME	NT						
10. Type	of environment:			2			
□Land	Swamp	□w	ater [Seasonal swa	amp□Shore	eline/Waterf	ront
i. Type o	of environment to	which o	il has spread:				
□Land	Swamp	□w	ater [River (identi	fy)		
ii. Weath	er condition						
Rain 11. Distance from t	Sunny he nearest sensiti	□Di	•	t 🗆 Win	ndy [□ _{Hot} [□cool
☐ Governmen ☐ Drinking w ☐ Built up an ☐ Farmlands ☐ Fish Farm/ ☐ Fishing net ☐ Others (spe	ea Pond	esignated	l protected are	a [[[[,m] ,m] ,m] ,m] ,m]	None WiThi Vicin	SEEM H HTY.
12. Containment m	easures put in pla	ace;					
Booms Others:	Trench		yke [Natural depre	ession [□Pit	
13. Any pictures or	video coverage?			[Y /	(N)		
14. Was there any o	lisruption to the i	investiga	tion?	[Y]	[N /	•	
If yes give brief descript	ion:						
H	07	X	PPLI	CA	BL	£	
D. TYPE/NUMBERS	OF PROPERTI	ES, IF A	NY, FOUND	WITHIN TH	E AREA O	F SPREAD	OF OIL
15. Structures / Pr		•	,				
S/N Type of Structs		iption	Size	Number		Comment	ts
1 1	_			A .		e 1:	<u> </u>

S/N	Type of Structures	Description	Size	Number	Comments
			<u> </u>		F 13400 T
'	$N \times N \times -$			AVCA	N - X VACU
	10116			1/27	4 11111
	1 - 1	1 41.	, ,		
	<u> </u>		<u> </u>	<u> </u>	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 400 60 60 JIV report S/N: 0144

1	6. Crops/E	cono	mic Trees				
S/N	Type of cr	ops	Young	Medium	Matured	Quantity	Comments
					<u> </u>		
<u> </u>	~ X [/	₹	17.74	K	62 A	7	MOLO


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description		Quantity/5	Size	Comme	nts
N	TONE K	MIHIM	AR	ea	Č	AF.	IMPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
1	ONE L	THIN A	REA	OF IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

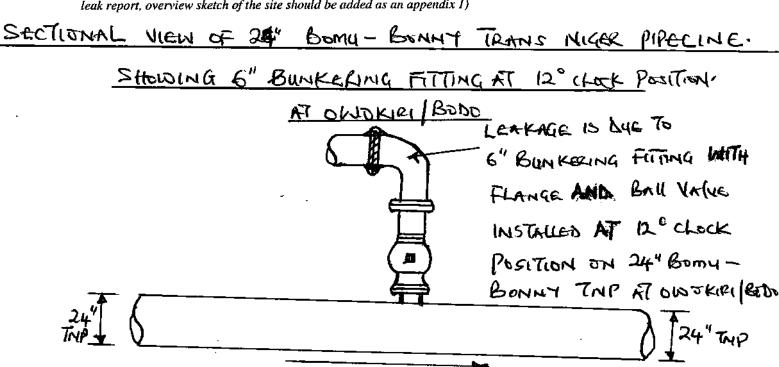

Bonn-Bongs & BIRELINE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1006060 JIV report S/N:

0144

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	WINN	Easting (McTex)
S/N	Northing (METER)	Easting (MC C2)
	62079.91	532153.22
	62079.88	532174.79
	62135-14	532190:30
	62136.90	532157.98
	62259.98	532275.46
	6 2221·35	532423.10
	62205.48	532416.75
	62231.93	532382.35
	62322.33	532362.24
	62263.12	532352.19
	62275.33	532320.44
	62282.73	532299.80
	62277.44	5 32289.75
	62.250.98	532271.76
	62239.87	532257.47
	62213.94	532239.48
	62181-66	532218.31
	62148.33	532195.56
	62145.15	532190.26
	62107.05	532182.87
	62069.48	53216751
	62101.76	532157.99
	62138-27	532165.39
	62136.15	532147.40

NCEDENT	Ŋo	:	06060

	THE SALL CO. SO BOBO
	o-Bai
NORTHING (METER)	CASING CARTER
62137.21	532130.99
62161.55	532147.93
62159-44	532154 · 81
62175-84	532170.16
62209.71	532181.80
62220.29	53220f · 55
62252-57	532217.25
69278.50	532231.01
62290.14	532240.01
62303.90	532253.76
62321.36	532297.69
62317-13	532326.26
62293.32	532356.95
62273.21	532396 64
62265.80	532405.11
62230.88	532416-22
62321-15	532314.02
62178.84	532187-62
62165-62	532173.33
62160.32	532162.75
62284.15	532371.24 Jan 12513.
€2499 67	532371.24 7JBm 532158.81 .c 107/2013.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1506560 JIV report S/N:	0144
G. INCIDENT INFORMATION:	
20. Impacted Area Details	
1.51 Hz	
Total calculated area of impact	
Impact within SPDC R.O.W	_
Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V _{recj}):	
Recovered oil V _{recl} : NIL	Barrels
22. Computation of estimated residual volume on site	
 a. Computation of estimated volume of pool of free phase oil (on land or confined water bod i. Area (m²) occupied by pool of free phase oil	y).
ii. Average Depth (m) of pool of free phase oil 6.5 m	
iii. Emulsification factor: 30 %	
iv. Estimated Volume of pool of free phase oil. V _{pool} : 4.40	barrels
 b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}). 1. Estimated Volume of infiltrated oil at spill point (Vinf a) i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 1-2m	
iii. Soil type: $CLNY$ iv. P_e (effective porosity of the soil).	A
v. Cause of spill: THIRD PARTY vi. Oil type: Bonny Meisture.	<u> </u>
vii. Oil Residence time on site, day: Two (2) (2)	
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: O	wE000.
ix. Estimated depth of infiltration around spill point: 1.2003 m	
Estimated Volume of infiltrated oil at spill point. V _{inf_a} : 8	46 barrels
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: Num	
iii. Soil type: iv. P_e (effective porosity of the soil) NeL	-
v. Cause of spill: Nth vi. Oil type: Nth	
vii. Oil Residence time on site, day: NIL	.1
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:	<u> </u>
ix. Estimated depth of infiltration around spill point:	
Estimated Volume of infiltrated oil at spill point. Vint.b: NOT APPLICATE	harrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

THE SHELL			_	NY OF NIGERIA L	IMTED. 0144
i. A	Area (m2) of soil	covered by the oil	: 4 5	728 m2 _	
	_	pool of free phase		oil:	
	, ,	•		on of oil: 0 60 t	ე <u>ვ</u> უ
	Soil type: CL				
	• •	osity of the soil)	8%		
	• •	ated Volume of inf	-		6 barrels
V	i. Estim	ated Volume of inf	mirated off. At Vi	nf:	7 Daniels
i. Total area	of oil on open w	ater: (D, 2 oil on water based	20 Mz	l on standard colora — **Spill Factors from Edition)	
Barely Visible	0.00004	(1	
Silvery	0.00008				
Slight Color	0.00015				
Bright Color	0.0003	70 %	0.0021		
Dull	0.001	30 %	0.6021	_	
Dark	0.002			_	
Black oil	1.0			_	
Emulsion (30% Oil)	I				
iii. 「	Percent Total Estimated Vol	ume of oil on open	0.0057	<u> </u>	Barrels
24. Calculation of			Wat.	0.00	
i. Estir	•	available for eva	poration within	surface area: 13 ·	58 h nercls
iii.	Estimated	Volume of evapora	ted oil. V _{evap} :	2-40	Barrels
Fyar	oration Factor	s (E-Factor) for S	SPDC Crude oil		
Oil Type		Bonny Light		dium	

Evap	oration Factors	(E-Factor) for SP	DC Crude oil			
Oil Type Days on site Bonny Light Bonny Medium						
Oil Residence time	< 1 day	10%	5%			
<u> </u>	1-7 days	25%	15%			
	> 7 days	40%	25%			

25. Net Estimated Spilled Volume V _E	$v_{\text{evap}}(bbls) = V_{\text{evap}}(bbls) + V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{\text{pool}}$
(bbls) + V _{recl} (bbls) = 15.98 + 8	.03+9-14+ 4.40+ NIL=
	15-98 Breek
Estimated Reported Volume** V _{rep} (bbls)=	16 Breechs.

JOI	INVESTIGATION REPORT FOR INCIDENT NO: 10060 60 JIV report S/N: 0144	
	alculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation of tware on site; Conversion of m³ to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules: • Any spill volume in excess of 1 bbl is rounded up to the next whole number.	g
	Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.	
	Examples: Calculated volume = 15.3 bbl Reported volume = 16 bbl Calculated volume = 0.35 bbl Reported volume = 0.4 bbl Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.	
	therever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropri eps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.	ate
	26. GENERAL STATUS OF THE SITE	
;	A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out	
	B. Investigation of the incident site showed that there is residual impact on site requiring further works	•
L		_
	27. REPRESENTATIVES This report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from	_
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation	
	this report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from	
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community:	_
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community: Department of Petroleum Resources [DPR]:	_
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community: Department of Petroleum Resources [DPR]: National Oil Spill Detection and Response Agency [NOSDRA]:	
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community: Department of Petroleum Resources [DPR]: National Oil Spill Detection and Response Agency [NOSDRA]: State Ministry of Environment [SME]:	
	his report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community: Department of Petroleum Resources [DPR]: National Oil Spill Detection and Response Agency [NOSDRA]: State Ministry of Environment [SME]: Nigeria Police Force [NPF]: Nigeria Police Force [NPF]: State Ministry of Environment [SME]: Nigeria Police Force [NPF]: Nig	
	This report was filled, agreed and signed on the 14/67/2013 by joint investigation epresentatives from Host Community: Department of Petroleum Resources [DPR]: National Oil Spill Detection and Response Agency [NOSDRA]: State Ministry of Environment [SME]: Nigeria Police Force [NPF]: Shell Petroleum Development Company [SPDC]: Shell Petroleum Development Company [SPDC]:	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1006060 JIV report S/N: 0144

28. Appendix 1: Overview sketch of the site

