JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N1122-(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1013307 2. Type of incident\* OIL SPILL 3. Name of Location 12" THO RIVER 2 - OGME PIPELINE 4. Name of nearest community ETITUZO DWAZState: ABIA 6. LGA VKWA WEST 7. Type of Production facility/Installation OIL PIPELIME 8. Asset owner/District PIPELIME **B. INCIDENT INFORMATION:** 9. Details of incident d. Description of spill point environment Recently excavated area ☐Firmed soil Loose soil ☐Exposed pipe surface Under water □ Swampy □Drill Rig ☐ Well Platform (on Water) e. Description of leak point (tick as applicable); Hack saw cut ☐ Tear (\_\_\_\_\_\_), □Drilled hole ☐ Inward dent. ☐Well head tampering ☐Complete Rupture ☐Missing Pipeline/Flowline Failed Weld-on illegal hot tap valve, Failed Clamp ☐ Third party tampering with Clamp Crude oil theft (illegal bunkering) point, Third party tampering with flange, Third party tampering with valve setting, ☐ Surge vessel overflow, Corrosion ☐ Saver-pit over flow, Flare System/Bund wall failure Accidental 3rd party equipment ☐Bulging Outward Com unit failure Cold vent □Valve Failure Relief valve failure Others (specify)\_ f. Incident caused by: Third party interference (Sabotage□; crude theft□; Line theft□; Accidental 3<sup>rd</sup> party damage□) ☐ Operational Others (including Mystery spills)\_\_\_\_\_ g. Spill point coordinates Measuring unit Northing: ( ) 524826.29 07208-02

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122

C.	RISK ASSESSME	ENT					_	, <u></u>
	10. Type	e of environment:			:			
	Land	□Swamp	□water	□Sea	asonal sw	amp□Sh	oreline/Wa	terfront
	i. Type	of environment to	which oil has	spread:				
	Land	□Swamp	□water	□Riv	ver (identi	fy)		
	ii. Weatl	her condition						
	☐Rain 11. Distance from	Sunny the nearest sensiti	<b>⊉</b> bry ve habitat	□Wet	□wii	ndy	□Hot	Cool
	☐ Governme ☐ Drinking v ☐ Built up as ☐ Farmlands ☐ Fish Farm ☐ Fishing ne ☐ Others (sp	rea s /Pond et	esignated prote	ected area	ا <i>لمر</i> ] 15 ]	/ <b>←</b> ,m]		
	12. Containment n	neasures put in pla	ce;					
	□Booms □Others:/	ロTrench いち ハタバル	ロDyke	□na	tural depr	ession	□Pit	
	13. Any pictures o	r video coverage?			W	[N]		
	14. Was there any	disruption to the in	nvestigation?		[ Y]	(M)		
If y	es give brief descrip	tion:						
1	VOT 1	APPLIC	ABL	E -				_
n	TVPF/NIIMRFPS	ΛΕ ΡΡΛΡΕΡΤΙΕ	C IF ANV E	OUND WIT	чим ти	T ADTA	OF CDDF	AD OF OU

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
					<u></u>
<u> </u>	Inste 11	1111451	AR	co NE	IMPRES
	JOME M	HIM	7.17	UP OF	11110
ı					

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122

	1	1		
1		1	l l	
		1		 
16. Crops/Economic Tree	S			

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
/\/	one	WITHIN	A	29	OF D	APA CT
					-	

### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
_/\	TONE !	allimin	ARCA	OF INSPACE

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
h	IONIC	1. Limia	ARCA	OF I MIDACÍ
74		- W. T.		

**E. GRAPHIC DESCRIPTION OF LEAK POINT** (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 12" TMO RIVER 2 - OGALE PIPELINE AT ETITIVE OWALA.
SHOWING POSITION OF CRUSE OIL THEFT POINT AT 12 O'CLUGE DOSITION.

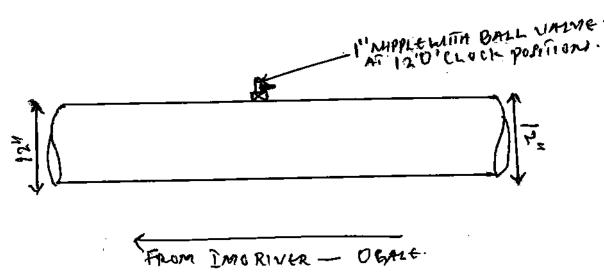

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	1	Easting (in)
S/N		Easting (cn)
881	607211.08	524829·38 524824·64 524826·28 524829·36
885	107210.92	524824.64
883	107201.87	524826.28
884	107201-87	524829.36
	10	
	<u> </u>	
	<u> </u>	
		<u></u>
-		
		t .
· j		
	·	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013577 JIV report S/N:	OTC

G. INCIDENT INFORMATION:

20.	Impacted A	Area Details		
	• To	otal calculated area of impact D · OOS Hu		
	• Im	pact within SPDC R.O.W		_
	• Im	pact outside SPDC R.O.W		
21.	Volume of	foil recovered before completion of JIV (V <sub>recJ</sub> ):		
		Recovered oil V <sub>recl</sub> :	14	Barrels
22.		on of estimated residual volume on site		
<b>a</b> .		on of estimated volume of pool of free phase oil (on land or confine Area (m²) occupied by pool of free phase oil	xd water bod	ly).
	ii.	حدا حصم الما		
	iii.	Emulsification factor:		
	iv.		MIL	barrels
b.		on of estimated volume of infiltrated oil in the soil ( $V_{inf}$ ). imated Volume of infiltrated oil at spill point (Vinf a)		
	i.	Area* (m²) of soil covered by the oil:		
	i <b>i.</b>	Average Depth (m) above leaking facility i.e. pipeline/flowline:_	1.2	
	iii.	Soil type: $P_e$ (effective porosity of the soil	1). <u> </u>	<u>a</u>
	v.	Cause of spill: LA FERENCE . Oil type: BONNY M	eDium	l
	vii.	Oil Residence time on site, day: ONE		
	viii.	Average depth of infiltration below leaking facility i.e. pipeline/f	lowline:	<u>7.0003M</u>
	ix.	Estimated depth of infiltration around spill point: 1-20	<u>03M</u>	_
		Estimated Volume of infiltrated oil at spill point. V <sub>inf_a</sub> :	0-1	60 barrels
,	2. Esti	imated Volume of infiltrated oil at second spill point [if applicable]	(Vinf b)	
	i.	Area* (m²) of soil covered by the oil:		
	ii.	Average Depth (m) above leaking facility i.e. piptline/flowline:_		
	iii.	Soil type: iv. Pe effective porosity of the soi	1)	
	v.	Cause of spall: Vi. Oil type:		
	vii.	Oil Residence time on lite, day:		
	viii.	Average depth of infiltration below leaking facility i.e. pipeline/f	lowline:	
	ix.	Estimated depth of infiltration around spill point:		<u> </u>
		Estimated Volume of infiltrated oil at spill point. V <sub>inf_b</sub> :	N/L	barrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

IT INVESTIGATION F	REPORT FOR I	NCIDENT NO:	013307	JIV report	: S/N: 0	122
i. A	Area (m2) of soil	covered by the oil:	24			
ii.	Area (m²) of the p	oool of free phase o	oil in touch with	soil:	_	
		n) below ground su			Q-00,	<u> </u>
		AM				<u> </u>
		osity of the soil)	8%			
				<del></del>		
V	i. Estima	ted Volume of infi	Itrated oil. At V	v <sub>inf</sub> :	0.02	ban
23. Computation	of estimated vo	olume of oil on o	pen water base	d on standard	coloration	on.
	of oil on open wa		<u> </u>			
ii. <u>Table of a</u>	verage depth of o	il on water based o	on coloration (	**Spill Facto Edition)	rs from U	SCG FOG (2
	Thickness	Percentage		2.41661(711)		
	(10M)	coverage	Volume (m3	)		
Barely Visible				4		
Silvery	0.00008			_		
Slight Color	0.00015	/				
Bright Color	0.0003	101		_		
Dull	0.001	2	m LE			
Dark	0.002	シントレク	·	_]		
Black oil	0.1	1				
Emulsion (30% Oil)	1					
_	Percent Total	100%				·
iii.	Estimated Volu	me of oil on open	water. V <sub>wat</sub> :	Mi	L	Barrels
24. Calculation of	of evaporated vo	olume:	.,,			•
i. Estin	nated Volume a	vailable for evap	oration within	surface area:_	0.6	12
	ctor: 15	•				
iii.	EstimatedV	olume of evaporate	ed oil. V <sub>evap</sub> :	(	)-11	Barrels
Fyan	oration Factors	(E-Factor) for SI	PDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Me			
Oil Residence time	< I day	10%	,	5%		
	1-7 days	25%		15%		
	> 7 days	40%		25%		
						•••
	أحركا المحاللات المسا	ume V <sub>Est</sub> (bbls)	$= V_{evap}(bbls) \cdot$	+ V <sub>wat</sub> (bbls)	+ V <sub>inf</sub> (t	obls) + $V_{pq}$
25. Net Estimat	<u>ea Spinea voi</u>					
25. Net Estimat (bbls) + V <sub>recl</sub>	(bbls) = $\nabla$ ·	ニャシェナ	0.62 +1	UIL FN	12-	
25. <u>Net Estimat</u> (bbls) + V <sub>reci</sub>	(bbls) = $\nabla$ ·	ニャシェナ	0.62 to	UIL TN 18BAA	11- 12 ez	
25. Net Estimat (bbls) + V <sub>recl</sub> Estimated Reported V	(bbls) = $\nabla$ ·	11+Mic+	0.62 +	MIL TN 18 BAR	12 20 ec	

NT INVE	ESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122
software	tion of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation on site; Conversion of $m^3$ to barrels is Volume (m3) x $\delta$ .29; **Round up estimated volume to next whole number us wing rules:
•	Any spill volume in excess of I bbl is rounded up to the next whole number.
•	Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.
	Examples: Calculated volume = 15.3 bbl Reported volume = 16 bbl Calculated volume = 0.35 bbl Reported volume = 0.4 bbl Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.
steps for	er this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use approp column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.
26.	GENERAL STATUS OF THE SITE
	Joint investigation of the incident site found that there is no residual impact after the initiaresponse and therefore recommend that the site be closed out
R	Investigation of the incident site showed that there is residual impact on site requiring further
	works
27.	REPRESENTATIVES
	report was filled, agreed and signed on the 26/07/2013 by joint investigation entatives from
•	Host Community:
•	Department of Petroleum Resources [DPR]: □
•	Department of Tetroleum Resources [51 K].
_	
•	National Oil Spill Detection and Response Agency [NOSDRA]:
	National Oil Spill Detection and Response Agency [NOSDRA]:
•	National Oil Spill Detection and Response Agency [NOSDRA]:
•	National Oil Spill Detection and Response Agency [NOSDRA]:
•	National Oil Spill Detection and Response Agency [NOSDRA]:  State Ministry of Environment [SME]:  Nigeria Police Force [NPF]:
•	National Oil Spill Detection and Response Agency [NOSDRA]:   State Ministry of Environment [SME]:   Nigeria Police Force [NPF]:   Shell Petroleum Development Company [SPDC]:

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1013307 JIV report S/N: 0122

28. Appendix 1: Overview sketch of the site

Location: 12" IMU LIVER 2 - OGALE PIPELINE AT ETITIVED OWARD SPDC RIGHT OF WAY - INFILTRATED AREA.
- SPILL POINT.
- Extent of Impact. 12" IMURIUER -