

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report SN: 0216

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1000706 2. Type of incident* OIL SPILL
 3. Name of location 20 INCH OTUMARA - ESCRAVOS TRUNKLINE
 4. Name of nearest community AJUDAIBO 5. State: DELTA 6. LGA WARRI-SOUTH WEST
 7. Type of Production facility/Installation TRUNKLINE 8. Asset owner/District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 25TH JUNE, 2013
 b. Start date/time of investigation: 27TH JUNE, 2013 AT 1437 HRS
 c. Investigation End date: 27TH JUNE, 2013 Actual investigation duration, days: ONE (1)

d. Description of spill point environment

- Firmed soil Loose soil Recently excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on Water) Drill Rig

e. Description of leak point (tick as applicable);

- Drilled hole Hack saw cut Tear (_____).
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline
 Crude oil theft (illegal bunkering) point. Third party tampering with Clamp
 Third party tampering with valve setting, Third party tampering with flange.
 Corrosion Saver-pit over flow, Surge vessel overflow,
 Bulging Outward Flare System/Bund wall failure Accidental 3rd party equipment
 impact Valve Failure com unit failure Cold vent
 Relief valve failure Others (specify) WELD-ON ILLEGAL HOT TAP VALVE

f. Incident caused by:

- Third party interference (Sabotage , crude theft , Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

g. Spill point coordinates

Measuring unit <u>M</u> <u>MINNA WEST BELT</u>	
Northing: <u>173192</u>	Easting: <u>308842</u>

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N: 0216

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp ^{TIDAL} Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [.m]
 - Drinking water source [.m]
 - Built up area [.m]
 - Farmlands [.m]
 - Fish Farm/Pond [.m]
 - Fishing net [.m]
 - Others (specify). [.m]
- NONE WITHIN VICINITY

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit
 Others: _____

13. Any pictures or video coverage? [Y] [N]

14. Was there any disruption to the investigation? [Y] [N]

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N: 0216

--	--	--	--	--	--	--

16. Crop/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	PALM TREE	NIL	2	4	6	/
2	RAPIE PALM	NIL	NIL	3	3	
3	MANGROVE	NIL	2	5	7	
/	/	/	/	/	/	/


17. Fish Nets/Ponds

S/N	Fish Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, a overview sketch of the site should be added as an appendix 1)

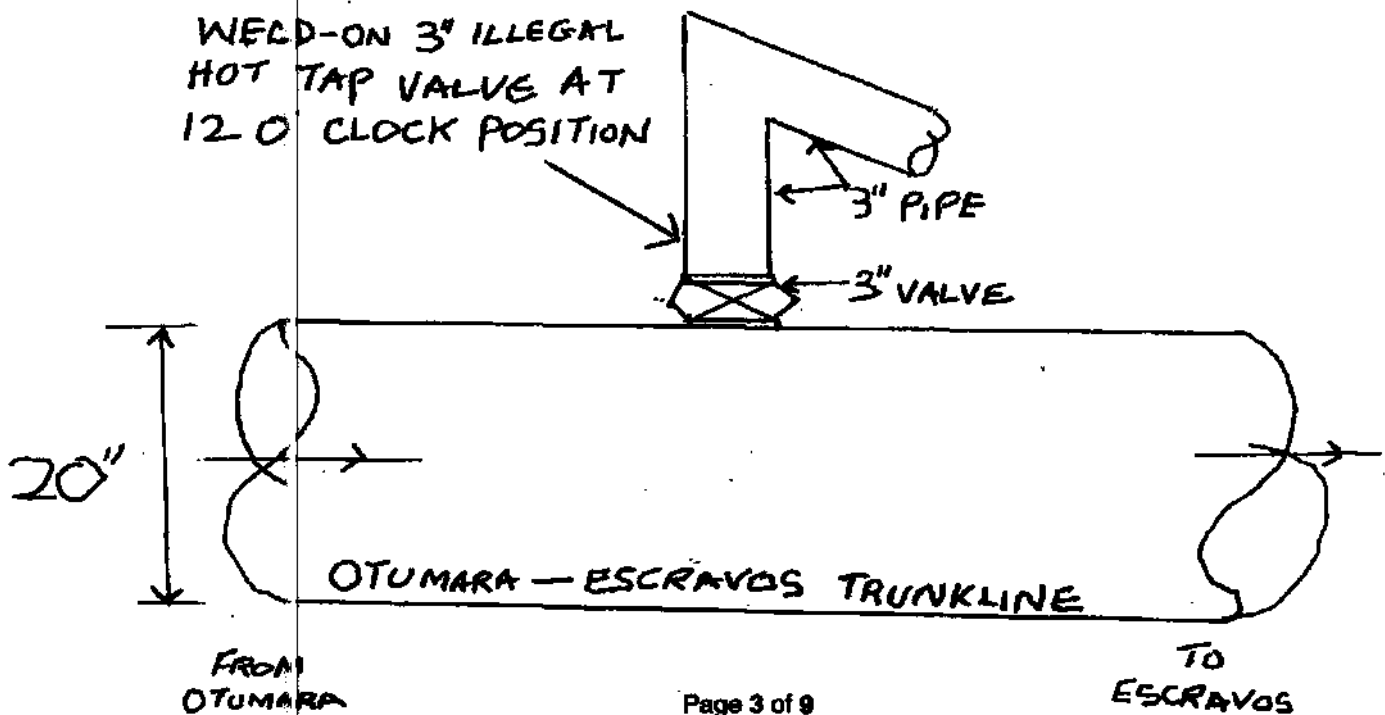

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report SN: 0216

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION
 19. Impact area boundary Coordinates (If more, Print and attach as an appendix)

S/N	Northing	Easting
1	173187	308843
2	173186	308839
3	173187	308834
4	173198	308835
5	173202	308829
6	173204	308830
7	173202	308835
8	173208	308839
9	173233	308845
10	173259	308846
11	173304	308861
12	173306	308867
13	173300	308874
14	173290	308865
15	173266	308855
16	173221	308846

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N: 0216

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 923.54 M²
- Impact within SPDC R.O.W 923.54 M²
- Impact outside SPDC R.O.W NOT APPLICABLE

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V _{rec} :	<u>NIL</u>	Barrels
----------------------------------	------------	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area (m²) occupied by pool of free phase oil 903.54
- ii. Average Depth (m) of pool of free phase oil 0.001
- iii. Emulsification factor: 45%
- iv.

Estimated Volume of pool of free phase oil. V _{pool} :	<u>3.13</u>	barrels
---	-------------	---------

b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}).

1. Estimated Volume of infiltrated oil at spill point (V_{inf a})

- i. Area* (m²) of soil covered by the oil: 20
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 0.3
- iii. Soil type: CLAY iv. P_e (effective porosity of the soil): 8%
- v. Cause of spill: INTERFERENCE vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: TWO
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.2M
- ix. Estimated depth of infiltration around spill point: 0.5M

x.

Estimated Volume of infiltrated oil at spill point. V _{inf a} :	<u>5.03</u>	barrels
--	-------------	---------

2. Estimated Volume of infiltrated oil at second spill point [if applicable] (V_{inf b})

- i. Area* (m²) of soil covered by the oil: _____
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: _____
- iii. Soil type: _____ iv. P_e (effective porosity of the soil): _____
- v. Cause of spill: _____ vi. Oil type: _____
- vii. Oil Residence time on site, day: _____
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: _____
- ix. Estimated depth of infiltration around spill point: _____

NOT APPLICABLE

Estimated Volume of infiltrated oil at spill point. V _{inf b} :	<u>NIL</u>	barrels
--	------------	---------

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (V_{inf c})

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N:

0216

Area (m²) of soil covered by the oil: _____

Area (m³) of the pool of free phase oil in touch with soil: _____

Average Depth (m) below ground surface of infiltration of oil: _____

Soil type: _____

P_e (effective porosity of the soil): _____

Estimated Volume of infiltrated oil. At V_{inf}: **NIL** barrels

NOT APPLICABLE

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL
- ii. Table of average depth of oil on water based on coloration (

***Spill Factors from USCG FOG (2000 Edition)*

	Thickness (mm)	Percentage coverage	Volume (m ³)
Barely Visible	0.00004		
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		

NOT APPLICABLE

Percent Total 100%

Estimated Volume of oil on open water. V_{wat}: **NIL** Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 8.16 BARRELS
- ii. E-Factor: 15%

Estimated Volume of evaporated oil. V_{evap}: **1.44** Barrels

Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume V_{net}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) - V_{recf}(bbls) =

1.44 + 5.03 + 3.13 = 9.6 BARRELS

Estimated Reported Volume** V_{rep}(bbls) = 10 BARRELS

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N: 0216

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for volume estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

27. REPRESENTATIVES

This report was filled, agreed and signed on the 27/6/2013 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

ADDITIONAL COMMENT

- BUNKERING VALVE AND FITTINGS NOT LEAKING ON SPDC RIGHT OF WAY.
- WEATHERED CRUDE OIL IMPACT WAS FOUND ON SPDC RIGHT OF WAY RESULTING FROM CRUDE OIL THEFT AND ILLEGAL LOCAL REFINERY ACTIVITIES ON THIRD PARTY AREA

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1000706 JIV report S/N: 0216

28. Appendix I: Overview sketch of the site

Location: 20" OTUMARE-ESCRAVOS TRUNKLINE SPILL SITE

