JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1037063 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1037063 2. Type of incident\* OIL SPILL 3. Name of Location 20" OTUMARA - ESCRAYOS TRUNKLINE 4. Name of nearest community ADJW) A(BO 5. State: DELTA 6. LGA WARRI - SOUTH WEST 7. Type of Production facility/Installation OIL PIPELINES. Asset owner/District PIPELINE B. INCIDENT INFORMATION: 9. Details of incident a. Date of incident: 8TH SEPTEMBER 2013
b. Start date/time of investigation: 12TH SEPTEMBER 2013 AT 0904HR8
c. Investigation End date: 12TH SEPTEMBER 2013 Actual investigation duration, days: 1 d. Description of spill point environment Loose soil Recently excavated area ☐Firmed soil **⊠** Swampy Under water Exposed pipe surface □Drill Rig ☐Well Platform (on Water) e. Description of leak point (tick as applicable); ☐ Tear (\_\_\_\_\_\_), Hack saw cut Drilled hole Complete Rupture ☐Inward dent, ☐Well head tampering Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline ☑Crude oil theft (illegal bunkering) point, ☐ Third party tampering with Clamp Third party tampering with flange, Third party tampering with valve setting, ☐ Saver-pit over flow, ☐ Surge vessel overflow, Corrosion Flare System/Bund wall failure Accidental 3rd party equipment ☐ Bulging Outward Com unit failure Cold vent ☐ Valve Failure Others (specify)\_ Relief valve failure

☐Third party interference (Sabotage ☐; crude theft ☐; Accidental 3rd party damage ☐)

Others (including Mystery spills)\_

g. Spi	Il point coordinates  Measuring unit METLES MINNA — V	UFST - BELT
	Northing: SP1 - 174130.50	Easting: 309089.46
	SP2 - 173983.45	309048.46

f. Incident caused by:

☐ Operational

111111	DEFT SETUDIEDM DEAFFORMENT COMEMO, OF MOTHER	1141 : 1-12.
JOINT INVESTIGA	TION REPORT FOR INCIDENT NO: 1037063 JIV report S/N:	0188
C. RISK ASSI	ESSMENT	
10.	Type of environment:	

10.	Type o	of environment:							
□Land	☐Seasonal swamp☐Shoreline/Waterfront								
i. Type of environment to which oil has spread:									
□Land	i	⊠Swamp	□Water	River (identify)					
ii. Weather condition									
☑Rain 11. Distance		Sunny se nearest sensiti	□Dry ve habitat	₩wet	□wit	ndy	□Hot	□cool	
□ Drit □ Buil □ Fart □ Fish □ Fish	aking wa It up are	ond	esignated prote	ected area	[ [ [	,m] ,m] ,m] ,m] ,m]	NONE THE VI	WITHIN	
12. Containt	ment me	asures put in pla	ice;						
□Boo □Oth	oms ers:	Trench	Dyke	⊠Na	tural depr	ession	□Pit		
13. Any pict	tures or	video coverage?	•		[W]	[N]			
14. Was the	re any d	isruption to the	investigation?		[ Y]	W			
If yes give brief of	descripti	on:				. <u> </u>			
		NOT	APP	LICAB	LE_				
				-					
	~								

# D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

# 15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
				1.4.0.	
	NONE W	THIN :	AKEA	OF IMPAC	( <del> </del>
	190,00				

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1037-063 JIV report S/N: 0188

ΝŢ	Type of crops	Young	Medium	Matured	Quantity	Comments
		WITHIN	Ap = A	AF ING	APT -	
	MUME	MITHIN	TACT	41 ////	ALC!	


#### 17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Соттептя
	MONE	WITHIN A	REA OF	IMPACI

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
		ADEA	DE IM	DACT
	MONE M	THIM TICET	UF (M	P/1C1
<del></del>				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

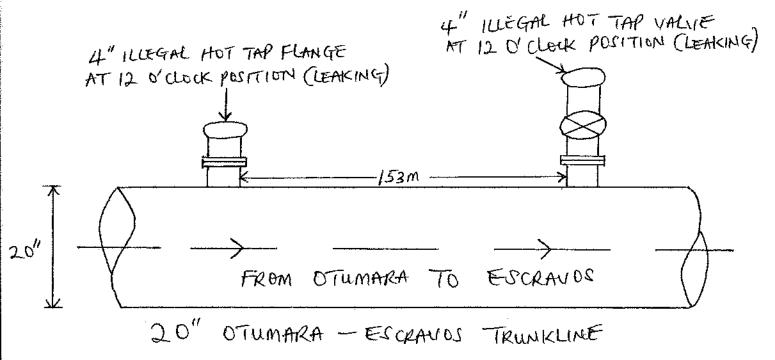

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1037 063 JIV report S/N: 0188

## F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA - WEST - BELT

S/N   Northing   Easting	
2 174106.35 309088.32 3 174146.28 309094.43 4 174144.36 309101.31 5 173949.67 309045.43 6 173968.10 309051.56 1 173986.53 309054.62 8 173995.72 309033.06 9 173953.24 309032.09	
3 174146.28 309694.43 4 174144.36 309101.31 5 173949.67 369045.43 6 173968.10 369051.56 1 173986.53 309054.62 8 173995.72 369033.66 9 173953.24 369032.69	
4       174144 · 36       309101 · 31         5       173949 · 67       309045 · 43         6       173968 · 10       309051 · 56         7       173986 · 53       309054 · 62         8       173995 · 72       309033 · 06         9       173953 · 24       309032 · 09	
5 173949 · 67 3 69 045 · 43 6 173 968 · 10 3 69 051 · 56 1 173 986 · 53 3 69 054 · 62 8 173995 · 72 3 69 033 · 66 9 173 953 · 24 3 69 032 · 69	
6       173 968 · 10       3 0 9 0 5 1 · 5 6         7       173 986 · 53       3 0 9 0 5 4 · 6 2         8       173 95 · 72       3 0 9 0 3 3 · 0 6         9       173 95 3 · 2 4       3 0 9 0 3 2 · 0 9	
7       173986.53       309054.62         8       173995.72       309033.06         9       173953.24       309032.09	
8 173995 · 72 309 033 · 06 9 173 953 · 24 309 032 · 09	
9 173 953 · 24 369 032 · 69	
10 173969.60 309039.30	
	<del></del>
	/-

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1037-063 JIV report S/N: 0188
G. INCIDENT INFORMATION:
20. Impacted Area Details
• Total calculated area of impact 900 m <sup>2</sup>
Total calculated area of impact     To o m
Impact within SPDC R.O.W 900 m <sup>2</sup>
Impact outside SPDC R.O.W NOT APPLICABLE
21. Volume of oil recovered before completion of JIV (V <sub>recJ</sub> ):
Recovered oil V <sub>rec.j</sub> : 1 Barrels
22. Computation of estimated residual volume on site
<ul> <li>a. Computation of estimated volume of pool of free phase oil (on land or confined water body).</li> <li>i. Area (m²) occupied by pool of free phase oil</li></ul>
ii. Average Depth (m) of pool of free phase oil 0.002 M
iii. Emulsification factor: 30 %
iv. Estimated Volume of pool of free phase oil. V <sub>pool</sub> : 2.91 barrels
<ul> <li>b. Computation of estimated volume of infiltrated oil in the soil (V<sub>int</sub>).</li> <li>1. Estimated Volume of infiltrated oil at spill point (Vinf a)</li> </ul>
i. Area* $(m^2)$ of soil covered by the oil: $20 \text{ m}^2$
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 0 · 2
iii. Soil type: $CAY$ iv. $P_c$ (effective porosity of the soil). $87$
v. Cause of spill: SABOTAGE vi. Oil type: BONNY MED IUM
vii. Oil Residence time on site, day: 4 DAYS
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: $\Theta \cdot Q \cdot $
ix. Estimated depth of infiltration around spill point: 0 2011 M
Estimated Volume of infiltrated oil at spill point. V <sub>int_a</sub> : 2.02 barrels
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)
i. Area* (m²) of soil covered by the oil: 30 m²
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 0.3 M
iii. Soil type: Uty iv. Pe (effective porosity of the soil). 8 70
v. Cause of spill: SABOTACEE vi. Oil type: BONNY MEDIUM
vii. Oil Residence time on site, day: 4 DAYS
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: O · OO
ix. Estimated depth of infiltration around spill point: 6.3011 M
Estimated Volume of infiltrated oil at spill point. V <sub>inf_b</sub> : 4-55 barrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

DINT INVESTIGATION F	EPORT FOR II	NCIDENT NO: 1	037063	JIV report S/	<b>Q1</b> 88
i. A	area (m2) of soil	covered by the oil	520	m <sup>2</sup> :	
ii. A	area (m²) of the p	ool of free phase	oil in touch with s	oil: NOT AF	PLI CABLE
iii. A	wersae Denth (m	n) helow ground si	urface of infiltratio	on of oil. 0 · 0	Ollm
	oil type:CL			<u>?</u>	
			8 %		
	•	sity of the soil)	<u> </u>		<u> </u>
V	i. Estima	ted Volume of inf	iltrated oil. At $V_{ii}$	at: O.	29 barrels
23. Computation	of estimated vo	olume of oil on o	pen water based	l on standard co	loration.
i. Total area	of oil on open wa	ter: NOT A	PHUGIBLE		
ii. <u>Table of a</u>	verage depth of o	il on water based	on coloration (	**Spill Factors f Edition)	rom USCG FOG (2000
	Thickness	Percentage			
	(mm)	coverage	Volume (m3)	٦	
Barely Visible	0.00004		- /,	-	
Silvery	80000.0		~~~	_	
Slight Color	0.00015		(X2)	_	
Bright Color	0.0003	<del></del>	<u> </u>	_	
Dull	0.001				
Dark	0.002	L.		_	
Black oil	0.1				
Emulsion (30% Oil)	1	4			
iii.	Percent Total Estimated Volu	ne of oil on open	water, V <sub>unt</sub> :	A I C I	Barrels
<u>t</u>			,,,,	MIL	
24. Calculation of	-			,	. 57 4 4
i. Estir	nated Volume a	vailable for eva	poration within s	surface area: /	0.76 BBL
ii. E-Fa	ctor: 15 %	<u> </u>			
iii.	EstimatedVo	olume of evaporat	ted oil. V <sub>evap</sub> :	1.90	Barrels
Fyan	oration Factors	(E-Factor) for S	PDC Crude oil		7
Oil Type	Days on site	Bonny Light	Bonny Med	dium	1
Oil Residence time	< 1 day	10%	···	5%	1
	1-7 days	25%		15%	1
	> 7 days	40%		25%	]
25. Net Estimat	ted Spilled Vol	ume V <sub>Est</sub> (bbls)	$= V_{evap}(bbls) +$	V <sub>wat</sub> (bbls) + `	V <sub>inf</sub> (bbls) + V <sub>pool</sub>
$\overline{(bbis)} + V_{rec}$	$(bbls) = \int ds$	2.66 B	BLS		-
Estimated Dayset d V	Johnnows V /h	hle)		····	
Estimated Reported Y	yonume ** Y <sub>rep</sub> (D	<sup>bls)=</sup> /3 B	BLS		
t <u> </u>				<del></del> ,	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1039063 JIV report S/N: 0188

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of -1 bbl is rounded up to the next whole number.
- Any spill volume in less than | I bbl | is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl

Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

#### 26. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
  - B. Investigation of the incident site showed that there is residual impact on site requiring further works

#### 27. REPRESENTATIVES

This report was filled, agreed and signed on the 2/13/09/20/3 by joint investigation representatives from

- Host Community: 

  ✓
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]: III
- State Ministry of Environment [SME]: 

   ✓
- Nigeria Police Force [NPF]: 

  ✓
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1037063 JIV report S/N: 0188

### 28. Appendix 1: Overview sketch of the site

