JOINT INVESTIGATION REPORT FOR INC	IDENT NO: 10438	282_JIV report S/N: 0187				
(Note: As practicable as possible the JIT re	port is to be signed in the	field by all the participating parties)				
A. GENERAL INFORMATION:						
1. Spill incident Number: 10 43 88	32 2.Type	of incident* OIL SPILL				
3. Name of Location KANBO W	IELL-78 FL	OWLINE				
3. Name of Location KANBO W ECTBEM DANGALABIRI/A 4. Name of nearest community	EBIDIAMA 5. State: BA	TELSA 6. LGA EKEREMOR				
7. Type of Production facility/Installation	LOWLINE 8.	Asset owner/District NWS2				
B. INCIDENT INFORMATION:						
9. Details of incident a. Date of incident: 22 ND SEPT b. Start date/time of investigation: 2 c. Investigation End date: 26 H 3 d. Description of spill point environt	EMBER 2013 674 SEPTEMBER EPT 2013 Actual invent	, 2.013 AT 132 DHRS estigation duration, days: 1 DAY				
Firmed soil	Loose soil	Recently excavated area				
Under water	☑ Swampy	Exposed pipe surface				
	□Well Platform (on Water) □Drill Rig					
	e. Description of leak point (tick as applicable); Drilled hole Hack saw cut Tear (
	Complete Rupture					
☐ Complete Rupture ☐ Inward dent, ☐ Well head tampering ☐ Failed Weld-on illegal hot tap valve, ☐ Failed Clamp ☐ Missing Pipeline/Flowline						
Crude oil theft (illegal bunkering) point, Third party tampering with Clamp						
_						
☐Third party tampering with val		Third party tampering with flange,				
<u> </u>	Saver-pit over flow,	-				
Bulging Outward	·	wall failure Accidental 3 rd party equipment				
impact		m unit failure Cold vent				
Relief valve failure	Others (specify)					
f. Incident caused by: ☐Third party interference (Sabotage ☑operational ☐Others (i	□; crude theft□; Line the ncluding Mystery spills)_	eft□; Accidental 3 rd party damage□)				
g. Spill point coordinates Measuring unit METERS	MINNA (WEST BELT)				
Northing:		Easting:				
97917.	36 MN	356018.14 mE				

	THE SHELL	. PETROLEU	M DEVEL	OPMENT	COMPANY	OF NIGE	ERIA LI	MTED.
/NI TNIC	ESTIGATION F	REPORT FOR I	NCIDENT	NO: 104	3882	JIV report	S/N:	0187
C. R	ISK ASSESSMI	ENT						010 .
	10. Type	e of environment	:					
	Land	⊠ Swamp(ī ∆∧() ⊐wa	ter [□Seasonal swa	ımp 🗆 Shoi	reline/W	aterfront
	і. Турс	of environment	to which oil	has spread:				
	□Land	V Swamp&	i dAt) □wa	ter [River (identif	fy)		
	ii. Weat	her condition						
1	Rain 1. Distance from	Sunny the nearest sensi	□Dry tive habitat		t 🗖 Win	dy	□Hot	□cool
	☐ Governme ☐ Drinking ☐ Built up a ☐ Farmlands ☐ Fish Farm ☐ Fishing ne ☐ Others (sp	rea s /Pond et	designated	protected are	a [[[[[m, [m, [m, [m, [m, [m]	NON THE	JE WITHM VICINITY
ı	2. Containment r	neasures put in p	lace;					
	⊠Booms □Others:	Trench	図Dyi	ke [INatural depre	ession	□Pit	
1	3. Any pictures of	or video coverage	:?		[7]	[N]		
1	4. Was there any	disruption to the	investigati	on?	[Y]	NOT		
If yes	give brief descrip	otion:						
	<u>. </u>	NOT	T A	PPLIG	ABLE			
								
	YPE/NUMBERS		IES, IF AN	IY, FOUND	WITHIN TH	E AREA (OF SPRE	EAD OF OIL
S/N	Type of Struc	tures Desc	ription S	Size	Number		Comp	nents
	I I NATE	1.11-1.11	il A	OEA	DF IN	1PA-C	-	


10/12 882 JO

l	6. Crops/Econo	mic Trees	•			
5/N_	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE	WITHIN A	REA	OF IMPA	C 7	
ı	7. Fish/Nets/Po	nds				
S/N	Fish/Nets/Pond	s Description	· - · ·	Quantity/Size	Comments	

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
ļ. 	NONE W	THIN AREA	- OF 11	NPACT
	700000			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

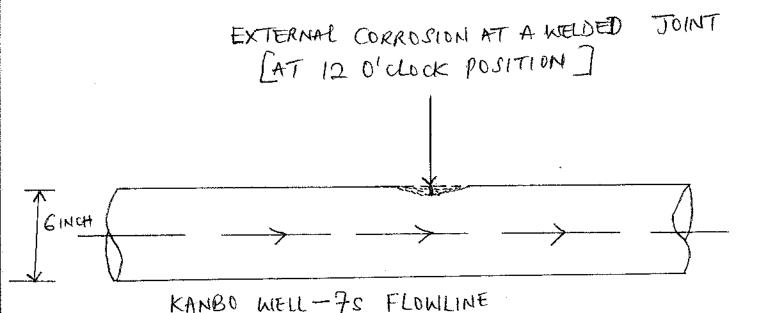

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1043 882 JIV report S/N: 0187

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA (WEST BELT)

	MINNA (h	IEST BELT)
S/N	Northing (M)	Easting (M)
WP932	97926.56	356011.96
WP933	97923.49	356008 - 88
WP934		356008.89
WP935	97917.35	356011.97
WP 936	97926.56	356011.96
WP937	97926.58	356018.12
WP938	97926.58	356021.20
WP 939	- · · · · · · · · · · · · · · · · · · ·	356021.20
WP940	97929.65	356018 - 12
WP941	97932 . 72	356018-11
WP942	97935.79	356021 · 19
WY 943		356024.26
WP 944	97935.79	356018.11
WP945		356008-91
WP946	97908.14	356015.07
WP947		356018.15
WP948	97905.08	356021.24
wp949	97905.08	356024.32
WP950	97905.09	356027.40
WP951	97905.09	356027 · 40
WP952	97905.09	356030 - 48
WP 953	97905.09	356030.48
WP954	97908 · 12	355999 · 67
WP955		356002 · 72

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1043882 JIV report S/N: ()187
G. INCIDENT INFORMATION:	-
20. Impacted Area Details	
II i C C	
Total calculated area of impact	
Impact within SPDC R.O.W 4 6 M ²	-
Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V _{recJ}):	
Recovered oil V _{rec.J} : N1L	Barrels
<u> </u>	
22. Computation of estimated residual volume on site	
a. Computation of estimated volume of pool of free phase oil (on land or confined water body i. Area (m²) occupied by pool of free phase oil346 m²_	<i>(</i>)-
ii. Average Depth (m) of pool of free phase oil 0.002 m	
iii. Emulsification factor: 40 7c	
iv. Estimated Volume of pool of free phase oil. V _{pool} : 2.6	barrels
b. Computation of estimated volume of infiltrated oil in the soil (V_{art}) .	
1. Estimated Volume of infiltrated oil at spill point (Vinf a)	
i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipetiac/flowline:	
iii. Soil type: iv. Pc (effective porosity of the soil)	
v. Cause of spill: vi. Qiktype: vii. Oil Residence time on site, day:	
/\	
viii. Average depth of infiltration leaking facility i.e. pipelinc/flowline:	
ix. Estimated depth of infiltration around spill point:	_
Estimated Volume of infiltrated oil at spill point. V _{inf_a} : N1L	barreis
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline:	
iii. Soil type: iv. P_c (effective porosity of the soil)	
v. Cause of spill: vi.	
vii. Oil Residence time on site, day:	
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:	
ix. Estimated depth of infiltration around spill point:	-
Estimated Volume of infiltrated oil at spill point. V _{inf_5} : \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\	barrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

INT INVESTIGATION F	EPORT FOR I	NCIDENT NO:	043882	፲_ JIV re	porť S/N:〔	187	7
i. A	area (m2) of soil :	covered by the oil:	- 70	M^2	•		
		ool of free phase o			114		_
		n) below ground su			0.0011	M	_
F	oil type:	ny below ground st A-√	mace of milital			<u> </u>	
			8 %				
	•	sity of the soil)	7.1 — 1.1				1
v	i. Estima	ted Volume of infi	iltrated oil. At V	/ _{int} :	0.00	-	barreis
23. Computation	of estimated vo	olume of oil on o	pen water base	d on stanc	lard colorat	ioп.	
i. Total area o	of oil on open wa	ter: NOT AP	PLICABLE				
a. Table of a	verage depth of o	il on water based o	on coloration (Factors from U	/SCG F	OG (2000
	401 * 1	D		Edition)			
	Thickness (mm)	Percentage coverage	Volume (m3)_			
Barely Visible	0.00004						
Silvery	0.00008						
Slight Color	0.00015						
Bright Color	0.0003		XID.				
Dull	0.001	LC.					
Dark	0.002	XX					
Black oil	0.1						
Emulsion (30% Oil)	1	10,					
	Percent Total	100%		_			
iii.		me of oil on open	water. V _{wat} :	M	<u>.</u>	Barr	rels
24. Calculation o	of evaporated vo	olume:		1.55			•
	-				α.	^ ~	0010
i. Estir	nated Volume a	vailable for evap	poration within	surface a	rea: 📿 🚺	35	BBL?
ii. E-Fa	ctor: 15 7	n					
11. E-Fa	ctor: 1 - 7	<u>-</u>	•				
üi.	EstimatedV	olume of evaporat	ed oil. V _{evap} :	0.4	17	Barr	rels
-	···	262.75	DDGG 1 ''		_ -		
		(E-Factor) for S					
Oil Type Oil Residence time	Days on site < 1 day	Bonny Light 10%	Bonny Me	5%			
On Residence time	1-7 days	25%		15%			
	> 7 days	40%		25%			
					1 		
25. Net Estimat	ed Spilled Vo	lume V _{Est} (bbls)	$= V_{evap}(bbls)$	+ V _{wat} (bl	$ols) + V_{inf}$ (bbls)	+ V _{pool}
$(bbls) + V_{rec}$	(bbls) = 3	12 BBL	.9				
		- 1 0					
Estimated Reported V	Volume** V _{ren} (b	bls)= // n a	21.0			<u></u>	
		## 4 BE	5F7				

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1043 882 JIV report S/N: 0187

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of -1 bbl is rounded up to the next whole number.
- Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 26/69/2013 by joint investigation representatives from

- Host Community: ☑
- Department of Petroleum Resources [DPR]: □
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:

 ✓
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings□

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1043882 JIV report S/N:

0187

28. Appendix 1: Overview sketch of the site

