JOINT INVESTIGATION REPORT FOR INCIDENT NO: $1121547$ JIV report S/N:	0441

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERA	AL INFORMATION:	17	NU OO	
1. Spill incid	lem Number: 112154	2.Type o	fincident* OIL SPI	<u>LL</u>
3. Name of I	ocation 20" OTUM	ARA – ESCR	AVOS LIVELI	ME
4. Name of n	nearest community ADJUD	A1BO 5. State: DEL	TA 6. LGA WARR	South-West
7. Type of Pi	roduction facility/Installation 0	IL PIPELINES A	sset owner/District PIPEL	INE
	NT INFORMATION:			
d. Des	incident te of incident: 4 FEBR rt date/time of investigation: 6 restigation End date 6 FE scription of spill point environm Firmed soil	CUARY 2014  FERRUARY,  B. 2014 Actual investment  Loose soil	2014 AT 1330H stigation duration, days: 1	
6. De:	Under water  Well Platform (on Water) scription of leak point (tick as a Drilled hole Complete Rupture Failed Weld-on illegal hot tap valve. Crude oil theft (illegal bunkering) Third party tampering with valve. Corrosion Bulging Outward uipment impact	Hack saw cut Inward dent, e, Failed Clamp ng) point, we setting, I Saver-pit over flow,	Exposed pipe surface Drill Rig  Tear (	ne vith Clamp
f. Inc MThi	Relief valve failure  cident caused by:  ird party interference (Sabotage)  perational Others (i	Others (specify)	rft□; Accidental 3 <sup>rd</sup> party dan	ægc□)
g. Sp	Measuring unit Meters Northing:	E	309125.0	23
	1			

						MPANY OF N		
OINT INV	ESTIGATION R	REPORT FOR	INCIDE	NT NO:	215	<del>47</del> JIV rep	ort S/N: C	)441
C. RI	ISK ASSESSME	ENT						
	10. Туре	e of environme	at:					
	Land	⊠Śwamp	<b>□</b> ,	Water	□ Sea	asonal swamp 🗆 S	horeline/Wat	terfront
	і. Туре	of environmen	it to which	oil has spre	ead:			
	□Land	<b>⊠</b> Swamp		Water	□Riv	ver (identify)		
	ii. Weath	her condition						
1	☐Rain I. Distance from	Sunny the nearest sen		•	□Wet	□Windy	□Hot	Cool
	Governme Drinking v Built up ar Farmlands Fish Farm Gishing ne	rea s v/Pond et	d designate	ed protected	d area	[ m, ] [m, ]	HE	E MITHIN VI CIMT
13	2. Containment n	neasures put in	place;					
	□Booms □Others:	Trench	<b>M</b> i	Dyke	□Nat	tural depression	Pit	
1:	3. Any pictures of	r video covera;	ge?			(Y) (N)		
1	4. Was there any	disruption to the	he investig	gation?		IN AN	•	
If yes	give brief descrip	tion:						
_		N(	)T	AP	'PL	1 GAB	LE	
D. TI	YPE/NUMBERS	OF PROPER	TIES, IF	ANY, FO	U <b>ND WIT</b>	HIN THE ARE	A OF SPRE	AD OF OIL
1:	5. Structures / P	'roperties						
S/N	Type of Struct	ures Des	cription	Size	Num	ber	Comment	S
					<u> </u>		<u> </u>	
	TANE	MITH	A	OF A	OF-	IMPAC	<del></del>	
	NUNE	WHI THE	4,,		$\bot$			

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 12547 JIV report S/N: 0441

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE	MITHIN 1	AREA	OF IMP	ACT	

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	HOME W	THIN AREA	OF IN	PACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	HONE W	THIN AREA	OF IM	PACT
L	7 7 7 7			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

3" FAILED WELD-ON ILLEGAL HOT TAP VALVE AT 12 O'CLOCK POSITION (LEAKING)

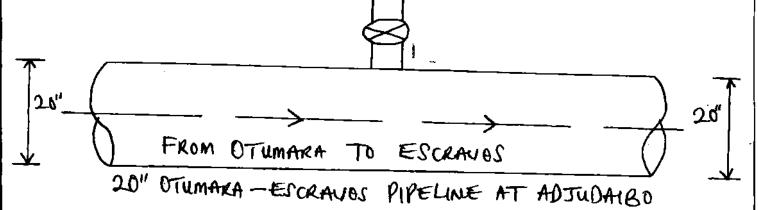

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 121547 JIV report S/N: 0441

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	Northing METERS	1985 - BEET)
S/N	Northing METERS	Easting METERS
	174244.59	<i>2</i> 99118-93
	174256.84	309085.04
	174299.90	309134.25
	174324 · 45	309118.83
	174299.83	309078-86
		_/
		<u> </u>
	<del>                                     </del>	
<del></del>	\ <u></u>	
	<del> </del>	<del></del>

#### G. INCIDENT INFORMATION:

20. Impacted Area Details

•	Total calculated area of impact	0.2914	
•	Impact within SPDC R.O.W	485	
•	Impact outside SPDC R.O.W	YES	

21. Volume of oil recovered before completion of JIV (V<sub>recI</sub>):

JOINT INVESTIGATION	REPORT FOR INCIDENT NO: 121547 JIV report S/N: 044	1
	Recovered oil V <sub>reel</sub> : N/L Barre	
Ĺ		
a Commutation	n of estimated residual volume on site  of estimated volume of pool of free phase oil (on land or confined water body).  Area (m²) occupied by pool of free phase oil 2300 m²	
ii.	Average Depth (m) of pool of free phase oil 6.002 m	
iii.	20.0/	
i <b>v.</b>	Estimated Volume of pool of free phase oil.	arrels
	V <sub>pool</sub> : 20.25	
b. Computatio	n of estimated volume of infiltrated oil in the soil (V <sub>inf</sub> ). mated Volume of infiltrated oil at spill point (Vinf a)	
, <b>i.</b>	Area* (m²) of soil covered by the oil:	
ii.	Average Depth (m) above leaking facility is pipeline/flowline:	
íii.	Soil type: iv. Pe (effective porosity of the soil)	
v.	Cause of spill: vi vil type:	
vii.	Oil Residence time on site, day:	
viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline:	_
ix.	Estimated depth of infiltration around spill point:	
	Estimated Volume of infiltrated oil at spill point Var.	barrels
2. Esti	mated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i.	Area* (m²) of soil covered by the oil:	
ii.	Average Depth (m) above leaking facility are, pipeline/flowline:	
iii.	Soil type: iv. P. (effective porosity of the soil)	
v.	Cause of spill: Oil type:	
vii.	Oil Residence time on site, days	
viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline:	t_
ix.	Estimated depth of infiltration around spill point:	rat
ş	Compared Volume of Intilligence of the State Point Volume Volume ALIC barre	els , i.
3. E		<del></del>
stúr	nated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)	q üpaten i.
i.	Area (m2) of soil covered by the oil:	ا. حاما
ii.	Area (m²) of the pool of free phase oil in touch with soil: NOT APPUG	in ce
iii.	Average Depth (m) below ground surface of infiltration of oil: 0 0 1 8	
iv.	Soil type: LATERITE	
v.	P <sub>e</sub> (effective perosity of the soil). 20 /-	<del>- 15</del>
	vi. Estimated Volume of infiltrated oil. At Vac 38	barrels

23. Computation of estimated volume of oil on open water based on standard coloration.

i. Total area of oil on open water: NOT APPLICABLE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1121547 JIV report S/N: 0441

ii. Table of average depth of oil on water based on coloration (

\*\*Spill Factors from USCG FOG (2000 Edition)

•	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004		
Silvery	0.00008	_	4.
Slight Color	0.00015		22
Bright Color	0.0003	्ष	
Dull	0.001	90	
Dark	0.002	N.	
Black oil	0.1		
Emulsion (30% Oil)	1	1/2	

iii. Estimated Volume of oil on open water. V<sub>wa</sub>: NIL Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 21. 63 BBLS
- ii. E-Factor: 15 1/6

iii. Estimated Volume of evaporated oil. V<sub>evap</sub>: 3.82 Barrels

Evaç	oration Factors	(E-Factor) for SP	DC Crude oil		
Oil Type Days on site Bonny Light Bonny Medium					
Oil Residence time	< 1 day	10%	5%		
	I-7 days	25%	15%		
	> 7 days	40%	25%		

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volute in less than I bbl is rounded up to the next 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph & (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

#### 26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1121547 JIV report S/N:	0441
---	------

В.	Investigation of	f the incident site showed that there is residual impact on site requiring further
	works	

#### 27. REPRESENTATIVES

This report was filled, agreed and signed on the 16/02/2014 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]: D/
- State Ministry of Environment [SME]: ■
- Nigeria Police Force [NPF]: □
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

### 28. Appendix 1: Overview sketch of the site

Location :	<u> </u>		
	1		
	1		
I			
	•		
		<del></del>	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1121547 JIV report S/N: 0441

