JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1102878 JIV report S/N: 0379

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:			
1. Spill incident Number: 1028	78 2.Type o	f incident* 01L	SPILL
3. Name of Location 24" NK	POKU -	BOMU PIP	ELINE
4. Name of nearest community B-bE	<b>RE</b> 5. State: <b>R1</b>	ERS6. LGA GO	KANA
7. Type of Production facility/Installation 01	L PIPELINE8. AS	sset owner/District P1	PELINE
B. INCIDENT INFORMATION:			
9. Details of incident  a. Date of incident: 5 TH  b. Start date/time of investigation: c. Investigation End date: 7 TH  d. Description of spill point environment	TANUARY TANUARY ANUARY Loose soil	, 20 14 IARY, 20 14/ tigation duration, days:	-
☐ Under water ☐ Well Platform (on Water)  e. Description of leak point (tick as apple)	JSwampy	☐Exposed pipe surface ☐Drill Rig	
Drilled hole	Hack saw cut Inward dent,	☐ Tear (	),
☐Crude oil theft (illegal bunkering) ☐Third party tampering with valve s	point,	☐Third party tampering	with Clamp
_ ` ` ` ` _	Saver-pit over flow,	☐Third party tampering ☐Surge vessel overflow,	
Bulging Outward	Flare System/Bund wa	Il failure 🗖 Accidental	3 <sup>rd</sup> party
equipment impact	ailure	Com unit failure	□Cold vent
Relief valve failure	Others (specify)		
f. Incident caused by:  Third party interference (Sabotage 7;  Operational Others (included)	crude theft ; Line theftuding Mystery spills)	·□; Accidental 3 <sup>rd</sup> party dar	magc□)
g. Spill point coordinates  Measuring unit A EPCRS  Northing:	· · · · · · · · · · · · · · · · · · ·	NIO-BELT)	
74721.11		534909-1	8

<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1102878 JIV report S/N: 0379

C.	RISK ASSE	SSMENT						
	10.	Type of enviro	nment:					
	<b>\(\overline{\sigma}\)</b> Lan	d □Swa	amp	□water	☐Seas	onal swamp□Si	horeline/Wat	erfront
	i.	Type of environ	ment to w	hich oil has s	pread:			
	Lan	d □Swa	amp	□Water	□Rive	r (identify)	<del></del>	
	ii.	Weather condit	ion					
	☐Rain	Sum from the neares		□Dry habitat	□Wet	□Windy	□Hot	□cool
	Driver Buil Buil Fan Grist Fish	vernment reservenking water sour lt up area mlands in Farm/Ponding net ters (specify).	PALM	TRE		[ ,m] [ 20 ,m] [ 20 ,m] [ ,m] [ ,m]		
	□Boo	oms 🗖 Tre		□Dyke	□Natu	ıral depression	Pit	
	13. Any pic	tures or video co	overage?			[X] [N]		
	14. Was the	re any disruption	n to the inv	estigation?		[Y] [N	/	
If :	yes give brief	description:		A	PPL	_1(	AB	

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N Type of Structures	Description	Size	Number		Commen	ts
NONE	W	TH	IN A	REF	OF	tmpa c

16. Crops/Economic Trees

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 102878 JIV report S/N: 0379


S/N 7	Type of crops	Young	Medium	Matured	Quantity	Comments
N	ÓNE	. WIT	HIN	ARE	\ 0F	MPACT

#### 17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
N	MALE 1	. A		
17	ONE N	HHIN F	REA	OF IMPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
N	ONE	WITHIN	AREA	OF IMPACT

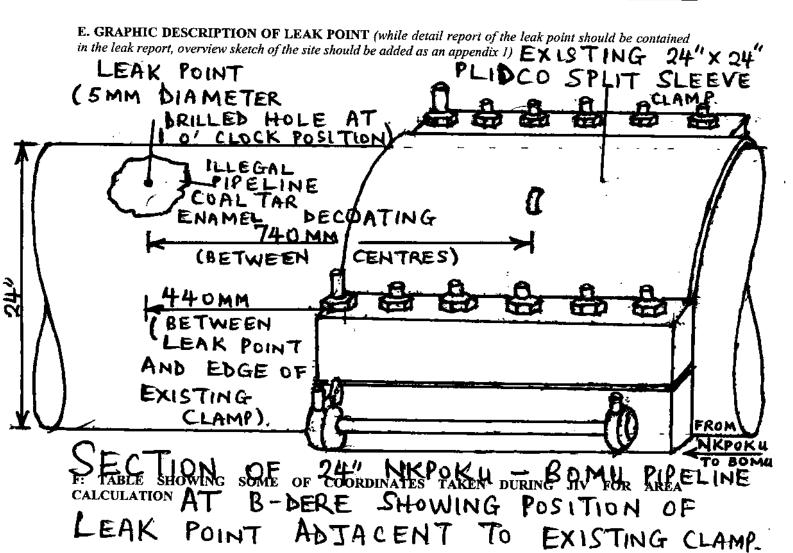

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 102878 JIV report S/N: 0379

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

	MININA (MU)-BELT)							
S/N	Northing METER							
	74718.04 74718.06 74739.54 74739.56	534909.18						
	74718·06	534899·93 534909·21						
	74739.54	534909.21						
	74739.56	534899 .97						
<u></u>								
		-						
		-						
	· · · · · · · · · · · · · · · · · · ·	<u> </u>						

#### G. INCIDENT INFORMATION:

20. Impacted Area Details

•	Total calculated area of impact	0.02Ha	
•	Impact within SPDC R.O.W		
•	Impact outside SPDC R.O.W		


21. Volume of oil recovered before completion of JIV  $(V_{recJ})$ :

		Recovered oil V <sub>reel</sub> :	9.43	Barrels
22.	Computation	on of estimated residual volume on site		
a.	Computatio	n of estimated volume of pool of free phase oil (on	land or confined water	body).
	i.	Area (m²) occupied by pool of free phase oil	1	_
	ii.	Average Depth (m) of pool of free phase oil	0.003	
	iii.	Emulsification factor:	1	1.
	iv.	Estimated Volume of pool of free phase of	0.02	barre
		V <sub>pool</sub> :	0.02	
ъ.		n of estimated volume of infiltrated oil in the soil ( mated Volume of infiltrated oil at spill point (Vinf a		
	i.	Area* (m²) of soil covered by the oil:	]	_
	ii.	Average Depth (m) above leaking facility i.e. pipe	eline/flowline:	
	iii.		rosity of the soil)2	
	v.	Cause of spill INTERFERENCE	BONNY MI	MUJES
	vii.	Oil Residence time on site, day: 2	AYS	
	viii.	Average depth of infiltration below leaking facilit	y i.e. pipeline/flowline:	0.00
	ix.	Estimated depth of infiltration around spill point:	1.002m	
		Estimated Volume of infiltrated oil at spill po	int. Vinc.	32 bar
	2. Esti	mated Volume of infiltrated oil at second spill poin	t [if applicable] (Vinf b	)
	i.	Area* (m²) of soil covered by the oil:		. <u>.</u> _
	ii.	Average Depth (in) above leaking facility i.e. pipe	eline/flowline:	
	iii.	Soil type: iv. Pe (effective por	rosity of the sail).	
	v.	Cause of spill: vi. Oil type:	TOUR	
	vii.	Oil Residence time on site, day:	_	
	viii.	Average depth of infiltration below haking facilit	y i.e. pipeline/flowline	
	ix.	Estimated depth of infiltration around spill point:		
	िर्देश ें.ड्रे.	Estimated Volume of infiltrated oil at spill point. V	NIL	barrels
	3. E		-	
		ated Volume of infiltrated oil outside immediate sp	oill point(s) region (Vin	fc)
	i.	Area (m2) of soil covered by the oil:		
	ii.	Area (m²) of the pool of free phase oil in touch wi		_
	iii.	Average Depth (m) below ground surface of infilt	tration of oil:	002
	iv.	Soil type: SINT		
	v.	P <sub>e</sub> (effective porosity of the soil).		
		vi. Estimated Volume of infiltrated oil. At	Vint. 0	-4 8 ba

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 10 2878 JIV report S/N: 0379

II. Table of average depth of oil on water based on coloration (

\*\*Spill Factors from USCG FOG (2000 Edition)

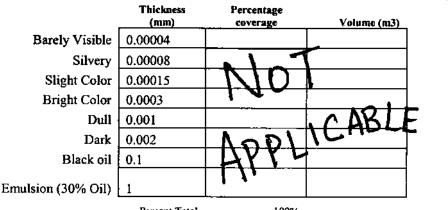

Percent Total 100%

Estimated Volume of oil on open water. V<sub>wat</sub>: Barrels

24. Calculation of evaporated volume:

iii.

- i. Estimated Volume available for evaporation within surface area: 11.25 BARRELS
- ii. E-Factor: 15%

iii. Estimated Volume of evaporated oil. V<sub>evap</sub>: Barrels

Evaporation Factors (E-Factor) for SPDC Crude oil						
Oil Type Days on site Bonny Light Bonny Medium						
Oil Residence time	< 1 day	10%	5%			
	1-7 days	25%	15%			
	> 7 days	40%	25%			

25. Net Estimated Spilled Volume 
$$V_{Est}(bbls) = V_{evap}(bbls) + V_{wit}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recl}(bbls) = 1.98 + NIL + 1.8 + 0.02 + 9.43$$

Estimated Reported Volume\*\*  $V_{rep}(bbls) = 1.48 + 0.02 + 9.43$ 

Estimated Reported Volume\*\*  $V_{rep}(bbls) = 1.48 + 0.02 + 9.43$ 

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

#### 26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 102878 JIV report S/N: 0379

B.	Investigation	f the incident site showed that there is residual impact on site requiring furt	her
	works		

#### 27. REPRESENTATIVES

This report was filled, agreed and signed on the 7/01/20\_14by joint investigation representatives from

Host Community: 
Department of Petroleum Resources [DPR]: 
National Oil Spill Detection and Response Agency [NOSDRA]: 
State Ministry of Environment [SME]: 
Nigeria Police Force [NPF]: 
Shell Petroleum Development Company [SPDC]: 
Signatories agree with reported findings: 
Separate DPR form has been filled out with same findings 
Tick as applicable

## 28. Appendix 1: Overview sketch of the site

Location: 24"	NKPOKU -	Воми	PIPELINE AT	B-DERE
			. •	

0379 JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1102878 JIV report S/N: BUILDING. SPAC RIGHT oF WAY 24" NKPOKU -BoMu PIPELINE AREA" COVERED BY SPILL POINT INFILTRATION IN SOIL. EXTENT OF LMPACT (IN PIT).