### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1208043 JIV report S/N: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 120804-3 5. State: BAYELSA 6. LGA EKEREMOR 4. Name of nearest community AGHORO 7. Type of Production facility/Installation OLL PIPELINE 8. Asset owner/District PIPELINE B. INCIDENT INFORMATION: 9. Details of incident a. Date of incident: 2 July: 2014 b. Start date/time of investigation: 6TH JULY, 2014 AT 1415 HRS c. Investigation End date: 6 TH JULY, 2014 Actual investigation duration, days: 1 DAY d. Description of spill point environment Recently excavated area Loose soil ☐Firmed soil **⊠**≲wampy Exposed pipe surface Under water □Well Platform (on Water) □Drill Rig Additional observations around the spill point: UPON EXCAVATION, A 4" IUEGAL HOT TAP VALVE WAS OBSERVED WELDED ON THE 24" CHUDE BIL PIPELINE AT 12 O'CLOCK POSITION. e. Description of leak point (tick as applicable); Hack saw cut ☐ Tear (\_\_\_\_\_ Drilled hole □Inward dent, ☐Well head tampering Complete Rupture MFailed Weld-on illegal hot tap valve, Failed Clamp ☐Missing Pipeline/Flowline · Crude oil theft (illegal bunkering) point, ☐ Third party tampering with Clamp Third party tampering with flange, Third party tampering with valve setting, ☐Surge vessel overflow, Corrosión ☐Saver-pit over flow, □Flare System/Bund wall failure □Accidental 3rd party equipment ☐Bulging Outward Com unit failure □Cold vent ☐ Valve Failure Relief valve failure Others (specify) f. Incident caused by: ☐ Third party interference (Sabotage ; crude the ft ☐; Line the ft ☐; Accidental 3rd party damage ☐) Others (including Mystery spills) Operational

<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction c) Encrouchment f) Fire.

#### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: g. Spill point coordinates Measuring unit Northing: C. RISK ASSESSMENT 10. Type of environment: Swamp Land □Water ☐ Seasonal swamp ☐ Shoreline/Waterfront Type of environment to which oil has spread: Land **Swamp** □Water River (identify)\_ îi. Weather condition Sunny □Rain □Wet □Windy □Hot Dry - 11. Distance from the nearest sensitive habitat Government reserved and designated protected area ,m] Drinking water source ,m] Built up area lm, **Farmlands** ,m] THE VICINITY Fish Farm/Pond ,m) Fishing net Others (specify). 12. Containment measures put in place; Matural depression Dvke ☐Booms Trench □Pit None Others: 13. Any pictures or video coverage? 14. Further response/repair initiated as at the time of JIV? If yes to item 14, give brief description: REPAIR IS BEING PLANNED DIDELLINES ASSET 15. Was there any disruption to the investigation? [W] [Y]

If yes to item 15 give brief description:

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1208043 JIV report S/N: 0575

### D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

### 16. Structures / Properties

LIANE IN ITHAN AREA DE IMPACT	S/N Type of Structures	Description	Size	Number	Comments	
	11011= 1.	1-1100	A-11=	A EC IM	201 - T	
140. 0 141111114 14 01. 01	MONE M	111114	THE	<del>/*                                    </del>		

S/N	Type of crops	Young .	Medium	Matured	Quantity	Comments
<u>  1.</u>	raffia palm	3	1		4	
2.	DIL PALM		_ 4		1.5	
3.	MANGROVE	FEIN	FEW		FEW	
<u> </u>		<del></del>				


#### 18. Fislt/Nets/Ponds

S/N	Fish/Nets/Ponds	Description		Quantity/Size	Comments
	NONE	WITHIN	ARE	A 0F	IMPACT
	790.	• • • • • • • • • • • • • • • • • • • •		<u>•</u> ·	<u> </u>

#### 19. Others (Specify) i.e. Animal Traps

S/N	Others	Description		Quantity/S	Size	Comments	
	LIDATE	WITHIN	A-2 F	A n	<u></u>	IMPART	
	AGIAC	7900 (100)		-	<u>'</u>	THYTICI	

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

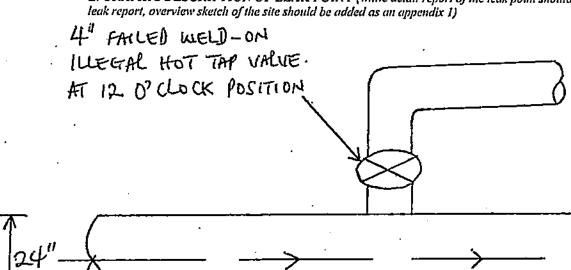

BRASS CREEK TO FORCADOS TERMINAL

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1208043 JIV report S/N: 0575

F: TAB 20.	LE SHOWING SOME OF COORDINATES Impacted area boundary Countinates (If mo	TAKEN DURING JIV FOR AREA CALCULATION ore. Print and allach us an appendix)
S/N	Northing (M)	Easting (M)
<del></del>	124743.75	332299.08
\$ ·\$	\	332280.56
· · · · · · ·	124756.01	332283.66
-	124755.99	332271.34
	124768.25	332252.85
	124762.10	332249. 78
	124734.53	332299.09
ļ	124725.32	332299.10
	124716.10	332299 · 11
	124725. 31	332292.94
	124728.37	332286.78
	124756.02	332289.82
	124737.57	332277. 53
	124737.57	332274.48
	-	
		l /
	· /	(67.
		9000
	/.	06/07/2014
· · ·		
1		

# ESTIMATION OF OIL SPILL VOLUME 24" TRANS - RAMOS PIPELINE AT AGHORO - 1208043

0	IL SPILLED ONSHORE	OFFSHORE (Leak stopped at s	source)		
<u>ļm</u>	pacted Area Detalls				
	Total Calculated Area of	Impact			900.00 m²
	1 Impact within SPDC R.O.V	V			m²
	il impact outside SPDC R.O.	.w			m²
1 <u>Vç</u>	<u>Slume of oil recovered befor</u>	<del></del>			
	I Estimated Recovered oil (I	det)			0.00 bbts
	<b>=</b> 4	(NI_NI II			0,00 bbis
	Estimated Recovered oil	(Mar) Asset		·····	A'nA pole
		talizat zaterma na sten			
	omputation of estimated res	of free phase oil (on land or confined	i water hadul		
B	i Total area occupied by po		, water popy,		650.00 m <sup>2</sup>
	ii Average depth of pool of fi	•			0.003 m
		If applicable, else 0%)			30.00 %
	m Cineminentali learn.	ii approactor and a re-			
	Estimated Volume of poo	ol of free phase oil, V <sub>peol</sub>			1.37 m³
	Estimated Volume of poo	ol of free phase oil, V <sub>pool</sub>			8.59 hbls
	<del></del>	<u> </u>			
ь	Computation of estimate	d volume of infiltrated oil in the soil	(V <sub>int</sub> )		
	1 Volume of Infiltrated oil a				
	i Total area covered by the	oil (infiltration)			12.00 m²
	ii Average depth of Infiltratio	n above leaking facility i.e. pipeline/flow	⁄line		0.200 m
	iii <u>Soil type</u>				Laterite
	iv P. (effective porosity of the	ı soil)			(20)%
	v Cause of spill				Third party interference ( )
			4 11 11 11 11 11		
		infiltration below the leaking point on p			
	Incident Date	JIV Date	Days on Site	 	
	7/2/2014 14:00	7/6/2014 11:45 atlonal , use 1 week as worst case			
	scenario except w	here 'days on site' exceeds 7.	7 _		
					<b>-</b>
		Infiltration of oil types in various soil by			_
	Soil type	Approximate time to reach			4
	Oil type	Sand	Loam	Clay	4
	Bonny Medium	3 weeks	3 years	> 10 years	4
	Bonny Light	2 days	2 months	> 10 years	J
					Bonny Medium
	vii Oil type	- hoteustaalisa faailiss la sisolisatiiss	fina.		0.0037 m
	An Wetage debru of immand	in below leaking facility i.e. pipeline/flow	IMI#		a. W. Sec. a., October 19
	ix Total depth below ground	surface of infiltration of oil			0.2037 m
	re retail debut below Brodug	SUITAGE OF ITHER EXPERT OF OR			1. 4.4 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1. 1.
	Estimated Values of int	thestad oil W			0.49 m³
	Estimated Volume of Inf Estimated Volume of Inf				3.07 bbis
	Espitiaten solution of the	PARTOC CITY I MITS			
	z Volume of Infiltrated oil	at second spill point [if applicable] (	V <sub>m(n</sub> )		
	I Total area covered by the		H4.5.1		m²
	# Average depth of infiltration	n above leaking facility i.e. pipeline/flov	ฟโกe		<u></u>
	III Soil type				- Seiect - <u> </u> ▼
	iv P. (effective porosity of th	a soil)			<u> </u>
					Carrier asia annal
	<ul> <li>Average depth of infiltration</li> </ul>	on below leaking facility i.e. pipeline/flow	rline		0.0000 m
	vi Total depth below ground	surface of infiltration of oil			mm
	Estimated Maluma of Int	Strested all V			° m 0.00
	Estimated Volume of Int				0.00 bbls
	Estimated Volume of Int	HRAIRO OIL A PULP			A44 phis

2 Valume of infiltrated all auto	rido immodista estil solutioi son	land the st			
	3 Volume of inflitrated oil outside immediate spill point(s) region (V <sub>late</sub> ) 1 Total Area covered by the oil (infiltration)				
ii Total Area of the pool of free p	238,00 m²				
iii <u>Soil type</u>	0.00 m²				
iv P. (effective porosity of the so	· <del></del>				
is a few and a f	7			20[%	
v Average depth below ground:	surface of infiltration of oil			0.0037 m	
Estimated Volume of Infiltra	tod oll, V <sub>inte</sub>			0.17 m³	
Estimated Volume of Infiltra	ted oll, V <sub>info</sub>	·	·-	1.09 bbls	
Estimated Total Volume of In	ofiltrated oil Mr		-	a a a J	
Estimated Total Volume of in		·	<del> </del>	0.66 m <sup>3</sup> 4.17 bbls	
			3,4,263	7777 #013	
<ul> <li>Computation of volume of o</li> </ul>	il on open water based on stand	fard coloration			
l Total area of oil on open water				0.00 m²	
ii Table of average depth of oil o	on water based on coloration			<del></del>	
Spill Factors from USCG FOG (2000	Edition)	Link to Coverage Visual Ald	•		
	Thiskeyes to 1	Percentage coverage			
Barely Visible	Thickness (дид.) 0.00004	(%)	Volume (m3)		
Silvery	800000.0		0.0000		
Slight Color	0.00035		0.0000		
Bright Color	0.00015		0.000.0		
Dull	0.001	<u>-</u>	0.0000		
Dark	0.002		0.0000		
Black oil	0.1		0.0000		
Emulsion (30% Qii)	1		0.0000	•	
	Percent Total:				
		· -		•	
Estimated Volume of oil on o	pen water, V <sub>wat</sub>			0.00 m³	
Estimated Volume of oil on o	pen water, V <sub>wat</sub>			0.00 bbts	
Calculation of evaporated volume	ī				
Saidburgon of exabolating Actionic	•				
Evaj	oration Factors (E-Factor) for S	PDC Crude oll			
-	pilled oil (days on site)	Oil ty	ρe		
1331331753 31175 31175		Bonny Light	Bonny Medium		
	1 day	10%	5%		
t:	1-7 days				
>:	40%	25%			
1 Was oil recovery before JIV co	maletian done before UV det=2		ſ	No 🔽	
ii Estimated volume available for	•			No Table bbls	
₩ E-factor	ill E-factor				
Estimated Volume of evapora	ated oil, V <sub>erro</sub>		<del></del>	2.25 bbls	
		-	·····	THE NUIS	
Net Total Estimated Spli	led Volume, V <sub>Est</sub>		<del></del>	15.00 bbis	
<del></del>					

# THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: 12080 43 JIV report S/N: G. INCIDENT INFORMATION: 20. Impacted Area Details Total calculated area of impact\_ $\mathbb{O}$ , $09\mathcal{V}_{o}$ Impact within SPDC R.O.W Impact outside SPDC R.O.W 21. Volume of oil recovered before completion of JIV (Vreel): Recovered oil Viet. Barrels Controlled recovery/evacuation from source with no impact to environment: Barrels Net Estimated Spilled Volume Ven (bbls): \*Notes: Volume estimation was done using an excel based tool.(see attached for details on the calculation) Reported spilled volume is an estimate Write other relevant notes taken into consideration for estimating the spilled in the box below: Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of $m^2$ to barrels is Volume (m3) x 6.29; \*\*Round up estimated volume to next whole number using the following rules: Any spill volume in excess of I bbl Is rounded up to the next whole number. Any spill volume in less than I bbl is rounded up to the next 0.1 bbl. Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl. Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for

column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1208043 JIV report S/N: 0575

### 23. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works
9.4.	•

### 24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Department of Petroleum Resources [DPR]: □
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]: 
   □
- Nigeria Police Force [NPF]: D
- Shell Petroleum Development Company [SPDC]: ☑
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings□

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1208043 JIV report S/N: 0575

25. Appendix 1: Overview sketch of the site

