

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1193469 2. Type of incident\* OIL SPILL  
 3. Name of Location 20" OPUKUSHI - BRASS CREEK PIPELINE  
 4. Name of nearest community TAMOGBENE 5. State: BAYELSA 6. LGA EKEREMOR  
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident  
 a. Date of incident: 9<sup>TH</sup> JUNE, 2014  
 b. Start date/time of investigation: 14<sup>TH</sup> JUNE, 2014 AT 1655HRS  
 c. Investigation End date: 15<sup>TH</sup> JUNE, 2014 Actual investigation duration, days: 2 DAYS  
 d. Description of spill point environment

- |   |  |  |
|---|--|--|
| <input type="checkbox"/> Firmed soil              | <input type="checkbox"/> Loose soil        | <input type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water              | <input checked="" type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface    |
| <input type="checkbox"/> Well Platform (on Water) |  | <input type="checkbox"/> Drill Rig               |

Additional observations around the spill point: UPON EXCAVATION, A 6" ILLEGAL HOT TAP VALVE WAS OBSERVED WELDED ON THE 20" CRUDE OIL PIPELINE AT 12 O'CLOCK POSITION. THE LEAK IS FROM THE CONNECTED PIPE FITTING ABOUT 20m FROM INCIDENT POINT.

- c. Description of leak point (tick as applicable);
- |  |   |   |
|--|---|---|
| <input type="checkbox"/> Drilled hole  | <input type="checkbox"/> Hack saw cut                   | <input type="checkbox"/> Tear (_____),                              |
| <input type="checkbox"/> Complete Rupture                                      | <input type="checkbox"/> Inward dent,                   | <input type="checkbox"/> Well head tampering                        |
| <input checked="" type="checkbox"/> Failed Weld-on illegal hot tap valve,      | <input type="checkbox"/> Failed Clamp                   | <input type="checkbox"/> Missing Pipeline/Flowline                  |
| <input checked="" type="checkbox"/> Crude oil theft (illegal bunkering) point, |   | <input type="checkbox"/> Third party tampering with Clamp           |
| <input type="checkbox"/> Third party tampering with valve setting,             |   | <input type="checkbox"/> Third party tampering with flange,         |
| <input type="checkbox"/> Corrosion   | <input type="checkbox"/> Saver-pit over flow,           | <input type="checkbox"/> Surge vessel overflow,                     |
| <input type="checkbox"/> Bulging Outward                                       | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party equipment |
| impact   | <input type="checkbox"/> Valve Failure                  | <input type="checkbox"/> com unit failure                           |
| <input type="checkbox"/> Relief valve failure                                  | <input type="checkbox"/> Others (specify) _____         | <input type="checkbox"/> Cold vent                                  |

- f. Incident caused by:
- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3<sup>rd</sup> party damage   
 Operational  Others (including Mystery spills) \_\_\_\_\_

\*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

g. Spill point coordinates (m) Minna - West belt

Measuring unit (m)	Northing:	Easting:
	<u>104200.43</u>	<u>362332.18</u>
	<u>[Signature]</u>	<u>[Signature]</u>

C. RISK ASSESSMENT

10. Type of environment:

- Land  Swamp  Water  Seasonal swamp  Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land  Swamp  Water  River (identify) \_\_\_\_\_

ii. Weather condition

- Rain  Sunny  Dry  Wet  Windy  Hot  Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area
- Drinking water source
- Built up area
- Farmlands
- Fish Farm/Pond
- Fishing net
- Others (specify).

[ ,m]  
[ ,m]  
[ ,m]  
[ ,m]  
[ ,m]

NONE SEEN WITHIN THE VICINITY

12. Containment measures put in place;

- Booms  Trench  Dyke  Natural depression  Pit  None  
 Others: \_\_\_\_\_

13. Any pictures or video coverage?

[N]

14. Further response/repair initiated as at the time of JIV?

[Y]

If yes to item 14, give brief description: REPAIR IS BEING PLANNED BY PIPELINE

ASSET TEAM

15. Was there any disruption to the investigation?

[Y]

If yes to item 15 give brief description:

NOT APPLICABLE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	NONE WITHIN AREA OF IMPACT				

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1.	OIL PALM	4	6	15	25	/
2.	RAFFIA PALM	—	6	5	11	
3.	SOFT WOOD	8	3	—	11	
4.	MANGROVES	FEW	FEW	—	FEW	

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

6" FAILED WELD-ON ILLEGAL HOT TAP VALVE AT 12 O'CLOCK POSITION

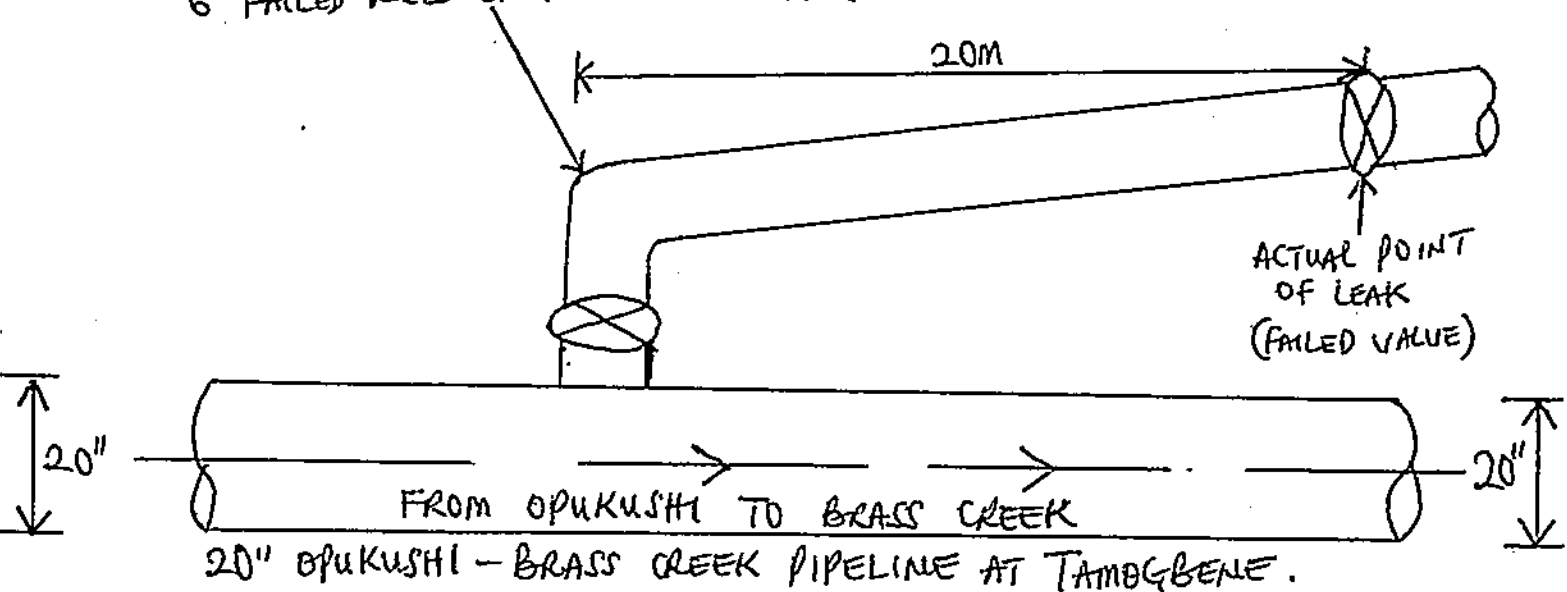

20" OPUKUSHI - BRASS CREEK PIPELINE AT TAMOGBENE.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates *(if more, Print and attach as an appendix)*

Mina - West belt

S/N	Northing (m)	Easting (m)
	104 171.69	362 297.09
10	104 172.76	362 316.82
	104 169.84	362 336.91
	104 135.57	362 337.09
	104 136.13	362 296.53

*CSA*

**ESTIMATION OF OIL SPILL VOLUME 20" OPUKUSHI - BRASS CREEK PIPELINE AT TAMOGBENE - 1193469**

**A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)**

**Impacted Area Details**

Total Calculated Area of Impact

- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

1,400.00	m <sup>2</sup>
	m <sup>2</sup>
	m <sup>2</sup>

**1 Volume of oil recovered before completion of JIV (V<sub>rec</sub>)**

i Estimated Recovered oil (Net)

0.00	bbbls
------	-------

Estimated Recovered oil (Net) V <sub>rec</sub>	0.00	bbbls
--	------	-------

**2 Computation of estimated residual volume on site**

**a Computation of volume of free phase oil (on land or confined water body)**

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (if applicable, else 0%)

1,250.00	m <sup>2</sup>
0.005	m
30.00	%

Estimated Volume of pool of free phase oil, V <sub>pool</sub>	4.38	m <sup>3</sup>
Estimated Volume of pool of free phase oil, V <sub>pool</sub>	27.62	bbbls

**b Computation of estimated volume of infiltrated oil in the soil (V<sub>inf</sub>)**

**1 Volume of infiltrated oil at spill point (V<sub>inf a</sub>)**

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P<sub>e</sub> (effective porosity of the soil)

12.00	m <sup>2</sup>
0.300	m
Clay	
8	%

v Cause of spill

Third party interference

vi Calculation of days for infiltration below the leaking point on pipeline or flowline		
Incident Date	JIV Date	Days on Site
6/9/2014 14:00	6/14/2014 11:45	5
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

vii Infiltration of oil types in various soil types vs time.			
Soil type	Approximate time to reach 1m depth below ground level		
Oil type	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

viii Oil type

Bonny Medium

ix Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.0014	m
--------	---

x Total depth below ground surface of infiltration of oil

0.3014	m
--------	---

Estimated Volume of infiltrated oil, V <sub>inf a</sub>	0.29	m <sup>3</sup>
Estimated Volume of infiltrated oil, V <sub>inf a</sub>	1.82	bbbls

**2 Volume of infiltrated oil at second spill point (if applicable) (V<sub>inf b</sub>)**

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P<sub>e</sub> (effective porosity of the soil)

	m <sup>2</sup>
	m
- Select -	
0	%

v Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.0000	m
--------	---

vi Total depth below ground surface of infiltration of oil

0.0000	m
--------	---

Estimated Volume of infiltrated oil, V <sub>inf b</sub>	0.00	m <sup>3</sup>
Estimated Volume of infiltrated oil, V <sub>inf b</sub>	0.00	bbbls

3 Volume of infiltrated oil outside immediate spill point(s) region ( $V_{inf,c}$ )

- i Total Area covered by the oil (infiltration)
- ii Total Area of the pool of free phase oil in touch with soil
- iii Soil type
- iv  $P_e$  (effective porosity of the soil)

138.00 m<sup>2</sup>  
 0.00 m<sup>2</sup>  
 Clay  
 8%

v Average depth below ground surface of infiltration of oil

0.0014 m

Estimated Volume of Infiltrated oil,  $V_{inf,c}$  0.02 m<sup>3</sup>  
 Estimated Volume of Infiltrated oil,  $V_{inf,c}$  0.10 bbls

Estimated Total Volume of Infiltrated oil,  $V_{inf}$  0.30 m<sup>3</sup>  
 Estimated Total Volume of Infiltrated oil,  $V_{inf}$  1.91 bbls

c Computation of volume of oil on open water based on coloration

- i Total area of oil on open water
- ii Table of average depth of oil on water based on coloration

0.00 m<sup>2</sup>

[Link to Coverage Visual Aid](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage (%)	Volume (m <sup>3</sup> )
Barely Visible	0.00004		0.0000
Silvery	0.00008		0.0000
Slight Color	0.00015		0.0000
Bright Color	0.0003		0.0000
Dull	0.001		0.0000
Dark	0.002		0.0000
Black oil	0.1		0.0000
Emulsion (30% Oil)	1		0.0000
Percent Total:		0%	0.0000

Estimated Volume of oil on open water,  $V_{wat}$  0.00 m<sup>3</sup>  
 Estimated Volume of oil on open water,  $V_{wat}$  0.00 bbls

3 Calculation of evaporated volume

Evaporation Factors (E-Factor) for SPDC Crude oil		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

- i Was oil recovery before JIV completion done before JIV date?
- ii Estimated volume available for evaporation

No  
 29.43 bbls

iii E-factor

15%

Estimated Volume of evaporated oil,  $V_{evap}$  5.18 bbls

Net Total Estimated Spilled Volume,  $V_{Est}$  34.63 bbls

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.14ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV ( $V_{rec}$ ):

Recovered oil $V_{rec}$ :	<u>NIL</u>	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

22. Net Estimated Spilled Volume $V_{ES}$ (bbbls)* =	<u>34.63 BBLS</u>
Estimated Reported Volume** $V_{rep}$ (bbbls) =	<u>35 BBLS</u>

\*Notes:

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume ( $m^3$ ) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl  
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl  
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193469 JIV report S/N: 0570

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

*Tick as applicable*



THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1193 469 JIV report S/N: **0570**

25. Appendix 1: Overview sketch of the site

