JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1202107 JIV report S/N: 00597 (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1202.107 2.Type of incident* 0 5. State: RIVERS 6. LGA AKUKU-TORU 4. Name of nearest community **RELEMA** 7. Type of Production facility/Installation WELLHEAD 8. Asset owner/District SWAMP 2 **B. INCIDENT INFORMATION:** 9. Details of incident 25 TH JUNE, 2014 b. Start date/time of investigation: 27TH JUNE, 2014/10:55 Hours Actual investigation duration, days: ONE (1) DAY c. Investigation End date: 2 2014 d. Description of spill point environment Recently excavated area Loose soil ☐Firmed soil **□**Swampy Exposed pipe surface Under water Well Platform (on Water) ☐Drill Rig Additional observations around the spill point: OIL BUBBLES WERE NOTICED INTERNALL AT THE POSITION OF THE MISSING CAMERON CONTROL UNIT ON THE WELL 7L ARM (BEING THE SPILL POINT). THE BONNET GASKET AND ONE OF THE FLANGE BOLTS FOR THE MISSING CCU ON WELL 7L WAS FOUND ON THE WELL HEAD GRATING AS AT TIME OF INVESTIGATION, OIL STAINS WERE OBSERVED ON THE BODY OF THE NELL HEAD BUT ONLY LIGHT OIL SHEEN WAS OBSERVED AS SPILL TO e. Description of leak point (tick as applicable); ENVIRONMENT (ON WATER), ALSO, THE CCI ☐ Tear (Hack saw cut Drilled hole Well head tampering WERE OBSERVED ☐ Inward dent, Complete Rupture Missing Pipeline/Flowline MISSING, BUT ☐Failed Weld-on illegal hot tap valve, ☐Failed Clamp Third party tampering with Clamp 083ERVABLE Crude oil theft (illegal bunkering) point, ☐ Third party tampering with flange, SPILL IMPACT. Third party tampering with valve setting, ☐ Saver-pit over flow, ☐Surge vessel overflow, ☐ Corrosión Flare System/Bund wall failure Accidental 3rd party equipment ☐ Bulging Outward ☐com unit failure Cold vent ☐ Valve Failure impact DOTHER (specify) CAMERON CONTROL UNIT (CCU)
REMOVAL BY UNKNOWN PERSON. Relief valve failure f. Incident caused by: Third party interference (Sabotage , crude theft□; Line theft□; Accidental 3rd party damage□) Others (including Mystery spills)_ ☐ Operational

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1202	107_JIV report S/N: 00597
g. Spill point coordinates Measuring unit M	M10-B=17)
Northing:	Easting:
43675-23	466531.88
7501525	700031 08
C. RISK ASSESSMENT	
10. Type of environment:	
□Land □Swamp ☑Water □Se	easonal swamp Shoreline/Waterfront
i. Type of environment to which oil has spread:	
□Land □Swamp ✓Water □R	iver (identify)
ii. Weather condition	
☐Rain ☐Sunny ☐Dry ☐Wet 11. Distance from the nearest sensitive habitat	□Windy □Hot □cool
Government reserved and designated protected area Drinking water source NONE Built up area Farmlands OBSERVED Fish Farm/Pond WITHIN Fishing net Others (specify).	[,m] [,m] [,m] [,m] [,m] [,m]
12. Containment measures put in place;	
Dothers: NoT APPLICABLE (LIGHT 13. Any pictures or video coverage?	Intural depression
	[·] [·]
If yes to item 14, give brief description:	ABLE
	[Y] [NJ/
15. Was there any disruption to the investigation?	[Y] [N]/
If yes to item 15 give brief description:	CABLE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1202107 JIV report S/N: 00597

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
11	ONE I	\ - , , , ,	١ ٨ ه) F	140
17	ONE W	11411	1 A	KEA UP	IMPACI

17. Crops/Economic Trees


S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONE	WITHIN	1 As	EA	DF IM	PACT

18. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Siz	e Com	ments	
X	ONE	WITHIN	AREA	0F	IMPACT	

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments	
-	1-1-	11 1	-	<u> </u>	
++	NONE	MI HIN A	REA	0 1	IMPA CT
			,		

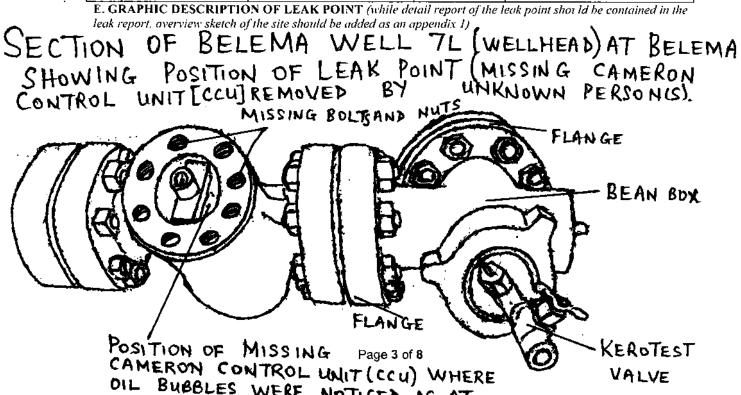

DIL BUBBLES WERE NOTICED AS AT

TIME OF INVESTIGATION [LEAK POINT]

KEROTEST

VALVE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1202107 JIV report S/N: 00597

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, F	Print and attach as an appendix)
--	----------------------------------

	MINNA	(MIO-AELT) Easting
S/N	1 11 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1 1	
	43672.36	43672.36
	43669 42	466541.02
	43680.95	466 519.85
	43672·36 43669·42 43680·95 43687·41	43672.36 466541.02 466519.85 466532.76
·		
<i>y</i>	l	

G. INCIDENT	INFORMATION:				
20. Impacted	l Area Details			. 1	
•	Total calculated area of i	impact	0.02	H9	
•	Impact within SPDC R.C).W	YES		
•	Impact outside SPDC R.	O.W	No		
21. Volume	of oil recovered before o	completion of	IV (V _{recJ}):		
	•	Recovered	oil V _{recJ} :	NiL	Barrels
Controlled	recovery/evacuation fro	om source wit	h no impact to	environment:	•
	N	iL B	arrels		

22. Net Estimated Spilled Volume V _{Est} (bbls)* =	0.004
Estimated Reported Volume** V _{rep} (bbls)=	BARREL

*Notes:

Volume estimation was done using an excel based tool. (see attached for details on the calculation)

Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; **Round up estimated volume to next whole number using the following rules:

Any spill volume in excess of 1 bbl is rounded up to the next whole number.

Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Wherever this estimation tool is not applicable please refer to puragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

v Average depth of infiltration below leaking facility i.e. pipeline/flowline

	<u>ES</u>	<u>TIMATION OF OIL SPIL</u>	<u>L VOLUME</u>			
_	011	PRILIED ANGUARE	SEESUARE // eak stooped at /	ourra)		
A			OFFSHORE (Leak stopped at s	ource)		
	<u> </u>	acted Area Details				219.00 m²
		Total Calculated Area of I	•			219.00 m ²
		I Impact within SPDC R.O.W				0.00 m ²
		ii Impact outside SPDC R.O.I	v			0.00]
1	Vol	ume of oil recovered before	completion of JIV (V,,,,)			
		i Estimated Recovered oil (N				bbls
		Estimated Recovered oil	Madi V			aidd 00.0
		Estilization Meconesian on A	Teach Chica			
2	Co	mputation of estimated resi	duai volume on site			
	а	Computation of volume of	f free phase oil (on land or confined	water body)		
		Total area occupied by poo	of free phase oil			. m²
		is Average depth of pool of fro	e phase oil			m
	i	ii Emulsification factor (I	f applicable, else 0%)			%
						0.00 m³
		Estimated Volume of poo				0.00 hbls
		Estimated Volume of poo	l of free phase Oil, V _{pool}			0.00 0.018
	_	O	tracions of inflicted all in the sail	M. A		
	Ь	•	t volume of infiltrated oil in the soil	(V int)		
		1 Volume of Infiltrated oil a	• • • • • • • • • • • • • • • • • • • •			m²
		i Total area covered by the o	•	4 *		
		•	above leaking facility i.e. pipeline/flow	tine		<u> m</u> Select-
		iii <u>Soil typ</u>				- Select - ▼ %
		v P, (effective porosity of the	son)			76
						1
		v Cause of spill				Third party interference
		vi Calculation of days for	infiltration below the leaking point on p	ipeline or flowline		
		Incident Date	JIV Date	Days on Site		
		6/25/2014 9:00	6/27/2014 10:55	2	1	
			ational, use 1 week as worst case			
			ere 'davs on site' exceeds 7.	7		
			Infiltration of oil types in various soil t	moe ve time		٦
		Soil type	Approximate time to reach		nd level	1
		Oil type	Sand	Loam	Çlay	7
		Bonny Medium	3 weeks	3 years	> 10 years	7
		Bonny Light	2 days	2 months	> 10 years	
		vir Oil type				Bonny Light
		iii Average depth of infitration	n below leaking facility i.e. pipeline/flow	/line		m
		•				
		ix Total depth below ground :	surface of infiltration of oil			m
		·				
		Estimated Volume of infi	Itrated oil, V ida			0,00 m ³
		Estimated Volume of infl	itrated oil, V _{inf.}			0.00 bbis
						_
		2 Volume of infiltrated oil a	t second spili point [if applicable] (V _{infb})		
		i Total area covered by the				m²
			n above leaking facility i.e. pipeline/flov	wine .		m __
		iii Soil type				- Select -
		iv P, (effective porosity of the	a soil)			%

JOINT INVESTIGATION REPORT SPILL VOLUME ESTIMATE FOR INCIDENT NO: 1202107

3

stal depth below ground s	surface of infiltration of oil			m
etimated Volume of Infl.	Itrated oil, V _{ed b}		[0.00 m³
stimated Volume of Infl	Itrated oil, V and b			0.00 bbls
Jalana of Inditioning oil o	outside immediate spill point(s) regio	on (1/)		
		Oli (V M/c)	Г	m²
Total Area covered by the	,		<u> </u>	m²
	ee phase oit in touch with soil		L	- Select -
Soil type	110		-	
e, (effective porosity of the	soli)			<u></u>
Average depth below grou	nd surface of infiltration of oil		I	m m
Estimated Volume of infl	itrated oil, V		Г	0.00 m³
Estimated Volume of Infl				0.00 bbis
				•
Estimated Total Volume				0.00 m³
Estimated Total Volume	of inflitrated oil, V _{MC}		_	0.00 bbls
Computation of volume	of oil on open water based on stand	iant coloration		
Total area of oil on open w			Γ	219.00 m²
	oil on water based on coloration		•	
toolo oi avoingo dopoi oi		Link to Coverage Visual		
Spill Factors from USCG FOG	(2000 Edition)	Ald		
	Thickness (mm)	Percentage coverage (%)	Volume (m3)	
Coroly Visible	0.0004		0.0000	
Barely Visible			0.0000	
Silvery	0.00008	· · · · —	0.0000	
Slight Color	0.00015	 		
Bright Color	0.0003		0.0000	
<u>Dull</u>	0.001	<u> </u>	0.0000	
<u>Dark</u>			0.0004	
Black oil		├ ──	0.0000	
Emulsion (30% Oil)	1		0.0000	
	Percent Total:	100%	0.0004	
Estimated Volume of all	on onen water V			0.0004 m ³
Estimated Volume of oil Estimated Volume of oil				0.003 bbls
ulation of evaporated vo	lume Evaporation Factors (E-Factor) for 1	SPOC Crude oil		
		Oil ty	rpe	
Residence tim	e of spälled oंस (days on site)	Bonny Light	Bonny Medium	
	< 1 day	10%	5%	
	1-7 days	25%		
	> 7 days	40%	25%	
184	III annulation done below INI debat		1	 No▼
	//V completion done before JIV date?		,	bbls
Estimated volume availab	ne for evaporation			מומו
E-factor				%
Estimated Volume of ex	raporated oil, V _{max}			0.001 bbis
	Spilled Volume, V _{Est}			Q.004 bbls

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 12 02 107 JIV report S/N: 00597

23. GEI	NERAL	STA	TUS O	FTHE	SITE
---------	-------	-----	-------	------	------

A.	-	ion of the incident site found that there is no residual impact after the initial I therefore recommend that the site be closed out
В.	Investigation of works	f the incident site showed that there is residual impact on site requiring further
		· · · · · · · · · · · · · · · · · · ·

24. REPRESENTATIVES

This re	port was filled, agreed and signed by the following joint investigation representatives:
•	Host Community:
•	Department of Petroleum Resources [DPR]: □
•	National Oil Spill Detection and Response Agency [NOSDRA]:
•	State Ministry of Environment [SME]:
•	Nigeria Police Force [NPF]: □
•	Shell Petroleum Development Company [SPDC]:
•	Signatories agree with reported findings:
•	Separate DPR form has been filled out with same findings
	Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1202107 JIV report S/N: 00597

25. Appendix 1: Overview sketch of the site

