NT INVESTIGATION REPORT FOR INCIDI	ENT NO: 11720	32_ JIV report S/N:	0537
(Note: As practicable as possible the JIT repor	rt is to be signed in the fi	eld by all the participating p	arties)
A. GENERAL INFORMATION:			
1. Spill incident Number: 117203	2. Type of	fincident* OIL SPI	L2_
3. Name of Location 8" MINIMIA	- Rumyek	pe Bulklin	E
4. Name of nearest community Rymust	9+ 5. State: RIV	ERS 6. LGA EMO)	tua.
7. Type of Production facility/Installation Bu	<u> 1レKレルノモ</u> 8. As	set owner/District LAN	02.
B. INCIDENT INFORMATION:		JIV FIRST V JIV SECOND VI JIV LAST VIS	ISIT WAS 7 TH ISIT WAS 14 TH
9. Details of incident a. Date of incident: 4" MAY			IT WAS 17"
b. Start date/time of investigation: 71	MAY 2014/13	3:25 pm	
c. Investigation End date: 17 MA	~) 2014 Actual invest	igation duration, days: TH	REE(3) NAY
d. Description of spill point environmen	•		
		5 6	
	Loose soil	Recently excavated area	
☐ Under water ☐ ☐ Well Platform (on Water)	Swampy	☐ Exposed pipe surface ☐ Drill Rig	
Additional observations around the spill p LINER AND SAND BAGS S THEFT POINTS.	THERE'S OVER 1	TATE ALL OF CA	
e. Description of leak point (tick as app	licable);		
☐ Drilled hole	Hack saw cut	Tear (),
	□Inward dent,	☐Well head tampering	
Failed Weld-on illegal hot tap valve,	☐ Failed Clamp	☐Missing Pipeline/Flowli	ne
Crude oil theft (illegal bunkering)	-	☐ Third party tampering w	rith Clamp
☐ Third party tampering with valve		Third party tampering w	ith flange,
_	_ •	Surge vessel overflow,	
☐Bulging Outward	•	Il failure □Accidental 3 rd	
impact 🔲 Valve Failure	□com	unit failure	vent
Relief valve failure			
	Others (specify)		
f. Incident caused by:			
f. Incident caused by: ☐Third party interference (Sabotage□;			age□)

^{*}This.can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

INVEST	IGATION RE	EPORT FOR INC	CIDENT NO	1172	032	JIV repo	rt S/N:	053	37
g. Sp	Measuring Northing:		Λ	Inna-	- M\	d be	<u>#</u>		
	SP1= SP2=	110448	65 65	Pů;	470	655 655	89 - 61	(Z'	
. RISK /	ASSESSME	NT							
10.	Туре	of environment:							
E	Land	□Swamp	□Water	□s	easonal swa	ımp□Sh	oreline/Wa	terfront	
	i. Type o	of environment to	which oil has	s spread:					
Ç	Land	□Swamp	□Water	\square_{R}	iver (identi	fy)			
	ii. Weath	er condition							
	Rain	Sunny the nearest sensitive	□Dry ve habitat	□Wet	□Wir	ady	□Hot	□со	ol
0 19 0 0	Governme Drinking v Built up ar Fish Farml Fishing ne Others (spe	ea /Pond t	signated pro	tected area	[///	► ,m] ► ,m] ► ,m] ► ,m]			
12. Co	ontainment m	easures put in pla	ce;						
	□Booms ☑Others: <u>F</u> y	Trench	□Dyke		latural depr		□Pit		□None
13. A	ny pictures o	r video coverage?			W	[N]			
14. I	Further respon	nse/repair initiated	l as at the tim	ne of JIV?	[Y]	[M]			
f yes to iter	m 14, give brie	f description:							
									
15. W	Vas there any	disruption to the i	nvestigation	?	[X]	[N]			_
f yes to ite	em 15 give b	rief description:	AND 1/1	sites II	16- 2311	_ S.T	E mai	746	7 MAY, 2
11376.11		427 F J L W "-1	- <u> </u>				<u> </u>		MV+STI GH

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1172032 JIV report S/N: 0537

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N Type of St	ructures	Description	Size	Number		Comments
NONE	1.417	HIIL	ARF	А	OF-	TMPAG
	70		7 (1			
17. Crops/Eco	nomic Trees	<u></u>	<u></u>		_	

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	MLMI TREE				3	DATAN-CTED
2	CASSAVA				140	RY SPILL
3	MAITE				100	
	·					

18. Fish/Nets/Ponds


S/N Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE	LITHIAL A	REA (FIMPACT

19. Others (Specify) i.e. Animal Traps

S/N Others	Description		Quantity/Size	Comments
NONE 1	MATHIN	AR	A 0	IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

ECTION OF 2 NOS OF CRUDE OIL THEFT POINTS AT 12 0'LLOUR POSTTION.

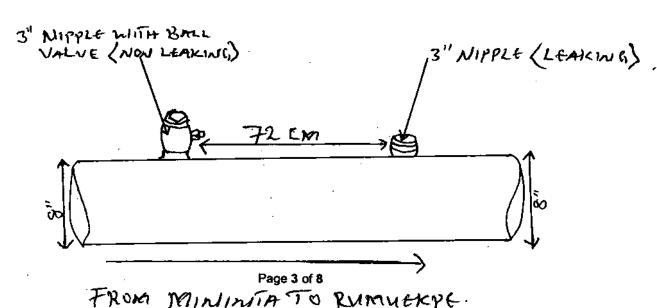

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1172032 JIV report S/N: 0537

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 20. Impacted area boundary Coordinates (If there, Print and attack as an appendit)

20	. Impacted area countains coordinates (2)	Minna-Mid belt.
S/N	Northing (M)	Easting (m)
	110454.77	470664.15
	110454·77 110417·91 110430·25 110467·12 110470·14	470664·15 470660·97 470642·52 470642·62 470661 11
	110430.25	470642.52
	110467.12	470642.62
	110470.14	470661 11
		/
,		
		
		+ /
		+ // -
		600
	•	1/2
		\/
		/
	 	<u></u>
	 	
	 	
	 	-
·	+	
		
		1

NT INVESTIGATION REPORT FOR INCIDENT NO: 1172032 JIV report S/N:	0537
G. INCIDENT INFORMATION:	0001
20. Impacted Area Details	
• Total calculated area of impact D. 09kg	
\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	-
• Impact within SPDC R.O.W	_
• Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V _{recl}):	T _ ·
Recovered oil V _{recJ} :	Barrels
Controlled recovery/evacuation from source with no impact to environment: Min Barrels	
22. Net Estimated Spilled Volume V _{Est} (bbls)* =	
5.37 BARRELS	
Estimated Reported Volume** V _{rep} (bbis)= 6 BARRELS.	
O DANKECI.	
*Notes: Volume estimation was done using an excel based tool.(see attached for details on the calculation) Reported spilled volume is an estimate	
Write other relevant notes taken into consideration for estimating the spilled in the box below:	<u> </u>
C- 055051163	•
SEE ATTACHED.	
Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimate Conversion of m³ to barrels is Volume (m³) x 6.29; **Round up estimated volume to next whole number using the following • Any spill volume in excess of 1 bbl is rounded up to the next whole number.	ion software on site; rules:
Any spill volume in less than 1 hbl is rounded up to the next 0.1 bbl.	
Examples: Calculated volume = 15.3 bbl Reported volume = 16 bbl Calculated volume = 0.35 bbl Reported volume = 0.4 bbl Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.	
Wherever this estimation tool is not applicable please refer to paragraph by (Peviotions) of the HV proceeding to use	


Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

ESTIMATION OF OIL SPILL VOLUME

	- SPIELED ONSHORE/OFFSHORE (Leak Stopped at Source)	
IMID	acted Area Details	
	Total Calculated Area of Impact	900.00 m²
	Impact within SPDC R.O.W	m²
i	i Impact outside SPDC R.O.W	[m²
1 <u>Vol</u>	ume of oil recovered before completion of JIV (V)	
	i Estimated Recovered oil (Net)	0.00 bbls
	Estimated Recovered oil (Net) V _{rec}	0.00 bbls
2 <u>Cor</u>	noutation of estimated residual volume on site	
a	Computation of volume of free phase oil (on land or confined water body)	
	i Total area occupied by pool of free phase oil	0.00 m ²
į	Average depth of pool of free phase oil	0.000 m
ii	i Emulsification factor (If applicable, else 0%)	%
	Estimated Volume of pool of free phase oil, V _{pool}	0.00 m³
	Estimated Volume of pool of free phase oil, V _{pool}	0.00 bbls
b	Computation of estimated volume of inflitrated oil in the soil (V int)	
1	Volume of infiltrated oil at apiii point (V _{kd x})	
	i Total area covered by the oil (infiltration)	4.00 m²
i	Average depth of infiltration above leaking facility i.e. pipeline/flowline	0.800 m
ii	i <u>Soil type</u>	Clay ▼
iv	P _e (effective porosity of the soil)	%
,	Cause of spill	Third party interference

vi[Calculation of days fo	r infiltration below the leaking point on p	sipeline or flowline			
L	Incident Date	JIV Date	Days on Site			
ſ	04/05/2014 14:30	17/05/2014 12:20	13			
r	If 'cause of spill' is ope					
L	scenario except v	scenario except where 'days on site' exceeds 7.				

Inflitration of oil types in various soil types vs time.				
Soil type Approximate time to reach 1m depth below ground level				
Oil type	Sand	Loam	Clay	
Bonny Medium	3 weeks	3 years	> 10 years	
Bonny Light	2 days	2 months	> 10 years	

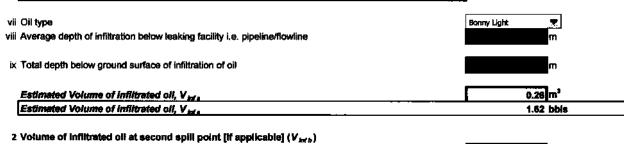

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- $_{iv}$ P, (effective porosity of the soil)
- v Average depth of infiltration below teaking facility i.e. pipeline/flowline



ri Total depth below ground	surface of infiltration of oil			m
Estimated Volume of inf	iltrated oil, V _{lef b}			0.00 m³
Estimated Volume of Inf	iltrated oil, V _{let b}			0.00 bbls
3 Volume of inflitrated oil	outside immediate spill point(s) regi	ion (۷ _{۳۰۰})		
i Total Area covered by the				896.00 m ²
	ee phase oil in touch with soil			0.00 m ²
i Soil type	•			□av ▼
P. (effective porosity of the	e soil)			%
/ Average depth below grou	nd surface of infiltration of oil			m
Estimated Volume of infi	iltrated oil, V _{erfe}			0.26 m³
Estimated Volume of Infl	iltrated oll, V _{infe} _			1.61 bbls
Estimated Total Volume Estimated Total Volume		_		0.51 m³ 3.22 bbis
	oil on water based on coloration	Link to Coverage Visual		m²
Spill Factors from USCG FOG	(2000 Edition)	Aid Percentage coverage		1
	Thickness (mm)	(%)	Volume (m3)	
Barely Visible	0.00004		0.0000	
Silvery	0.00000		0.0000	
Slight Color	0,00015		0.0000	
Bright Color	0.0003		0.0000	
Dull	0.501		0.0000	
<u>Dark</u>	0.002		0.0000	
Black oil	0.1		0.0000	
Emulsion (30% Oil)			0.0000	
	Percent Total:	0%	0.0000	
Estimated Volume of oil				*
	on open water, V _{wat}			0.00 m ³

3 <u>Calculation of evaporated volume</u>

Evaporation Factors (E-Factor) for SPDC Crude oil			
Residence time of spilled oil (days on site)	Oil type		
	Bonny Light	Bonny Medium	
< 1 day	10%	5%	
1-7 days	25%	15%	
> 7 days	40%	25%.	

i Was oil recovery before JIV completion done before JIV date?

ii Estimated volume available for evaporation

bbls

iii *E-factor*

Estimated Volume of evaporated oil, V_{erso}

2.15 bbls

Net Total Estimated Spilled Volume, V_{Est}

5.37 bbls

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1172032 JIV report S/N: 0537

23. GENERAL	STATU	IS OF	THE	SITE
-------------	-------	-------	-----	------

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:
- Department of Petroleum Resources [DPR]: ☑
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: 🗹
- Shell Petroleum Development Company [SPDC]: 🗷
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings □

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1172032 JIV report S/N: 0537

25. Appendix 1: Overview sketch of the site

