JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486 JIV report S/N: 00766 (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1285486 2. Type of incident\* Oll SPILL 3. Name of Location CAWTHORNE CHANNEL 3 WELL 41 S FLOWLINE 4. Name of nearest community SAND-SAND 5. State: RIVERS 6. LGA DEGEMA 7. Type of Production facility/Installation OIL FLOW INES. Asset owner/District SWAMP **B. INCIDENT INFORMATION:** 9. Details of incident TH NOVEMBER, 2014 b. Start date/time of investigation: 14 TH NOVEMBER, 2014/11:23 HOURS
c. Investigation End date: 2014 Actual investigation duration, days: 0 NE(1) DAY d. Description of spill point environment ☐Recently excavated area ☐Firmed soil ☐Under water Exposed pipe surface □Drill Rig □Well Platform (on Water) Additional observations around the spill point: ON JOINT INVESTIGATION TEAM'S ARRIVAL AT SITE, BUBBLES WERE OBSERVED AT SPILL POINT. UPON EXPOSURE VIA EXCAVATION BY THE JOINT INVESTIGATION TEAM, A HISSING SOUND WAS HEARD UNDERNEATH, THE SHRINK SLEEVE FLOWLINE COATING (AROUND THE SPILL POINT) WHICH WAS OBSERVED TO HAVE FAILED LONGITUDINALLY AT 12 0' CLOCK POSITION AN REMOVAL AFTHE FAILED CHOICE CLEANE (CLOCK POSITION) CLOCK POSITION ON REMOVAL OF THE FAILED SHRINK SLEEVE COATING, PITTINGS We. Description of leak point (tick as applicable); OBSERVED AT FOUR POSITIONS ON Hack saw cut Tear ( Drilled hole FLOWLINE SECTIONS Well head tampering | FLOW LINE SECTION, | 11 0' CLOCK, 12 0' CLOCK, | 12 0' CLOCK, | 12 0' CLOCK Complete Rupture ☐Inward dent. ☐ Failed Weld-on illegal hot tap valve, ☐ Failed Clamp Third party tampering with Clamp PosiTions: Crude oil theft (illegal bunkering) point, Third party tampering with flange, YITH Third party tampering with valve setting, DSurge vessel overflow, POINT IDENTIFIED **Z** Corrosión ☐Saver-pit over flow, Flare System/Bund wall failure Accidental 3rd party equipment AS ☐Bulging Outward Com unit failure ☐Cold vent impact ☐ Valve Failure Relief valve failure Others (specify) PITTING A WELDED f. Incident caused by:

☐ Third party interference (Sabotage□; crude theft□; Line theft□; Accidental 3<sup>rd</sup> party damage□) 130 MM f. Incident caused by:

Others (including Mystery spills)\_

**Z**Operational

PIN HOLE.


<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVEST	IGATION RE	PORT FOR IN	CIDENT NO:	<u> 285</u>	<u>486</u> JIV rep	ort S/N: (	00766
g. Sp	ill point coord		More	a M	o-bālī		
	Northing:		71.74	1-1	Easting:		
		6065	1.77		5017	58.6	6nd
			7			1	
		<del> </del>	<del>                                     </del>			$-\!$	
C. RISK A	ASSESSME	NT	A				
10.		of environment:					
ב	Land	Swamp	□Water	□Se	asonal swamp S	horeline/Wa	terfront
	i. Type o	f environment to	which oil has sp	read:			
C	Land	Swamp	□Water	□Ri	ver (identify)		
	ii. Weath	er condition					
	Rain stance from t	Sunny he nearest sensiti	•	□Wet	<b>□</b> Windy	□Hot	□cool
0 0 0	Drinking w Built up are Farmlands Fish Farm/I Fishing net	ea Pond			[ ,m] [ ,m] [ ,m] [ ,m] [ ,m] [ ,m]		
12. Co	ontainment me	easures put in pla	ce;				
_	Booms Others:	Trench	<b>⊅</b> Dyke	□na	atural depression	□Pit	□None
13. Ar	ny pictures or	video coverage?			[Y] [N]		
14. F	urther respon	se/repair initiated	d as at the time of	JIV?	[Y] [N <b>]</b>	/	
If yes to iten	1 14, give brief	description:	1000		101	<b></b> -	
	101	<del></del> -	APPL	_ 1 (	TARF		
15. W	as there any o	lisruption to the i	nvestigation?		[Y] [N]	/	
If yes to ite	m 15 give bri	ef description:			A 1 A 1	<b>-</b>	
	TOP	<u> </u>	APP	1	CARI		

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486 JIV report S/N: 00766

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

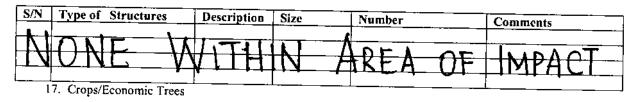

S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONE	MITHIN	AR	E A DI	= IMD	\OT
11311	<del>V V I I I I I I</del>			<u>                                   </u>	16

18. Fish/Nets/Ponds


S/N Fish/Nets/Ponds Description	Quantity/Size	Comments	
NONE WITHIN	AREA	DF _	MPACT

19. Others (Specify) i.e. Animal Traps

S/N Others	Description	Quantity/Size Comments
NONE '	WITHIN A	REA OF IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION (SHOWING PLAN) OF CAWTHORNE CHANNEL 3 WELL 41 S FLOWLINE AT SAND-SAND SHOWING POSITION OF LEAK DUE TO CORROSION.

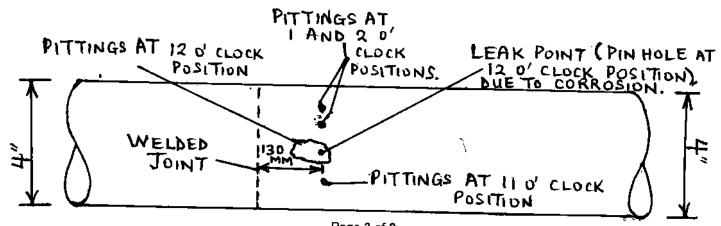

FROM CAWTHORNE CHANNEL 3 WELL 415
TO CAWTHORNE CHANNEL 3 FLOW STATION

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486JIV report S/N: 00766

# F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix) MNドラ (からつらさば)

	Northing MC TEOR	'U BOW
S/N	in C TORA	Easting METERS
	60648-69	501761.73
	60651.75	501 764 • 82
	6065483	501 761.74
	60651-77 60654.84	501765.57
	60654.84	501768.66
		. /
-		
		7
	<b>/</b>	
-		

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486JIV report S/N: 00766

20. Impacted Area Det	tails
-----------------------	-------

Total calculated area of impact	<u>. 0.0033Hq</u>	
Impact within SPDC R.O.W_	\(ēs	
Impact outside SPDC R.O.W	Nο	
21. Volume of oil recovered before comp	letion of JIV (V <sub>recJ</sub> ):	
Re	ecovered oil V <sub>recJ</sub> :	Barrels
Controlled recovery/evacuation from so	ource with no impact to environment:	•
NIL	Barrels	

22. <u>Net Es</u>	timated Spille	d Volume V <sub>Est</sub>	<u> bbls)*</u> =	0.62		
		i je				
Estimated Re	ported Volume	** V <sub>rep</sub> (bbls)=	0	7BARI	₹EL.	

#### \*Notes:

- Volume estimation was done using an excel based tool.(see attached for details on the calculation)
  - Reported spilled volume is on estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than I bbl is rounded up to the next 0,1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

## ESTIMATION OF OIL SPILL VOLUME

OIL	SPILLED ONSHORE	OFFSHORE (Leak stopped at	source)			
mpa	ected Area Details					
	Total Calculated Area of	impact			33.00 m²	
i	Impact within SPDC R.O.V	V			33.00 m²	
íi	Impact outside SPDC R.O.	W		1	0.00 m²	
/olu	me of oil recovered befor	e completion of JIV (V)				
j	Estimated Recovered oil (I	Net)			0.00 bbls	
ı	Estimated Recovered oil	(Net) V <sub>recu</sub>			0.00 bbla	
•						
Com	putation of estimated res	idual volume on site				
1	Computation of volume of	of free phase oil (on land or confined	i water body)			
İ	Total area occupied by por	ol of free phase oil			0.00 m²	
	Average depth of pool of fr	ee phase oil			0.000 m	
įii	Emulsification factor	If applicable, else 0%)			0 %	
	Estimated Volume of poo	of free phase oil, V <sub>pool</sub>			0.00 m³	
	Estimated Volume of poo	of free phase oil, V <sub>pool</sub>			0.00 bbls	
	Compreheton of colleges	d column of highlanded oil in the call	<b>A</b> 1			
	Volume of infiltrated oil a	d volume of infiltrated oil in the soil : t spill point (V )	(▼ inf)			
	Total area covered by the				1.00 m <sup>2</sup>	
	=	on (minuacion) n above leaking facility i.e. pipeline/flow	dine		0.900 m	
	Soil type	1 above seaking facility file, pipelities flow	riire		(Cay ♥	
	P. (effective porosity of the	e soif)			8 %	
•	. B (amazana parasan) an ana				u /0	
٧	Cause of spill				Operational	
اي.		:-#16-#: b-1 #b-1	: l: #ti	1		
vi		infiltration below the leaking point on p	·	1		
	Incident Date	JIV Date	Days on Site	1		
	11/11/2014 11:00	11/14/2014 11:40 ational, use 1 week as worst case	3	1		
ı		here 'days on site' exceeds 7.	7			
		Infiltration of oil types in various soil t	vpes vs time.		ו	
	Soil type	Approximate time to reach		nd level	1	
	Oil type	Sand	Loam	Clay	1	
	Bonny Medium	3 weeks	3 years	> 10 years	1	
	Bonny Light	2 days	2 months	> 10 years	]	
, rià	Oil type				Bonny Light .	
		n below leaking facility i.e. pipeline/flow	dine		0.002 m	
****	, training a stage of an orthogonal				3.55	
įχ	Total depth below ground	surface of infiltration of oil			0.902 m	
	F. 600 . 40 . 116 1					
1						
2	Estimated Volume of infi Estimated Volume of infi Volume of infitrated oil a		(men)		0.07 m <sup>3</sup> 0.45 bbls	
	Total area covered by the				m²	
	Average depth of infiltratio	m				
iíi	Soil type	- , ,			- Select - ▼	
	P. (effective porosity of the	soil)			0 %	
ν	Average depth of infiltration	Average depth of infiltration below leaking facility i.e. pipeline/flowline				
νi	Total depth below ground:	surface of infiltration of oil			0.000 m	
νi	Total depth below ground :				0.000 m	

i Total Area covered by the ii Total Area of the pool of fr		on (V <sub>infe</sub> )		<del></del> 1 ,
i Total Area of the pool of fr				32.00 m <sup>2</sup>
•	ee phase oil in touch with soil			0.00 m²
i <u>Soil type</u> , P <sub>e</sub> (effective porosity of the	e coit			Cley ♥
A LP (ellective bolosity of the	7 SON)			8 %
Average depth below grou	and surface of infiltration of oil		•	0.001 m
Estimated Volume of infi	litrated oil, V <sub>inf c</sub>			0.00 m³
Estimated Volume of infl	itrated oil, V <sub>infe</sub>	•		0.01 bbls
	outside Immediate spill point(s) regio	on (superficial impact	l, V <sub>erf d</sub> )	lm²
Total Area covered by the	-			m²
l lotal Area of the poor of the	ree phase oil in touch with soil			fi1
i Average depth below grou	and surface of infiltration of oil			0.001 m
Estimated Volume of inf	itrated oil, V <sub>infe</sub>			0. <b>0</b> 0 m³
Estimated Volume of inf				0.00 bbls
Estimated Total Volume				0.07 m <sup>3</sup>
Estimated Total Volume	of Infiltrated oil, V <sub>inf</sub>			0.47 bbls
Total area of oil on open w	of oil on open water based on stands vater oil on water based on coloration	ard coloration		m²
		Link to Coverage Visual		
Spill Factors from USCG FOG	(2000 Edition)	Aid Percentage coverage	i	1
	Thickness (mm)	(%)	Volume (m3)	
Barety Visible	0,09004		0.0000	
<u>Silvery</u>	0,0008		0.0000	
Slight Color	0.00015		0.0000	
Bright Color	0.0003		0.0000	
<u>Dull</u>	0.001		0,0000	
<u>Dark</u> Black oil	0.002		0.0000	
Emulsion (30% Oil)	0.1		0.0000	
	Percent Total:	0%	0.0000	
				ı
Estimated Volume of oil	on open water, V <sub>wet</sub>			0.00 m <sup>3</sup>
Estimated Volume of oil	on open water, V <sub>wat</sub>			0.00 bbls
culation of evaporated vol		PDDC Country will		1
	Evaporation Factors (E-Factor) for S	Oil ty		
Residence time	e of spilled oil (days on site)	Bonny Light	Bonny Medium	
	< 1 day	10%	5%	
	1-7 days	25%	15%	
	> 7 days	40%	25%	[
: Was all recovery halous	IV completion done before JIV date?			No ▼
•	ne for evaporation			
i Estimated volume availab	не тог өчарогация			25 %
i Estimated volume availab  E-factor  Estimated Volume of evo				25 % 0.16 bbls

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486 JIV report S/N: 00766

# 23. GENERAL STATUS OF THE SITE

	A.	Joint investigation of the incident site found that there is no residual impact after the initial
ļ		response and JIT therefore recommend that the site be closed out
	В.	Investigation of the incident site showed that there is residual impact on site requiring further
		works <b>5</b>

### 24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:		
•	Host Community: 5	
•	Department of Petroleum Resources [DPR]:	
•	National Oil Spill Detection and Response Agency [NOSDRA]:	
•	State Ministry of Environment [SME]:	-
•	Nigeria Police Force [NPF]: 🗖	
•	Sheil Petroleum Development Company [SPDC]: 5	
•	Signatories agree with reported findings: 🗣	
•	Separate DPR form has been filled out with same findings	
	Tick	as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285486 JIV report S/N: 00766

25. Appendix 1: Overview sketch of the site

