

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1276823 2. Type of incident\* OIL SPILL  
 3. Name of Location SEIBOU WELLS - 1T AND 2L/S  
 4. Name of nearest community GBANRAUN 5. State: BAYELSA 6. LGA SOUTHERN - IJAW  
 7. Type of Production facility/Installation WELL HEAD 8. Asset owner/District SWAMP WEST / OPUKUSFH

B. INCIDENT INFORMATION:

9. Details of incident  
 a. Date of incident: 28<sup>TH</sup> OCTOBER, 2014  
 b. Start date/time of investigation: 1<sup>ST</sup> NOVEMBER, 2014 AT 1135 HRS  
 c. Investigation End date: 11<sup>TH</sup> NOVEMBER, 2014 Actual investigation duration, days: 3 DAYS  
 d. Description of spill point environment

- |  |  |  |
|--|--|--|
| <input type="checkbox"/> Firmed soil                         | <input type="checkbox"/> Loose soil        | <input type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water                         | <input checked="" type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface    |
| <input checked="" type="checkbox"/> Well Platform (on Water) |  | <input type="checkbox"/> Drill Rig               |

Additional observations around the spill point: UPON INVESTIGATION, THE JIT OBSERVED THAT THE CAMERON CONTROL UNIT ON SEIBOU WELL-1T HAS BEEN REMOVED. THE JIT ALSO OBSERVED THAT THE CAMERON CONTROL UNIT ON SEIBOU WELLS - 2L/S WERE TAMPERED WITH (WAS IN ADVANCED STAGE OF REMOVAL). THE CONTAINMENT BOOM THAT WAS DEPLOYED WAS ALSO OBSERVED TO BE TAMPERED WITH BY UNKNOWN PERSONS.

- c. Description of leak point (tick as applicable);
- |   |   |   |
|---|---|---|
| <input type="checkbox"/> Drilled hole                               | <input type="checkbox"/> Hack saw cut   | <input type="checkbox"/> Tear ( _____ ),                            |
| <input type="checkbox"/> Complete Rupture                           | <input type="checkbox"/> Inward dent,   | <input checked="" type="checkbox"/> Well head tampering             |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve,      | <input type="checkbox"/> Failed Clamp   | <input type="checkbox"/> Missing Pipeline/Flowline                  |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, |   | <input type="checkbox"/> Third party tampering with Clamp           |
| <input type="checkbox"/> Third party tampering with valve setting,  |   | <input type="checkbox"/> Third party tampering with flange,         |
| <input type="checkbox"/> Corrosión                                  | <input type="checkbox"/> Saver-pit over flow,   | <input type="checkbox"/> Surge vessel overflow,                     |
| <input type="checkbox"/> Bulging Outward                            | <input type="checkbox"/> Flare System/Bund wall failure   | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party equipment |
| impact <input type="checkbox"/> Valve Failure                       | <input type="checkbox"/> com unit failure   | <input type="checkbox"/> Cold vent                                  |
| <input type="checkbox"/> Relief valve failure                       | <input checked="" type="checkbox"/> Others (specify) <u>THEFT OF CAMERON CONTROL UNIT AT SEIBOU WELLHEAD - 1T</u> |   |

- f. Incident caused by:  
 Third party interference (Sabotage , crude theft ; Line theft ; Accidental 3<sup>rd</sup> party damage   
 Operational  Others (including Mystery spills) \_\_\_\_\_

\*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

g. Spill point coordinates

Measuring unit		MINNA (WEST - BELT)	
Northings:	(m)	Easting:	(m)
WELL-1T:	91964		387784
WELL-2L/s:	91550		384405

C. RISK ASSESSMENT

10. Type of environment:

- Land  Swamp  Water  Seasonal swamp  Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land  Swamp  Water  River (identify) \_\_\_\_\_

ii. Weather condition

- Rain  Sunny  Dry  Wet  Windy  Hot  Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [     ,m]  
 Drinking water source [ 0 ,m]  
 Built up area [     ,m]  
 Farmlands [     ,m]  
 Fish Farm/Pond [     ,m]  
 Fishing net [ 0 ,m]  
 Others (specify).

12. Containment measures put in place;

- Booms  Trench  Dyke  Natural depression  Pit  None  
 Others: \_\_\_\_\_

13. Any pictures or video coverage?  [N]

14. Further response/repair initiated as at the time of JIV? [Y]

If yes to item 14, give brief description: REPAIR IS BEING PLANNED BY THE ASSET ENGINEERING TEAM.

15. Was there any disruption to the investigation?  [N]

If yes to item 15 give brief description: THE HOST COMMUNITY REPRESENTATIVES PREVENTED THE JIV FROM CARRYING OUT ANY INVESTIGATION AT THE INCIDENT POINTS. THEIR REASONS BEING THAT THE JIV WAS INCOMPLETE, AS THERE WAS JUST A NOSDRA REP. PRESENT ON THE 1<sup>ST</sup> OF NOVEMBER, 2014. THIS WAS ADDRESSED IN SUBSEQUENT VISITS TO THE SPILL SITE ON THE 4<sup>TH</sup> & 11<sup>TH</sup> OF NOVEMBER, 2014.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.  
 JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1.	PALM TREES	4	—	—	4	
2.	STUMPS	9	—	—	9	
/						

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
1.	FISH NETS	OIL STAINED FISH NETS	5	CRUDE OIL STAINED FISH NETS
/				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF SEIBOU WELL-1T AND WELL-2L/S, SHOWING TAMPERED CCU.

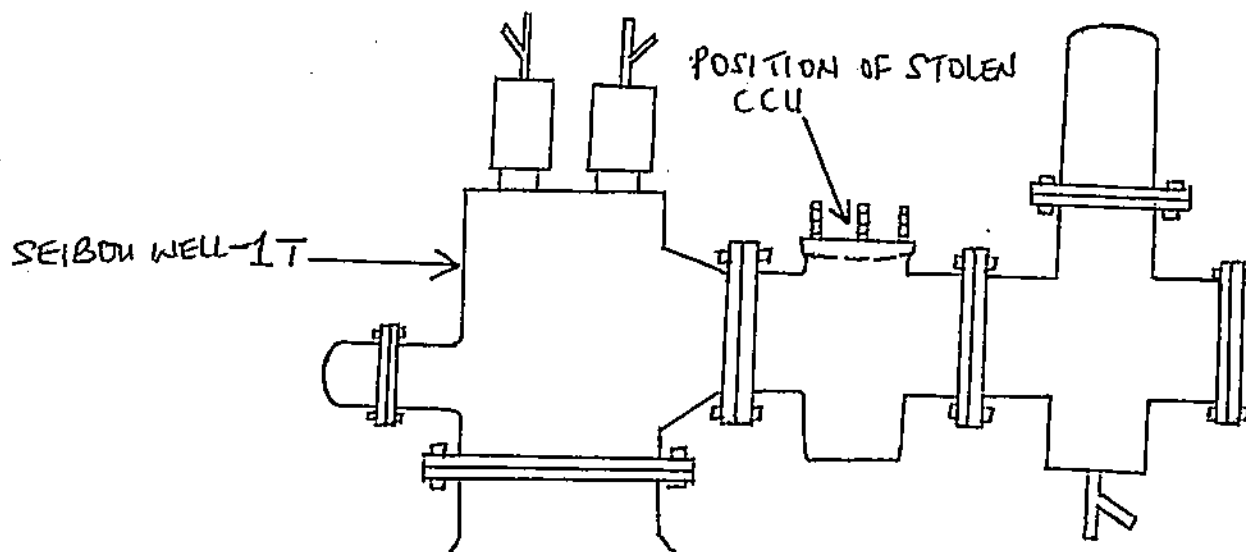


THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINWA (WEST-BELT)

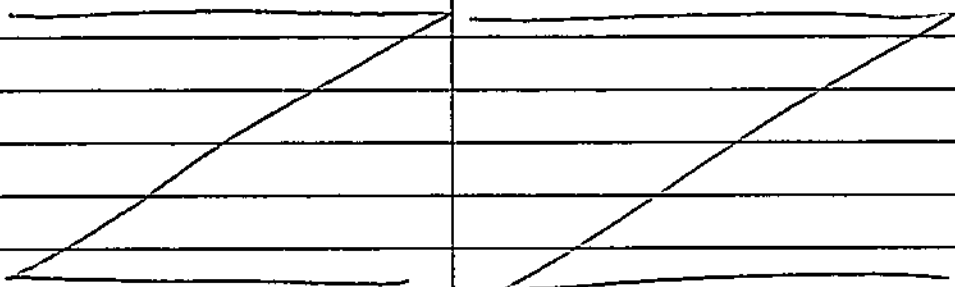S/N	Northing (m)	Easting (m)
	91904	387825
	91950	387839
	91982	387850
	92003	387848
	92026	387799
	92023	387769
	91956	387750
	91550	387440
	91565	387410 - Boom
	91554	387383
	91526	387405
	91484	387447
	91468	387457
	91469	387486
	91538	387547
	91519	387484
	91517	387496
	91559	387582
	91581	387558
		

**ESTIMATION OF OIL SPILL VOLUME**

**A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)**

Impacted Area Details

Total Calculated Area of Impact

8,118.00	m <sup>2</sup>
	m <sup>2</sup>
	m <sup>2</sup>

i Impact within SPDC R.O.W

ii Impact outside SPDC R.O.W

**1 Volume of oil recovered before completion of JIV (V<sub>rec</sub>)**

i Estimated Recovered oil (Net)

0.00	bbbls
------	-------

Estimated Recovered oil (Net) V <sub>rec</sub>	0.00 bbbls
--	------------

**2 Computation of estimated residual volume on site**

**a Computation of volume of free phase oil (on land or confined water body)**

i Total area occupied by pool of free phase oil

3,543.00	m <sup>2</sup>
----------	----------------

ii Average depth of pool of free phase oil

0.002	m
-------	---

iii Emulsification factor (If applicable, else 0%)

30	%
----	---

Estimated Volume of pool of free phase oil, V<sub>pool</sub>

4.96	m <sup>3</sup>
------	----------------

Estimated Volume of pool of free phase oil, V <sub>pool</sub>	31.20 bbbls
---	-------------

**b Computation of estimated volume of infiltrated oil in the soil (V<sub>inf</sub>)**

**1 Volume of infiltrated oil at spill point (V<sub>inf a</sub>)**

i Total area covered by the oil (infiltration)

	m <sup>2</sup>
--	----------------

ii Average depth of infiltration above leaking facility i.e. pipeline/flowline

	m
--	---

iii Soil type

Laterite	▼
----------	---

iv P<sub>e</sub> (effective porosity of the soil)

20	%
----	---

v Cause of spill

Third party interference	▼
--------------------------	---

**vi Calculation of days for infiltration below the leaking point on pipeline or flowline**

Incident Date	JIV Date	Days on Site
10/28/2014 13:40	11/11/2014 14:45	14
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

*Infiltration of oil types in various soil types vs time.*

Oil type	Approximate time to reach 1m depth below ground level		
	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

vii Oil type

Bonny Medium	▼
--------------	---

viii Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.013	m
-------	---

ix Total depth below ground surface of infiltration of oil

0.013	m
-------	---

Estimated Volume of infiltrated oil, V<sub>inf a</sub>

0.00	m <sup>3</sup>
------	----------------

Estimated Volume of infiltrated oil, V <sub>inf a</sub>	0.00 bbbls
---	------------

**2 Volume of infiltrated oil at second spill point (if applicable) (V<sub>inf b</sub>)**

i Total area covered by the oil (infiltration)

	m <sup>2</sup>
--	----------------

ii Average depth of infiltration above leaking facility i.e. pipeline/flowline

	m
--	---

iii Soil type

Laterite	▼
----------	---

iv P<sub>e</sub> (effective porosity of the soil)

20	%
----	---

v Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.013	m
-------	---

vi Total depth below ground surface of infiltration of oil 0.013 m

Estimated Volume of infiltrated oil,  $V_{inf b}$  0.00 m<sup>3</sup>

Estimated Volume of infiltrated oil,  $V_{inf b}$  0.00 bbls

**3 Volume of infiltrated oil outside immediate spill point(s) region ( $V_{inf c}$ )**

i Total Area covered by the oil (infiltration) m<sup>2</sup>

ii Total Area of the pool of free phase oil in touch with soil m<sup>2</sup>

iii Soil type Laterite

iv  $P_e$  (effective porosity of the soil) 20%

v Average depth below ground surface of infiltration of oil 0.013 m

Estimated Volume of infiltrated oil,  $V_{inf c}$  0.00 m<sup>3</sup>

Estimated Volume of infiltrated oil,  $V_{inf c}$  0.00 bbls

**4 Volume of infiltrated oil outside immediate spill point(s) region (superficial impact,  $V_{inf d}$ )**

i Total Area covered by the oil (infiltration) m<sup>2</sup>

ii Total Area of the pool of free phase oil in touch with soil m<sup>2</sup>

iii Average depth below ground surface of infiltration of oil 0.004 m

Estimated Volume of infiltrated oil,  $V_{inf d}$  0.00 m<sup>3</sup>

Estimated Volume of infiltrated oil,  $V_{inf d}$  0.00 bbls

Estimated Total Volume of infiltrated oil,  $V_{inf}$  0.00 m<sup>3</sup>

Estimated Total Volume of infiltrated oil,  $V_{inf}$  0.00 bbls

**c Computation of volume of oil on open water based on standard coloration**

i Total area of oil on open water 4,575.00 m<sup>2</sup>

ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual Aid](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage (%)	Volume (m3)
Barely Visible	0.00004		0.0000
Silvery	0.00008	15%	0.0001
Slight Color	0.00015		0.0000
Bright Color	0.0003	5%	0.0001
Oil	0.001	5%	0.0002
Dark	0.002		0.0000
Black oil	0.1	30%	0.1373
Emulsion (30% Oil)	1	45%	0.8176
Percent Total:		100%	0.7552

Estimated Volume of oil on open water,  $V_{wat}$  0.76 m<sup>3</sup>

Estimated Volume of oil on open water,  $V_{wat}$  4.75 bbls

**3 Calculation of evaporated volume**

Evaporation Factors (E-Factor) for SPDC Crude oil		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

i Was oil recovery before JIV completion done before JIV date?

No

JOINT INVESTIGATION REPORT SPILL VOLUME ESTIMATE FOR INCIDENT NO: 1276823

ii Estimated volume available for evaporation

bbls

iii E-factor

%

Estimated Volume of evaporated oil,  $V_{evap}$  11.98 bbls

**Net Total Estimated Spilled Volume,  $V_{Est}$  47.93 bbls**

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.8118 Ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV ( $V_{rec}$ ):

Recovered oil: $V_{rec}$	<u>NIL</u>	Barrels
--------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

22. <u>Net Estimated Spilled Volume <math>V_{est}</math> (bbbls) =</u>	<u>47.93 BBLS</u>
<u>Estimated Reported Volume** <math>V_{rep}</math> (bbbls) =</u>	<u>48 BBLS</u>

\*Notes:

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $m^3$  to barrels is Volume ( $m^3$ ) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl  
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl  
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.



THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 JIV report S/N: 00680

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

*Tick as applicable*

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1276823 IIV report S/N: 00680

25. Appendix 1: Overview sketch of the site

