THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED. JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1247286 JIV report S/N: 00710 (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: I. Spill incident Number: 1247286 2. Type of incident* [] 1 ROMU RONNY PIPELINE 4. Name of nearest community BODO-CITY 5. State: RIVERS 6. LGA GOKANA 7. Type of Production facility/Installation DIL PIPELINE 8. Asset owner/District PIPELINE **B. INCIDENT INFORMATION:** 9. Details of incident TH SEPTEMBER, 2014 SEPTEMBER, 2014/14:20 Hours b. Start date/time of investigation: 12 TH Actual investigation duration, days: <u>ONE(1)</u> DAY c. Investigation End date: d. Description of spill point environment Recently excavated area Loose soil ☐Firmed soil Swampy Exposed pipe surface Under water Drill Rig ☐ Well Platform (on Water) BUNDWALL WAS OBSERVED Additional observations around the spill point: A BUNDWALL WAS OBSERVED AROUND THE BUBBLING SPILL POINT ON JOINT INVESTIGATION TEAM'S ARRIVAL AT SITE. ON EXPOSURE, CRUDE OIL LEAK WAS NOTICED FROM A HOSE TIED TO THE 6" PIPE ELBOW WITH A CLOTH PIECE. IMPACTED SOIL IS DARK BROWN CLAY WITH ORGANIC MATTER e. Description of leak point (tick as applicable); Hack saw cut ☐ Tear (Drilled hole ☐ Well head tampering Complete Rupture ☐Inward dent, ☐Failed Weld-on illegal hot tap valve, ☐Failed Clamp ☐Missing Pipeline/Flowline ☐ Third party tampering with Clamp Crude oil theft (illegal bunkering) point, ☐ Third party tampering with flange, Third party tampering with valve setting, ☐Surge vessel overflow, ☐Saver-pit over flow, Corrosión □Flare System/Bund wall failure □Accidental 3rd party equipment Bulging Outward Cold vent Com unit failure ☐Valve Failure impact Relief valve failure Others (specify) f. Incident caused by:

Third party interference (Sabotage□; crude theft , Line theft□; Accidental 3rd party damage□)

Others (including Mystery spills)_

Operational

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

OINT INVESTIGATION REPORT FOR INCIDENT NO:	247286 JIV report S/N: 00710
g. Spill point coordinates Measuring unit MINU	A MID BELT
Northing:	Easting:
63302,10m	532340.28m
C. RISK ASSESSMENT	
10. Type of environment:	
□Land □Swamp □Water	☐ Seasonal swamp☐ Shoreline/Waterfront
 Type of environment to which oil has sp 	read:
□Land □Swamp □Water	River (identify)
ii. Weather condition	
☐Rain ☐Sunny ☐Dry 11. Distance from the nearest sensitive habitat	□Wet □Windy □Hot □cool
☐ Government reserved and designated protect ☐ Drinking water source ☐ Built up area ☐ Farmlands ☐ Fish Farm/Pond ☐ Fishing net ✔ Others (specify). MANG-ROVE V	[,m] [,m] [,m] [,m]
12. Containment measures put in place;	
Booms Trench Dyke Others: BUND WALLS	□Natural depression
13. Any pictures or video coverage?	[и] 💯
14. Further response/repair initiated as at the time of	fJIV? [Y] [NV
If yes to item 14, give brief description:) L LC A D L E
NOT ATT	LICABLE
15. Was there any disruption to the investigation?	[A] [A]
If yes to item 15 give brief description:	LICABLE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1247 286 JIV report S/N: 00710

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N Type of Structures	Description	Size	Number		Comments
MONIE 1	17-11-	Λ	A		1.704
TUNE	Λ H	N 1.	K L A	01	MYACT
17. Crops/Economic Tre		<u> </u>		<u> </u>	

S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONE	WITHI	NA	REA	OF IM	PACT


18. Fish/Nets/Ponds

S/N Fis	sh/Nets/Ponds	Description	Quantity/Size	Comments	
NC	NE V	VITHIN A	REA	OF	MPACT

19. Others (Specify) i.e. Animal Traps

S/N Others	Description	Quantity/Size	Comments	
NONE	WITHIN	AREA	OF_	IMPA CT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

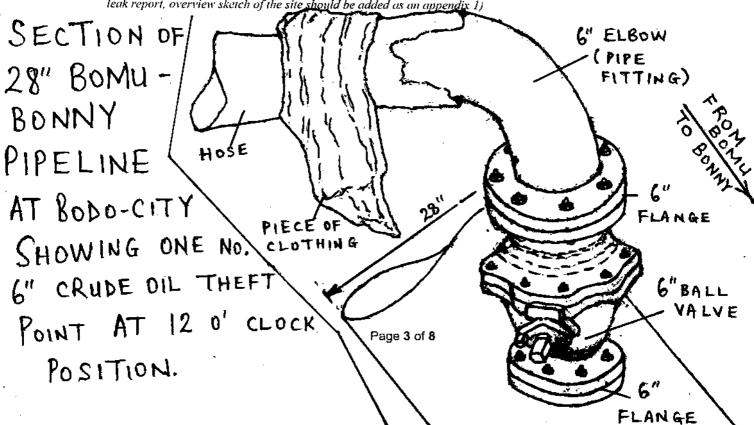

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 12 47286 JIV report S/N: 00710

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION 20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

20.	Impacted area boundary Coordinates (If ma	rre, Print and attach as an appendix)
S/N	Northing	Easting
١,	63332,88m	532303.35m
	(3337,76	532336.63m
2	63324.53m	532354.89m
4	63307,86m	5.32351.71m
4	63288.55m	532348.27m
6	63292 89m	532337.19m
7	63292.94m	532324.86m
	0)~1 ~ 1 ~ 1 ~ 1	7
	V V	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1247286 JIV report S/N: 00710

G. INCIE)ENT	INF	ORM	ATI	ON:
----------	------	-----	-----	-----	-----

20.	Im	pacte	d A	rea	Deta	ails

•	Tota	i calculated	area of impact	<u>.0.16</u>	<u>Ha.</u>			
•			PDC R.O.W_		YES.			_
•	lmpa	ct outside S	SPDC R.O.W		YES	<u>-</u>		
21. Volume	of oil	recovered	before compl	letion of JIV	(V _{recJ}):			
	Γ.		Re	covered oil V	rec].	MII		Barrels
Controlled	recov	ery/evacu	ation from so	urce with no	impact to	environmen	ıt:	
			พบ	Barrels	1			

22: Net Estimated Spilled Volume V _{Fut} ()		394	55		
Estimated Reported Volume** V _{rep} (bbls)**	3	95 B	ARREL!	S	

*Notes:

Volume estimation was done using an excel based tool (see attached for details on the calculation)

Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

• Any spill volume in excess of 1 bbl is rounded up to the next whole number.

Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ------ Reported volume = 0.4 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

3 Volume of infiltrated oil outside immediate spill point(s) region (V_{infe})

ESTIMATION OF OIL SPILL VOLUME

	FFSHORE (Leak stopped at	source)		
Impacted Area Details				
Total Calculated Area of In	rpact			1,624.00 m ²
i Impact within SPDC R.O.W				m ²
ii Impact outside SPDC R.O.VI	<i>'</i>			m²
Volume of oil recovered before	completion of JIV (V)			
Estimated Recovered oil (Ne				bbls
, Espiriding Necoseted (in five				L
Estimated Recovered oil (N	let) V _{rocJ}			0.00 bbls
Computation of estimated resid	ual volume on site			
	free phase oil (on land or confined	water body)		
i Total area occupied by pool	•			342.00 m ²
ii Average depth of pool of free	•			0.136 m
	applicable, else 0%)			0 %
in minimum in the control of the	application, each of the			
Estimated Volume of pool				48.51 m³
Estimated Volume of pool	of free phase oll, V _{pool}			292.56 bbis
b Computation of estimated	volume of infiltrated oil in the soil	(V)		
Volume of infiltrated oil at:		1 - MT/		
i Total area covered by the oil				2.00 m ²
•	'	dian		2.750 m
	above leaking facility i.e. pipeline/flow	ліпе		
iii Soil type iv P _e (effective porosity of the s	OII)			Clay Ψ
ly retenedate porosity of the s	Oil)			8 %
v Cause of spill				Third party interference
vi Calculation of days for in	filtration below the leaking point on p	ipeline or flowline		
incident Date	JIV Date	Days on Site		
9/9/2014 11:30	9/12/2014 15:55	3		
	tional, use 1 week as worst case	3		
	re 'days on site' exceeds 7.	7		
	Infiltration of all types in various soil t	vnes vs time	-	7
Soil type	Approximate time to reach		nd level	1
Oil type	Sand	Loam	Clay	╡
Bonny Medium	3 weeks	3 years	> 10 years	-1
Bonny Light	2 days	2 months	> 10 years	<u> </u>
vii Oil type		W		Borny Light
viii Average depth of infitiation i	below leaking facility i.e. pipeline/flow	nin e		0.001 m
ix Total depth below ground su	rface of infiltration of oil			2.751 m
		•		0.44 m³
Estimated Volume of infiltr Estimated Volume of infiltr				
Esumated Youthe of Inhio	aceu on, e _{kd s}			2.77 bbis
2 Volume of inflitrated oil at :	second spili point (if applicable) (V	(meb)		
i Total area covered by the oil	(infiltration)			m ²
ii Average depth of infiltration a	above leaking facility i.e. pipeline/flow	/line		m
ili <u>Soil type</u>				- Select - ▼
iv P. (effective porosity of the s	oif)			0 %
v Average depth of infiltration I	below leaking facility i.e. pipeline/flow	line		0.000 m
vi Total depth below ground su	rface of infiltration of oil			0.000 m
Estimated Volume of Inflite	ated oll, V _{ers}			0.00 m ³
Estimated Volume of infiltr				0.00 bbis
Esqueren Animus or Hugh	acou un, Flafb			0.00 0015

JOINT INVESTIGATION REPORT SPILL VOLUME ESTIMATE FOR INCIDENT NO: 1247286

Total Area covered by the Total Area of the pool of fro				1,282.00 m ²
	ee phase oil in touch with soil			120.00 m ²
Soil type	are prince on in today with our			Clay ♥
P _e (effective porosity of the	soil)			8 %
Average depth below grou	nd surface of infiltration of oil			0.001 m
Estimated Volume of Infl	" '			0.09 m³
Estimated Volume of infi	ttrated oil, V _{ird c}			0.58 bbls
Estimated Total Volume	of Infiltrated oil, V _{kd}			0.53 m³
Estimated Total Volume	of infiltrated oil, V _{kd}			3.35 bb/s
Total area of oil on open w	of oil on open water based on standa rater oil on water based on coloration	Link to Coverage Visual		m²
Spill Factors from USGG FOG	(2000 Edition)	Aid		•
	Thickness (mm)	Percentage coverage (%)	Volume (m3)	
Barely Visible	0.00004		0.0000	
Silvery	0.00008	•	0.0000	
Slight Color	0.00015		0.0000	
Bright Color	0,0003		0.0000	
Du!l	0.001		0.0000	
Dark	0.002		0.0000	
Black oil	0.1		0.0000	
Emulsion (30% Oil)	1		0.0000	
	Percent Total:	0%	0.0000	
	on onen water V			0.00 m ³
Estimated Volume of oil				
Estimated Volume of oil of Estimated Volume of oil o			·	0.00 bbls
Estimated Volume of oil ulation of evaporated volume	on open water, V _{wat}	SPOC Crusto oli		0.00 bbis
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} uma Evaporation Factors (E-Factor) for S		, , , , , , , , , , , , , , , , , , ,	0.00 bbis
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat}	Oil ty	`	0.00 bbls
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} <u>uma</u> Evaporation Factors (E-Factor) for Second spilled oil (days on site)	Oil ty Bonny Light	Bonny Medium	0.00 bbls
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} uma Evaporation Factors (E-Factor) for Set of spilled oil (days on site) < 1 day	Oil ty Banny Light 10%	Bonny Medium 5%	0.00 bbls
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} uma Evaporation Factors (E-Factor) for S e of spilled oil (days on site) <1 day 1-7 days	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	0.00 bbls
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} uma Evaporation Factors (E-Factor) for Set of spilled oil (days on site) < 1 day	Oil ty Banny Light 10%	Bonny Medium 5%	0.00 bbls
Estimated Volume of oil outside of oil outside of evaporated volume of e	on open water, V _{wat} uma Evaporation Factors (E-Factor) for S of spilled oil (days on site) <1 day 1-7 days >7 days	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	- <u></u>
Estimated Volume of oil outside of oil outside of evaporated volume of e	uma Evaporation Factors (E-Factor) for S of spilled oil (days on site) <1 day 1-7 days > 7 days V completion done before JIV date?	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	0.00 bb/s No 295.91 bb/s
Estimated Volume of oil ulation of evaporated volume Residence time Was oil recovery before Jl	uma Evaporation Factors (E-Factor) for S of spilled oil (days on site) <1 day 1-7 days > 7 days V completion done before JIV date?	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	No
Estimated Volume of oil ulation of evaporated volume Residence time Was oil recovery before Jl Estimated volume available	with the second control of the second contro	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	No bbls
Estimated Volume of oil ulation of evaporated volume Residence time Residence time Was oil recovery before JI Estimated volume available	with the second control of the second contro	Oil ty Banny Light 10% 25%	Bonny Medium 5% 15%	No 295.91 bbls 25 %

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1247286 JIV report S/N: 00710

23. GENERAL STATUS OF THE SITE

Α.	. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

24. REPRESENTATIVES

This report was filled, agreed	l and signed by the	following joint in	vestigation	rcpresentati	ives
--------------------------------	---------------------	--------------------	-------------	--------------	------

- Host Community:

 ✓
- Department of Petroleum Resources [DPR]: □
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings□

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1247286 JIV report S/N: 00/10

25. Appendix 1: Overview sketch of the site

