

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2859715 JIV report S/N: 0000753

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

## A. GENERAL INFORMATION:

1. Fountain Incident Number: 2859715 2. Type of incident\* OIL SPILL  
3. Name of Location 20<sup>m</sup> KOLOCREEK - RUMUEKPE PIPELINE  
4. Name of nearest community ODAU (km9) 5. State: RIVERS 6. LGA ABUA/ODUAL  
7. Production Facility/Installation OIL PIPELINE  
8. Asset Owner/Hub THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED (SPDC)/PIPELINE

## B. INCIDENT INFORMATION:

9. Details of incident:  
a. Date Reported: 13<sup>TH</sup> FEBRUARY, 2021  
b. Start date/time of Investigation: 15<sup>TH</sup> FEBRUARY, 2021 / 1200HRS  
c. Investigation End date: 15<sup>TH</sup> FEBRUARY, 2021 Day(s) on site: ONE (1) DAY  
d. Description of spill point environment  
 Firm soil  Loose soil  Recently excavated area  
 Under water  Swampy  Exposed pipe surface  
 Well Platform (on water)  Drill Rig  Sand bag(s)

Additional observations around the spill point: THE JOINT INVESTIGATION TEAM OBSERVED A PREVIOUSLY INSTALLED CLAMP.

## e. Description of leak point (tick as applicable);

- |  |   |  |
|--|---|--|
| <input type="checkbox"/> Smooth round-edge hole                                | <input type="checkbox"/> Rough-edge hole      | <input type="checkbox"/> Hack saw cut                                      |
| <input type="checkbox"/> Complete Rupture                                      | <input type="checkbox"/> Inward dent,         | <input type="checkbox"/> Well head tampering                               |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve                  | <input type="checkbox"/> Failed Clamp,        | <input type="checkbox"/> Missing Pipeline/Flowline                         |
| <input checked="" type="checkbox"/> Crude oil theft (illegal bunkering) point, | <input type="checkbox"/> Saver-pit over flow  | <input type="checkbox"/> Third party tampering with Clamp                  |
| <input type="checkbox"/> Third party tampering with valve setting              | <input type="checkbox"/> Bulging Outward      | <input type="checkbox"/> Third party tampering with flange,                |
| <input type="checkbox"/> Flare System/Bund wall failure                        | <input type="checkbox"/> Cold vent            | <input type="checkbox"/> Surge vessel overflow,                            |
| <input type="checkbox"/> Valve Failure   | <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party equipment impact |
| <input type="checkbox"/> Tear (_____)  |   |  |
| <input type="checkbox"/> Others (specify) _____                                |   |  |

## f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3<sup>rd</sup> party damage   
 Operational  Others (including Mystery spills) \_\_\_\_\_

\*This can be: (a) Oil Spill (b) Drilling fluid/Chemical (c) Siltation (d) Water Leak (e) Fire (f) Non-leaking theft point removal

Version 2020/01

Distribution of copies: White (Asset Owner); Pink (DPR); Green (NOSDRA); Yellow (State Ministry of Environment); Blue (Host Community)

# JOINT INVESTIGATION REPORT

000753

INCIDENT NO: 2859715 JIV report S/N:

g. Spill Point Coordinates (\*Incidents  $\leq 100m$  apart to be aggregated into one Joint Investigation Report)

h. Measuring unit

WGS 84

Northing:	Easting:
SP1 = 4.928891	6.440946
SP2 = 4.928881	6.440914 (Non-Leaking)

## C. RISK ASSESSMENT

### 10. Details of Environment

i. Type of environment where spill occurred (select one):

- Land     
  Swamp     
  Water     
  Seasonal swamp     
  Shoreline/Waterfront

ii. Type of environment to which oil has spread:

- Land     
  Swamp     
  Waterbody (specify) \_\_\_\_\_

iii. Weather condition

- Dry     
  Wet     
  Windy     
  Hot

### 11. Distance to Sensitive habitat within 100m radius

- |   |            |
|---|------------|
| <input type="checkbox"/> Government reserved and designated protected area                    | [      ,m] |
| <input type="checkbox"/> Drinking water source  | [      ,m] |
| <input type="checkbox"/> Surface water <input type="checkbox"/> Borehole                      |            |
| <input type="checkbox"/> Built up Area  | [      ,m] |
| <input type="checkbox"/> Residential Area <input type="checkbox"/> Commercial/Industrial Area |            |
| <input type="checkbox"/> Farmlands  | [      ,m] |
| <input type="checkbox"/> Fish Farm/Pond   | [      ,m] |
| <input type="checkbox"/> Fishing net  | [      ,m] |
| <input type="checkbox"/> Others (specify) _____   | [      ,m] |

} NONE SEEN  
WITHIN  
VICINITY

### 12. Containment measures put in place:

- Booms   
  Trench   
  Dyke   
  Pit   
  Natural depression   
  None

Others: \_\_\_\_\_

13. Any pictures or video coverage?

[N]

14. Further response/repair initiated as at the time of JIV?

[N]

If yes to item 14, give brief description:

CRUDE OIL RECOVERY AND REPAIR ACTIVITIES ONGOING

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2859715 JIV report S/N: 0000753

15. Was there any disruption to the investigation? [Y]

If yes to item 15 give brief description:

NOT APPLICABLE

16. Was JIV delayed? [Y]

Reason(s): NOT APPLICABLE

- Delayed Community Access Approval     Security Challenges     Access constraint due to terrain  
 Others (specify) \_\_\_\_\_

**D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL**

17. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

18. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						

19. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

20. Others (Specify) e.g. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

**E. GRAPHIC DESCRIPTION OF LEAK POINT** (while detailed description of the leak point should be contained in the leak report, overview sketch of the site should be added as appendix 1)

A SECTION OF 20" KOLOCREEK-RUMUEKPE PIPELINE AT ODAU (km 9) SHOWING A 4" VALVE WITH A CONCRETE CAST AND A NON-LEAKING 4" VALVE OF 5.2 METRES APART INSTALLED AT 12 O'CLOCK POSITION BY UNKNOWN PERSONS ALONGSIDE A PREVIOUSLY INSTALLED CLAMP.

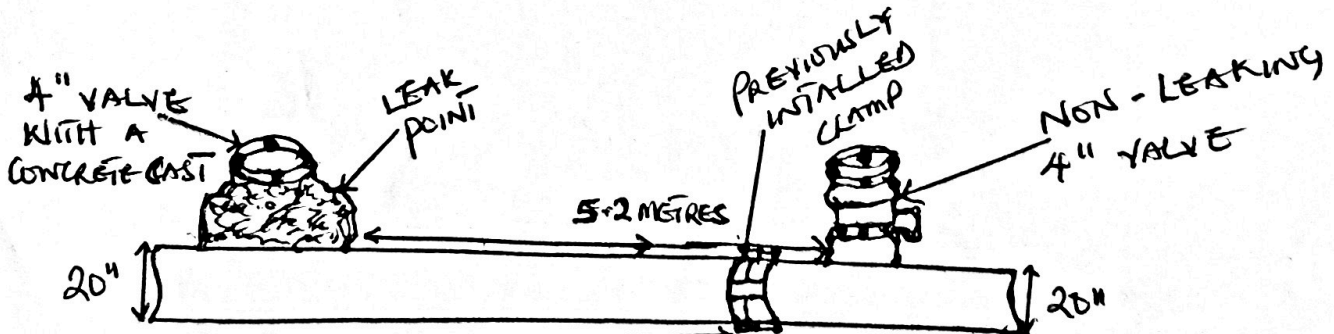

FROM KOLOCREEK-RUMUEKPE PIPELINE version 2020/01





# JOINT INVESTIGATION REPORT

INCIDENT NO: 2859715 JIV report S/N: 0000753

**G. INCIDENT INFORMATION:**

**a. Impacted Area Details \***

- Total calculated area of impact (Ha) 0.24ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

\* Round off to 2 decimal places if area is  $\geq 100 \text{ m}^2$  or to 4 decimal places if area is  $< 100 \text{ m}^2$  (e.g. 14.55, 0.0051, 0.0009)  
 \* Express in Hectares (Ha)

**b. Volume of oil recovered before completion of JIV ( $V_{\text{rec}}$ ):**

Recovered oil $V_{\text{rec}}$	18	Barrels
--------------------------------	----	---------

Controlled recovery/evacuation from source with no impact to environment:

NIL	Barrels
-----	---------


**c. Net Estimated Spilled Volume  $V_{\text{Est}}$ (bbls)\* = 462.97 BARRELS**

**Estimated Reported Volume\*\*  $V_{\text{rep}}$ (bbls) = 463 BARRELS**

**\*Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for volume estimation or cause of spill:

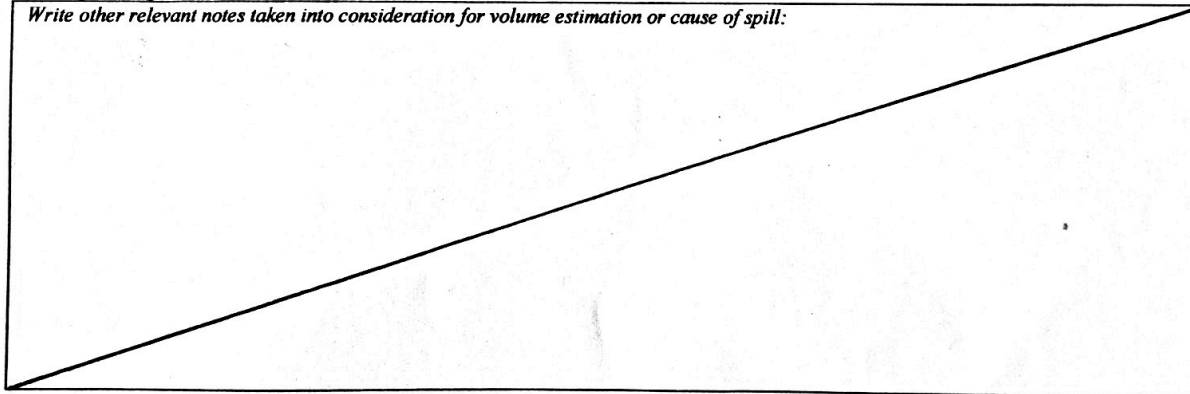

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of  $\text{m}^3$  to barrels is  $\text{Volume (m}^3) \times 6.29$ ; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ——— Reported volume = 16 bbl  
 Calculated volume = 0.35 bbl ——— Reported volume = 0.4 bbl  
 Calculated volume = 0.01 bbl ——— Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2859715 JIV report S/N: 000753

## d. General Status of the site

- i. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out
- ii. Investigation of the incident site showed that there is residual impact on site requiring further works

## e. Representatives

This report was filled, agreed and signed by the following joint investigation team representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- The Shell Petroleum Development Company [SPDC]:
- *Separate DPR form has been filled out with same findings*
- *Separate NOSDRA form has been filled out with same findings*
- *Separate SME form has been filled out with same findings*


*Tick as applicable*

Version 2020/01

# JOINT INVESTIGATION REPORT

INCIDENT NO: 2859715 JIV report S/N: 0000753

## f. Appendix 1: Overview sketch of the site

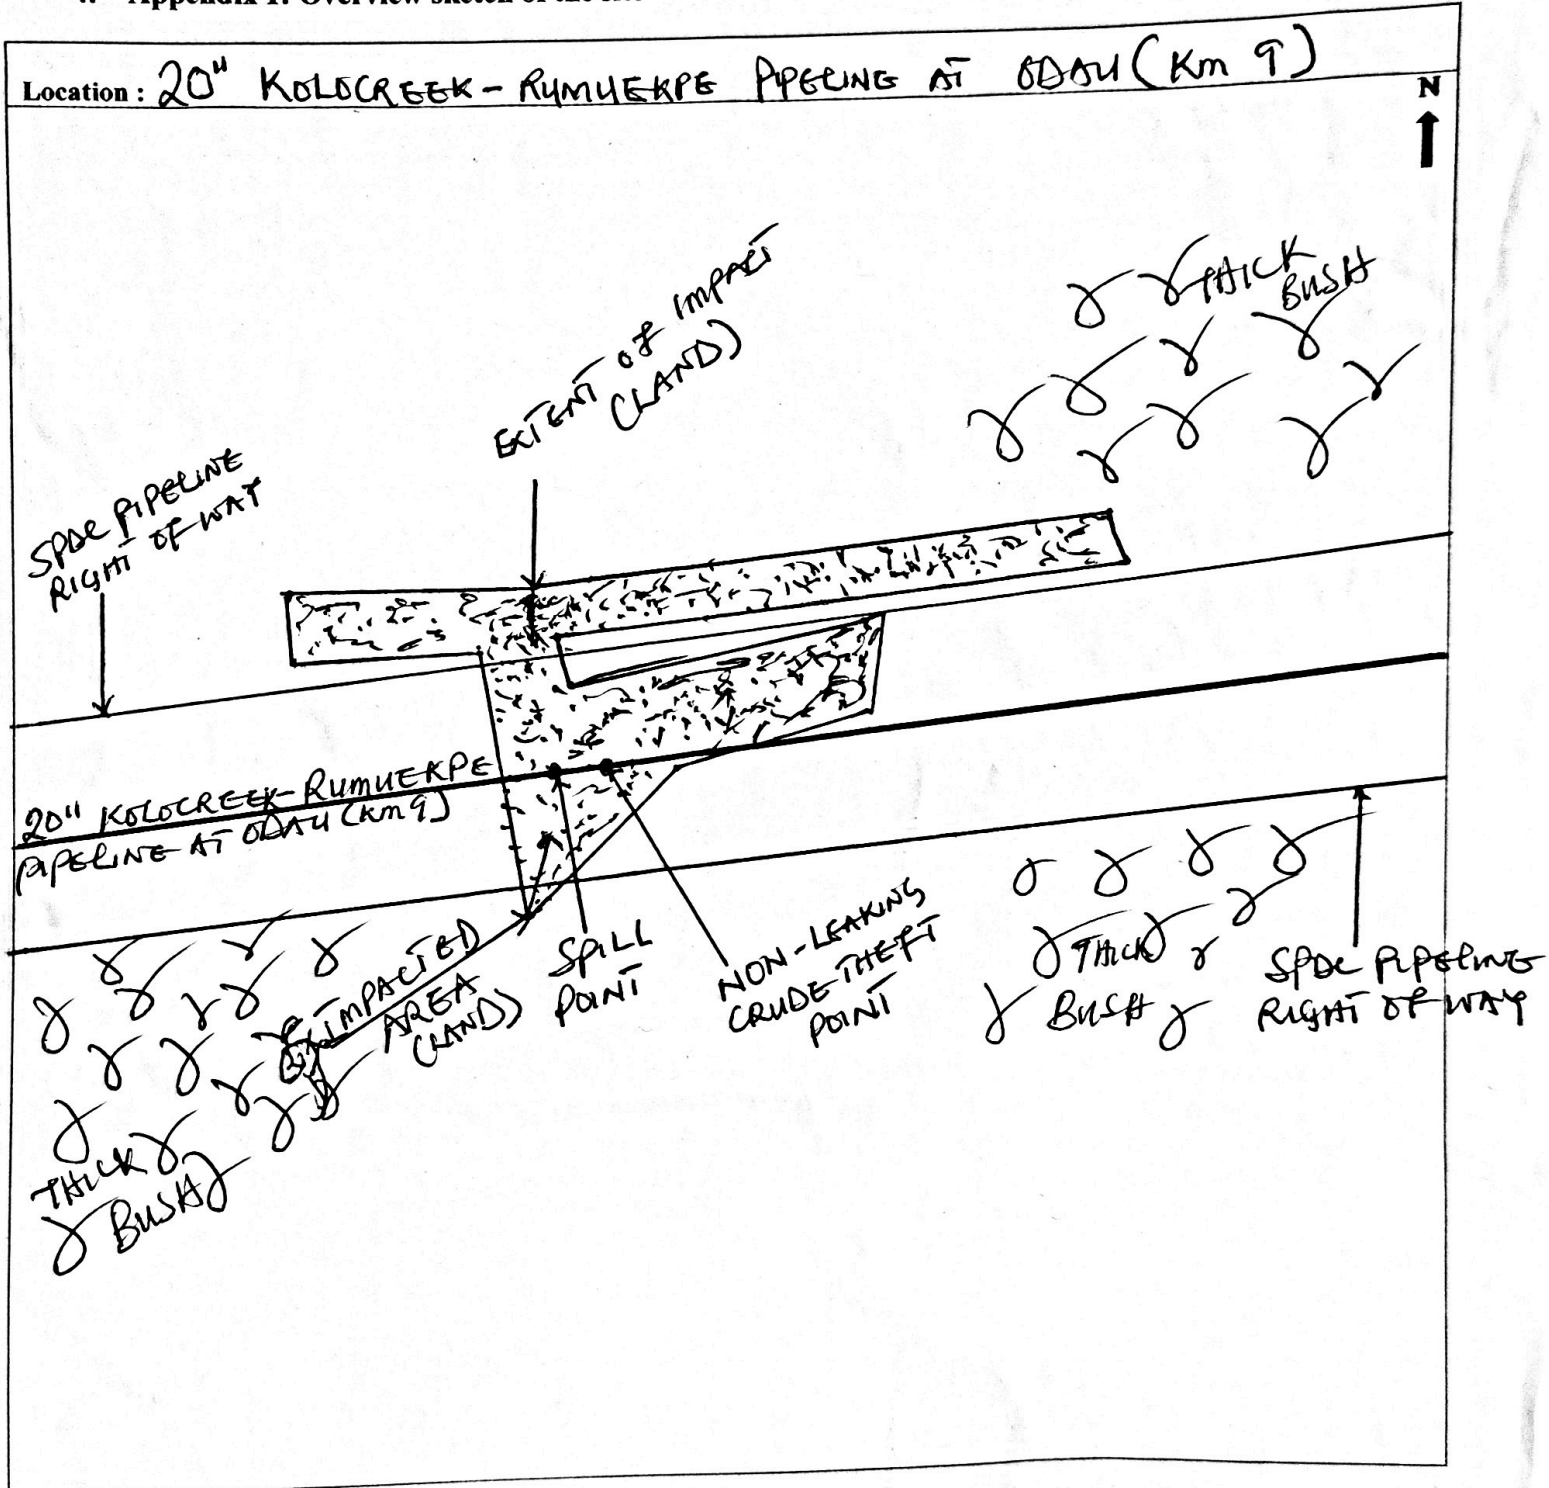

Version 2020/01

Distribution of copies: White (Asset Owner); Pink (DPR); Green (NOSDRA); Yellow (State Ministry of Environment);  
Blue (Host Community)