

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: 00764

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1285765 2. Type of incident* OIL SPILL
 3. Name of Location 12" IMO RIVER 2 - OGMLE PIPELINE
 4. Name of nearest community OWAZA 5. State: ABIA 6. LGA UKWA WEST
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident
 a. Date of incident: 12TH NOVEMBER, 2014
 b. Start date/time of investigation: 14TH NOVEMBER, 2014
 c. Investigation End date: 15TH NOVEMBER 2014 Actual investigation duration, days: TWO (2) DAYS.
 d. Description of spill point environment

- | | | |
|---|--|---|
| <input type="checkbox"/> Firmed soil | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |

Additional observations around the spill point:

- e. Description of leak point (tick as applicable);
- | | | |
|--|---|---|
| <input type="checkbox"/> Drilled hole | <input type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____). |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input checked="" type="checkbox"/> Failed Weld-on illegal hot tap valve, | <input type="checkbox"/> Failed Clamp | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input checked="" type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosion | <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 rd party equipment |
| impact | <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure |
| <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Others (specify) _____ | <input type="checkbox"/> Cold vent |

- f. Incident caused by:
- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 12857.65 JIV report S/N: 00764

g. Spill point coordinates

Measuring unit		<u>Minna Mud belt</u>	
Northing:		Easting:	
<u>108467.72</u>		<u>523691.98</u>	
<u>[Signature]</u>		<u>[Signature]</u>	

C. RISK ASSESSMENT

10. Type of environment:

- Land
 Swamp
 Water
 Seasonal swamp
 Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land
 ^{SEASONAL} Swamp
 Water
 River (identify) _____

ii. Weather condition

- Rain
 Sunny
 Dry
 Wet
 Windy
 Hot
 cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
 Drinking water source [,m]
 Built up area [,m]
 Farmlands None seen [,m]
 Fish Farm/Pond within vicinity [,m]
 Fishing net [,m]
 Others (specify). [,m]

12. Containment measures put in place;

- Booms
 Trench
 Dyke
 Natural depression
 Pit
 None
 Others: _____

13. Any pictures or video coverage? [N]

14. Further response/repair initiated as at the time of JIV? [N]

If yes to item 14, give brief description: RECOVERY ACTIVITIES ON GOING.

REPAIR WORK WAS DONE BY CLARIPALB.

15. Was there any disruption to the investigation? [Y]

If yes to item 15 give brief description:
NOT APPLICABLE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: 00764

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
None within Area of Impact					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	PALM TREE	✓	—	—	Few	IMPACT BY SPILL.
2	RAPHIA PALM	—	—	✓	Few	
3	BAMBOO TREE	—	✓	✓	Few	

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
None within Area of Impact				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
None within Area of Impact				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 12" IMO RIVER 2 - OGALÉ PIPELINE AT OHAZA SHOWING POSITION OF CRUDE OIL THREAT POINT AT 12 O'CLOCK.

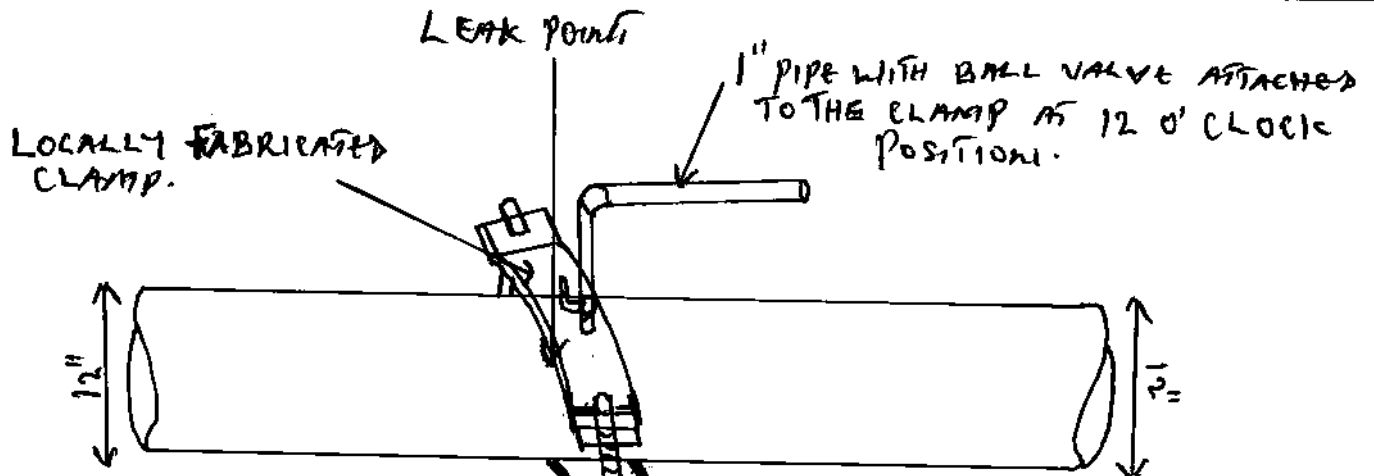

← FROM IMO RIVER 2 TO OGALÉ.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: **00764**

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION
 20. Impacted area boundary Coordinates *(If more, Print and attach on appendix)*

Minna Mid belt

S/N	Northing	Easting

attached Appendix

See Q/L

15/11/14

FD: 2014 - 1285765

COORDINATE LIST OF 12"IMO-RIVER 2-OGALE PIPELINE SPILL AT OWAZA					
MINNA MID BELT					
PTS	EASTINGS	NORTHINGS			
954	523602.81	108515.98			
955	523608.98	108519.04			
956	523615.12	108509.81			
957	523618.21	108512.88			
958	523636.67	108500.55			
959	523642.84	108506.68			
960	523655.13	108488.23			
961	523667.49	108509.71			
962	523664.44	108522			
963	523664.47	108537.36			
964	523667.57	108549.64			
965	523664.5	108552.72			
967	523661.39	108540.44			
968	523667.49	108506.63			
969	523676.73	108506.62			
970	523695.2	108500.44			
971	523698.29	108506.57			
972	523698.27	108494.29			
973	523701.32	108478.92			
975	523719.83	108491.17			
976	523793.63	108426.51			
977	523796.74	108438.79			
978	523772.08	108432.7			
979	523732.07	108451.21			
980	523716.68	108460.46			
981	523698.22	108469.71			
982	523679.76	108482.04			
9590	523639.52	108532.8			
9780	523791.21	108479.59			
9790	523746.17	108497.66			

Bl, 15/11/14

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: **00764**

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

<p>This report was filled, agreed and signed by the following joint investigation representatives:</p> <ul style="list-style-type: none">• Host Community: <input checked="" type="checkbox"/>• Department of Petroleum Resources [DPR]: <input checked="" type="checkbox"/>• National Oil Spill Detection and Response Agency [NOSDRA]: <input checked="" type="checkbox"/>• State Ministry of Environment [SME]: <input checked="" type="checkbox"/>• Nigeria Police Force [NPF]: <input checked="" type="checkbox"/>• Shell Petroleum Development Company [SPDC]: <input checked="" type="checkbox"/>• Signatories agree with reported findings: <input checked="" type="checkbox"/>• Separate DPR form has been filled out with same findings <input checked="" type="checkbox"/> <p style="text-align: right;"><i>Tick as applicable</i></p>
--

ESTIMATION OF OIL SPILL VOLUME

A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)

Impacted Area Details

Total Calculated Area of Impact 6,500.00 m²

i Impact within SPDC R.O.W m²

ii Impact outside SPDC R.O.W m²

1 Volume of oil recovered before completion of JIV (V_{rec,1})

i Estimated Recovered oil (Net) 133.00 bbls

Estimated Recovered oil (Net) V_{rec,1} 133.00 bbls

2 Computation of estimated residual volume on site

a Computation of volume of free phase oil (on land or confined water body)

i Total area occupied by pool of free phase oil 4,800.00 m²

ii Average depth of pool of free phase oil 0.006 m

iii Emulsification factor (If applicable, else 0%) 0%

Estimated Volume of pool of free phase oil, V_{pool} 28.80 m³

Estimated Volume of pool of free phase oil, V_{pool} 181.15 bbls

b Computation of estimated volume of infiltrated oil in the soil (V_{inf})

1 Volume of infiltrated oil at spill point (V_{inf,a})

i Total area covered by the oil (infiltration) 1.00 m²

ii Average depth of infiltration above leaking facility i.e. pipeline/flowline 1.200 m

iii Soil type Clay

iv P_e (effective porosity of the soil) 8%

v Cause of spill Third party interference

vi Calculation of days for infiltration below the leaking point on pipeline or flowline

Incident Date	JIV Date	Days on Site
11/12/2014 12:00	11/15/2014 11:35	3
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.			
Soil type	Approximate time to reach 1m depth below ground level		
Oil type	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

vii Oil type Bonny Medium

viii Average depth of infiltration below leaking facility i.e. pipeline/flowline 0.001 m

ix Total depth below ground surface of infiltration of oil 1.201 m

Estimated Volume of infiltrated oil, V_{inf,a} 0.10 m³

Estimated Volume of infiltrated oil, V_{inf,a} 0.60 bbls

2 Volume of infiltrated oil at second spill point [if applicable] (V_{inf,b})

i Total area covered by the oil (infiltration) m²

ii Average depth of infiltration above leaking facility i.e. pipeline/flowline m

iii Soil type - Select -

iv P_e (effective porosity of the soil) 0%

v Average depth of infiltration below leaking facility i.e. pipeline/flowline 0.000 m

vi Total depth below ground surface of infiltration of oil 0.000 m

Estimated Volume of infiltrated oil, V_{inf,b} 0.00 m³

Estimated Volume of infiltrated oil, V_{inf,b} 0.00 bbls

3 Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf,c}$)

- i Total Area covered by the oil (infiltration) 2,500.00 m²
- ii Total Area of the pool of free phase oil in touch with soil 2,800.00 m²
- iii Soil type Clay
- iv P_e (effective porosity of the soil) 8%
- v Average depth below ground surface of infiltration of oil 0.001 m

Estimated Volume of Infiltrated oil, $V_{inf,c}$	0.36 m³
Estimated Volume of Infiltrated oil, $V_{inf,c}$	2.19 bbls

4 Volume of infiltrated oil outside immediate spill point(s) region (superficial impact, $V_{inf,d}$)

- i Total Area covered by the oil (infiltration) m²
- ii Total Area of the pool of free phase oil in touch with soil m²
- iii Average depth below ground surface of infiltration of oil 0.001 m

Estimated Volume of Infiltrated oil, $V_{inf,d}$	0.00 m³
Estimated Volume of Infiltrated oil, $V_{inf,d}$	0.00 bbls

Estimated Total Volume of infiltrated oil, V_{inf}	0.44 m³
Estimated Total Volume of infiltrated oil, V_{inf}	2.80 bbls

c Computation of volume of oil on open water based on standard coloration

- i Total area of oil on open water m²
- ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual Aid](#)

Spill Factors from USCG FDG (2000 Edition)		Aid	
	Thickness (mm)	Percentage coverage (%)	Volume (m3)
<u>Barely Visible</u>	0.00004		0.0000
<u>Silvery</u>	0.00008		0.0000
<u>Slight Color</u>	0.00015		0.0000
<u>Bright Color</u>	0.0003		0.0000
<u>Dull</u>	0.001		0.0000
<u>Dark</u>	0.002		0.0000
<u>Black oil</u>	0.1		0.0000
<u>Emulsion (30% Oil)</u>	1		0.0000
Percent Total:		0%	0.0000

Estimated Volume of oil on open water, V_{wat}	0.00 m³
Estimated Volume of oil on open water, V_{wat}	0.00 bbls

3 Calculation of evaporated volume

Evaporation Factors (E-Factor) for SPDC Crude oil		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

- i Was oil recovery before JIV completion done before JIV date? Yes
- ii Estimated volume available for evaporation 183.95 bbls
- iii E-factor 15%

Estimated Volume of evaporated oil, V_{evap}	32.46 bbls
--	-------------------

Net Total Estimated Spilled Volume, V_{Est}	349.41 bbls
---	--------------------

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: 00764

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.65HA
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>133</u>	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

22. Net Estimated Spilled Volume V_{Est}(bbls)* =	<u>349.41 BARRELS</u>
Estimated Reported Volume** V_{rep}(bbls)=	<u>350 BARRELS.</u>

***Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1285765 JIV report S/N: 00764

25. Appendix 1: Overview sketch of the site

