

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 1287226 2. Type of incident* OIL SPILL
 3. Name of Location EKULAMA 2 WELL 24T FLOWLINE
 4. Name of nearest community FREETOWN (KULA) 5. State: RIVERS 6. LGA AKUKU-TORU
 7. Type of Production facility/Installation OIL FLOWLINE Asset owner/District SWAMP 2

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 13TH NOVEMBER, 2014
 b. Start date/time of investigation: 18TH NOVEMBER, 2014/11:23 HOURS; AND
5TH DECEMBER, 2014
 c. Investigation End date: 2014 Actual investigation duration, days: TWO(2) DAYS
 d. Description of spill point environment

- | | | |
|---|--|--|
| <input type="checkbox"/> Firmed soil | <input checked="" type="checkbox"/> Loose soil | <input type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input checked="" type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |

Additional observations around the spill point: ON FIRST DAY OF JOINT INVESTIGATION VISIT, BUBBLES WERE OBSERVED AT SPILL POINT ALONG A CHANNEL ON SWAMPY TERRAIN. ON EXPOSURE (BY EXCAVATION) OF AFFECTED FLOWLINE SECTION ON SECOND DAY OF JOINT INVESTIGATION VISIT, THE FLOWLINE COATING AROUND A WELDED JOINT WAS NOTICED UNTAMPERED WITH UPON REMOVAL OF THE SAID COATING BY THE JOINT INVESTIGATION TEAM TO ASCERTAIN SPILL CAUSE,

- e. Description of leak point (tick as applicable): LEAK WAS CONFIRMED DUE TO A FAILURE AT THE WELDED JOINT.
- | | | |
|---|---|--|
| <input type="checkbox"/> Drilled hole | <input type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____) |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve, | <input type="checkbox"/> Failed Clamp | <input type="checkbox"/> Missing Pipeline/Flowline |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosion | <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 rd party equipment impact |
| <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure | <input type="checkbox"/> Cold vent |
| <input type="checkbox"/> Relief valve failure | <input checked="" type="checkbox"/> Others (specify) <u>FAILED WELDED JOINT</u> | |

- f. Incident caused by:
- Third party interference (Sabotage; crude theft; Line theft; Accidental 3rd party damage)
 Operational Others (including Mystery spills) _____

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

g. Spill point coordinates

Measuring unit		<u>MINNA (MID BELT)</u>	
Northing: (m)		Easting: (m)	
<u>60934.25</u>		<u>468748.74</u>	

C. RISK ASSESSMENT

10. Type of environment:

- Land
 Swamp
 Water
 Seasonal swamp
 Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land
 Swamp
 Water
 River (identify) _____

ii. Weather condition

- Rain
 Sunny
 Dry
 Wet
 Windy
 Hot
 cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
 Drinking water source [,m]
 Built up area [,m]
 Farmlands [,m]
 Fish Farm/Pond [,m]
 Fishing net [,m]
 Others (specify) MANGROVE VEGETATION

12. Containment measures put in place;

- Booms
 Trench
 Dyke
 Natural depression
 Pit
 None
 Others: _____

13. Any pictures or video coverage? [] [N]

14. Further response/repair initiated as at the time of JIV? [] [N]

If yes to item 14, give brief description:

ABSORBENT MATERIALS (PADS) WERE DEPLOYED ON CHANNEL RUNNING ALONG SPILL POINT, DURING EXPOSURE OF SPILL POINT TO ASCERTAIN SPILL CAUSE.

15. Was there any disruption to the investigation? [] [N]

If yes to item 15 give brief description:

FIRST JOINT INVESTIGATION VISIT OF 18TH NOVEMBER 2014 WAS INCONCLUSIVE AS THE JOINT INVESTIGATION TEAM WERE UNABLE TO ASCERTAIN CAUSE OF SPILL DUE TO HIGH TIDE.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF EKULAMA 2 WELL 24T FLOWLINE AT FREETOWN (KULA) SHOWING FAILURE AT WELDED JOINT (LEAK POINT) AT 3 O' CLOCK POSITION.

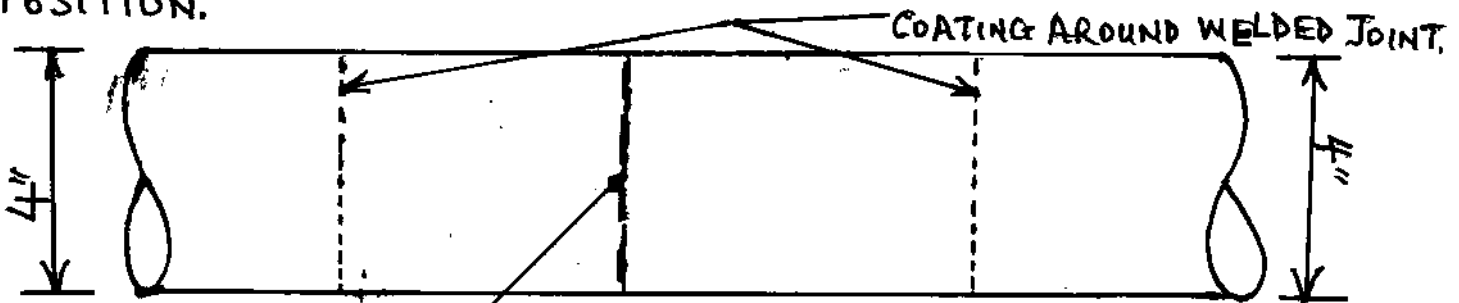

FAILED WELDED JOINT LEAK POINT AT 3 O' CLOCK POSITION.

FROM EKULAMA 2 WELL 24T TO EKULAMA 2 FLOW STATION.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA CMD BELT

S/N	Northing (m)	Easting (m)
1	60926.79	468786.21
2	60911.12	468740.50
3	60925.36	468697.73
4	60932.82	468696.41
5	60940.39	468697.73
6	60946.63	468717.47
7	60965.86	468739.97
8	60946.47	468773.72

[Handwritten signature]
05/12/2014

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.284 Hg
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>NIL</u>	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

22. Net Estimated Spilled Volume V_{Est}(bbls)* =	<u>3.64</u>
Estimated Reported Volume** V_{rep}(bbls)=	<u>4 BARRELS</u>

***Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NOT APPLICABLE

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site: Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

ESTIMATION OF OIL SPILL VOLUME

A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)

Impacted Area Details

- Total Calculated Area of Impact
- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

2,841.00	m ²
	m ²
	m ²

1 Volume of oil recovered before completion of JIV (V_{rec})

- i Estimated Recovered oil (Net)

0.00	bbts
------	------

Estimated Recovered oil (Net) V_{rec}	0.00 bbts
--	------------------

2 Computation of estimated residual volume on site

a Computation of volume of free phase oil (on land or confined water body)

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (If applicable, else 0%)

3.00	m ²
0.001	m
0	%

Estimated Volume of pool of free phase oil, V_{pool}	0.00 m³
---	---------------------------

Estimated Volume of pool of free phase oil, V_{pool}	0.02 bbts
---	------------------

b Computation of estimated volume of infiltrated oil in the soil (V_{inf})

1 Volume of infiltrated oil at spill point (V_{inf a})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

1.00	m ²
1.500	m
Clay	▼
8	%

- v Cause of spill

Operational	▼
-------------	---

vi Calculation of days for infiltration below the leaking point on pipeline or flowline

Incident Date	JIV Date	Days on Site
11/13/2014 17:00	11/18/2014 11:40	5
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.			
Oil type	Approximate time to reach 1m depth below ground level		
	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

- vii Oil type

Bonny Light	▼
-------------	---

- viii Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.002	m
-------	---

- ix Total depth below ground surface of infiltration of oil

1.502	m
-------	---

Estimated Volume of infiltrated oil, V_{inf a}	0.12 m³
---	---------------------------

Estimated Volume of infiltrated oil, V_{inf a}	0.76 bbts
---	------------------

2 Volume of infiltrated oil at second spill point [if applicable] (V_{inf b})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

	m ²
	m
- Select -	▼
0	%

- v Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.000	m
-------	---

- vi Total depth below ground surface of infiltration of oil

0.000	m
-------	---

Estimated Volume of infiltrated oil, V_{inf b}	0.00 m³
---	---------------------------

Estimated Volume of infiltrated oil, V_{inf b}	0.00 bbts
---	------------------

3 Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf c}$)

i Total Area covered by the oil (infiltration) m²

ii Total Area of the pool of free phase oil in touch with soil m²

iii Soil type

iv P_o (effective porosity of the soil) %

v Average depth below ground surface of infiltration of oil m

Estimated Volume of infiltrated oil, $V_{inf c}$ m³

Estimated Volume of infiltrated oil, $V_{inf c}$ bbls

4 Volume of infiltrated oil outside immediate spill point(s) region (superficial impact, $V_{inf d}$)

i Total Area covered by the oil (infiltration) m²

ii Total Area of the pool of free phase oil in touch with soil m²

iii Average depth below ground surface of infiltration of oil m

Estimated Volume of infiltrated oil, $V_{inf d}$ m³

Estimated Volume of infiltrated oil, $V_{inf d}$ bbls

Estimated Total Volume of infiltrated oil, V_{inf} m³

Estimated Total Volume of infiltrated oil, V_{inf} bbls

c Computation of volume of oil on open water based on standard coloration

i Total area of oil on open water m²

ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual Aid](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage (%)	Volume (m3)
Barely Visible	0.00004		0.0000
Silvery	0.00008		0.0000
Slight Color	0.00015		0.0000
Bright Color	0.0003		0.0000
Dull	0.001		0.0000
Dark	0.002		0.0000
Black oil	0.1		0.0000
Emulsion (30% Oil)	1		0.0000
Percent Total:		0%	0.0000

Estimated Volume of oil on open water, V_{wat} m³

Estimated Volume of oil on open water, V_{wat} bbls

3 Calculation of evaporated volume

Evaporation Factors (E-Factor) for SPDC Crude oil			
Residence time of spilled oil (days on site)	Oil type		
	Bonny Light	Bonny Medium	
< 1 day	10%	5%	
1-7 days	25%	15%	
> 7 days	40%	25%	

i Was oil recovery before JIV completion done before JIV date?

ii Estimated volume available for evaporation bbls

iii E-factor %

Estimated Volume of evaporated oil, V_{evap} bbls

Net Total Estimated Spilled Volume, V_{Est} bbls

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287226 JIV report S/N: 00796

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

<p>This report was filled, agreed and signed by the following joint investigation representatives:</p> <ul style="list-style-type: none">• Host Community: <input checked="" type="checkbox"/>• Department of Petroleum Resources [DPR]: <input type="checkbox"/>• National Oil Spill Detection and Response Agency [NOSDRA]: <input checked="" type="checkbox"/>• State Ministry of Environment [SME]: <input checked="" type="checkbox"/>• Nigeria Police Force [NPF]: <input type="checkbox"/>• Shell Petroleum Development Company [SPDC]: <input checked="" type="checkbox"/>• <i>Signatories agree with reported findings:</i> <input checked="" type="checkbox"/>• <i>Separate DPR form has been filled out with same findings</i> <input type="checkbox"/> <p style="text-align: right;"><i>Tick as applicable</i></p>
--

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED:

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1287216 JIV report S/N: 00796

25. Appendix 1: Overview sketch of the site

