JOINT INVESTIGATION REPO	ORT FOR INCIDENT NO	0031 702 874
(Note: As practicable as possible the JIT re	port is to be signed in the	- · · · · · · · · · · · · · · · · · · ·
A. GENERAL INFORMATION:	J ,	ey we me purpopuling purites)
1. Spill incident Number:7028	.74 2.Type o	of incident* ON SPILE
3. Name of Location 14" OKORD	A - DILAME	VOE DIRELING
	KUIVIUE	RPE PIPELINE
I. Name of nearest communityKARI	+MA_5. State: <u>BAY</u> 1	ELSA 6. LGA <u>YENAGOA</u>
7. Type of Production facility/Installation _	OIL PIPELINE 8. A	sset owner/District NESP/Kolocreek
B. INCIDENT INFORMATION:		
b. Date/Period of investigation: 25	TH AUGUST,	
c. Description of spill point environm Firmed soil		_
□ Under water		Previously excavated area
☐ Well Platform (on Water)	□ Swampy	☐ Exposed pipe surface
d. Description of leak point (tick as a	pplicable);	Rig
	Hack saw cut	☐ Explosive tear,
☐ Complete Rupture	☐ Inward dent,	☐ Well head tampering
☐ Failed Weld-on illegal hot tap v	alve,	☐ Missing Pipeline/Flowline)
☐ Crude oil theft (illegal bunkerin	g) point,	☐ Third party tampering with Clamp
☐ Third party tampering with valv	e setting,	☐ Third party tampering with flange,
□ External Corrosion	-	□ Internal Corrosion
Saver-pit over flow,	☐ Surge vessel overflow,	
☐ Flare System/Bund wall Failure	☐ Valve Failure	□ com unit failure .
□ Cold vent	☐ Relief valve failure	□ Others (specify) NoT APPLICABLE
e. Incident due to:		
Third party interference	☐ Operational	□ Others (specify NoT APPLI CABLE
f. Spill point coordinates (MIN Measuring unit M Northing:	·	asting: 445072·45

Page 1 of 9

^{*}This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0031702874

C.	RISK ASSES	SSMEN	т				
	10.	Type of	f environment:				
	√ Land	i	□ Swamp	□ Water	□ Seaso	onal swa	mp
	i.	Type of	environment to v	vhich oil has sprea	ad:		
	"Land		(SEASONA	□ Water	□ Rive	r (identii	(y) NOT APPLICABLE
	Rain	ing	Condition ☐Sunny Representative	e habitat			
	□ Drin □ Buil □ Farn □ Fish □ Fish □ Othe	iking wat t up area nlands Farm/Po ing net ers (speci	er source	ignated protected	area	[[[25 [,m] ,m] ,m] ,m] ,m]
	□ Boor	ms	□ Trench	□ Dyke			
	, 🗹 Othe	ers: N	IATURAL	DEPRESSI	ON	_	
	13. Any pict	ures or v	ideo coverage?			[Y]/	[N]
	14. Was ther	e any dis	sruption to the in	vestigation?		[Y]	[N]
If y	res give brief d	escription	n:	APF		16	ABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

NONE XILTURA OF INJONG	S/N	Type of Structures	Description	Size	Number	Comments
TYVIAL WITHIN AKEA OF HATAL	H	ONE V	ATHI	N AF	EA OF	IMPACT

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0031 702874

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	PALM		/		5	FREE STAND
	TREES					ING TREES
<u> </u>						IMPACTED
		<u> </u>				

17. Fish/Nets/Ponds


S/N	Fish/Nets/F	onds	Description		Quantity/	Size	Comments
M)NE	TIW	HIM /	ARE A	OF		IPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others		Description	1	Quantity/Size	Comments
4		—		4		
	771	<u> </u>		$\Delta D \Box I$		TO A GIL
		<u> </u>	ITIIV			MITAL
]

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix 1)

SECTION OF 14" OKORDIA - RUMUEKPE PIPELINE AT IKARAMA SHOWING POSITION OF HACKSAW CUT.

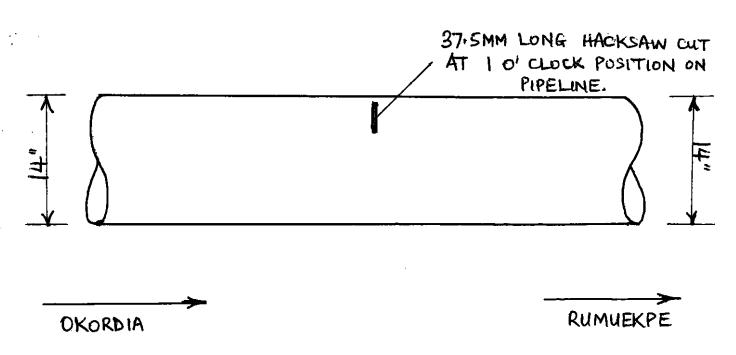

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

OUNT INVESTIGATION REPORT FOR INCIDENT NO. 0031702874 JOINT INVESTIGATION REPORT FOR INCIDENT NO:_

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2) (MINNA MID-BELT)

S/N	Northing (M)	Easting (M)
253	126050-83	445136.94
254	126118.61	445075.71
242	126155.54	445066-19
240	126170.89	445069-32
239	126173.97	445069.33
238	126183-21	445060.12
237	126189.34	445060-30
245	126201-60	445075.58
246	26210-81	445078-69
247	126210.76	445094.10
248	126209.80	445123-88
249	126 152-70	445171.34
250	126/11-41	445186.78

G. INCIDENT INFORMATION:

20	Impacted	Area	Details
ZU.	HIIDacteu	ALU a	


Total calculated area of impact	1.25 Ha	
Impact within SPDC R.O.W	1.15 Ha	
Impact outside R.O.W	0.10 Ha	
21. Volume of oil recovered before completion of JIV	(V _{rec.j}):	
Recovered oil V _{rec} r.	NIL	barrels
20. Computation of the residual volume on site a. Computation of volume of pool of free phase oil (on lar	nd or confined water body).	
i. Area (m²) occupied by pool of free phase	oil	
ii. Average Depth (m) of pool of free phase of	oil	
iii. Emulsification factor: NU		
iv. Volume of pool of free phase oi		

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 702874

- b. Computation of volume of infiltrated oil in the soil (V_{inf}).
 - i. Area (m²) covered by the oil: ______
 - ii. Area of the pool of free phase oil in touch with soil:
 - iii. Average Depth (m) below ground surface of infiltration of oil: D. f)
 - iv. Soil type: CIAY
 - v. P_e (effective porosity of the soil).

iv.	Volume of infiltrated oil. V _{inf}	2.24	barrels

- 21. Computation of volume of oil on open water based on standard coloration.
 - i. Total area of oil on open water:
 - ii. Table of average depth of oil on water based on coloration *

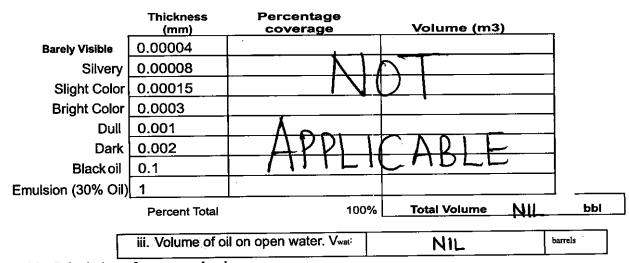

- 22. Calculation of evaporated volume:
 - i. Oil type: **BONNY** MEDIUM
 - ii. E-Factor: 5%

in: volume of evaporation evap	iii. Volume of evaporated oil. V evap:	13.79	barrels
--------------------------------	--	-------	---------

Evapo	ration Factors (E-Fa	actor) for SPDC Crue	de oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

23. Gross Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls) = 13.79 + NIL + 2.24 + 75.9 + NIL = 91.93$

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0031702874

V _{Est} (bbls)=	91.0	BARRELS		
24. <u>N</u>	let Total Estimated S	pilled Volume V Est(<u>bbls)</u> = V	$e_{\text{evap}}(\text{bbls}) + 0.6*V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{inf}}(bb$
v v	V_{pool} (bbls) + V_{recJ} (bb	ls) = 13.79 +	NLT	2.24+ 75.9+ NIL = 91.93
VEst(bbls	<u>= 91.9</u>	7 BARRELS		

25. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact After the
	initial response and therefore recommend that the site be closed out 🔲
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

26 Signatories

This report was filled and signed on the <u>29/08/20 11</u> at incident site by joint investigation representatives from

- Host Community
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:

Tick as applicable


^{*}Calculation of the respective estimated volume is to be done using the new spill estimation software on site

^{*}Conversion of m3 to barrels is Total volume VT (m3) x 6.29

^{*}Emulsification factor for spill on water to consider is 60% of volume of oil.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: UU31 702874

20. Appendix 1: Overview sketch of the site

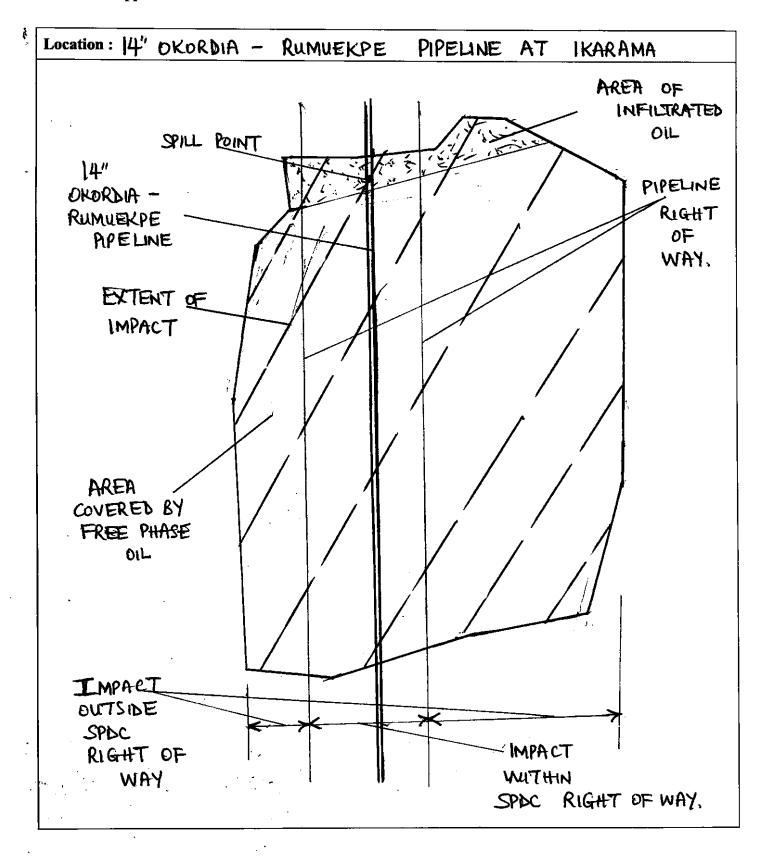

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 702874 0031

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION (MINNA MID-BELT).

S/N	Northing (M)	Easting (M)
251	126094.82	
252	126094.82 12 6 069.35	445177.90 445166.78
	<u> </u>	
-		
	/	
:		