JOINT INVESTIGATION REPORT FOR INCIDENT NO: ... 0016 7-03073

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:		, .
1. Spill incident Number: 7038	73 2.Type	of incident* SPILL
3. Name of Location 16" EGBEN	1A-ASSA PH	PELINE
4. Name of nearest community EKP	AGHA 5. State: R	WERS 6. LGA ONELGA
7. Type of Production facility/Installation	HL PIPELINE 8.	Asset owner/District NESP/LAND 2
B. INCIDENT INFORMATION:		· · · · · · · · · · · · · · · · · · ·
9. Details of incident a. Date of incident: 22NP b. Date/Period of investigation: 2	4494ST 21	011 * AUGUST 2011
c. Description of spill point environm		<del></del>
☐ Firmed soil	Loose soil	Previously excavated area
☐ Under water	□ Swampy	☐ Exposed pipe surface
☐ Well Platform (on Water)		□ Rig
d. Description of leak point (tick as a	pplicable);	
☐ Drilled hole	☐ Hack saw cut	☐ Explosive tear,
□ Complete Rupture	☐ Inward dent,	☐ Well head tampering
Failed Weld-on illegal hot tap v		☐ Missing Pipeline/Flowline)
rude oil theft (illegal bunkerin	g) point,	☐ Third party tampering with Clamp
☐ Third party tampering with valv	e setting,	☐ Third party tampering with flange,
☐ External Corrosion		□ Internal Corrosion
☐ Saver-pit over flow,	☐ Surge vessel overflow	
☐ Flare System/Bund wall Failure		□ com unit failure
□ Cold vent	☐ Relief valve failure	☐ Others (specify)
Total and a		\.\.\.\.\.\.\.\.\.\.\.\.\.\.\.\.\.\.\.
e. Incident due to: Third party interference	□ Operational	□ Others (specify
f. Spill point coordinates  Measuring unit (METER)	(MINNA	MID-BELT)
Northing:		Easting:
156727.0	6	480139.01
·		
·		

Page 1 of 9

<sup>\*</sup>This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

#### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: C. RISK ASSESSMENT 10. Type of environment: Land □ Swamp □ Water ☐ Seasonal swamp Type of environment to which oil has spread: \\_/Land □ Swamp □ Water ☐ River (identify) Weather condition Raining □ Sunny 11. Distance from the nearest sensitive habitat ☐ Government reserved and designated protected area ☐ Drinking water source **人**(L ,m] ☐ Built up area ,m] □ Farmlands ,m] ☐ Fish Farm/Pond ,m] ☐ Fishing net **↓**//,m] ☐ Others (specify). 12. Containment measures put in place; □ Booms □ Dyke 13. Any pictures or video coverage? [N]

If yes give brief description:

17 WAS CONFILMED ON SITE THAT THE SPILL OCCURRED

IN LIVELS STATE AND NOT IN IMO, AS EARLIER STATED IN THE

NOTIFICATION TO REGULATORS SO THE REGULATORS FROM IMO WELF

CHANGED:

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

14. Was there any disruption to the investigation?

S/N	Type of Structures	Description	Size	Number	Comments
	MONE	WITHIA	LA	DEA OF	IM PACT
	' <b>V</b>			<u> </u>	•
				1	-

### 

#### 16. Crops/Economic Trees

S/N	Type of crops	Young		Medium	Matured	Quantity	Comments
	MON	<u> </u>	WIT	HIN	APEA	OFI	MPACT
		L					

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE N	ITHIM	AREA OF	IMPACT

#### 18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
_	MANIT	1 (17# 101	LISA AF	1200 000 000
	Moine	MALLALIA	ALEW OL	IMPACI

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix 1)

A SECTION OF 16" EGBEMA-ASSA PIPELINE AT EXPERGIAL
SHOWING BUNKERING POINTS FITTED AT 12 0' CLOCK POSITION

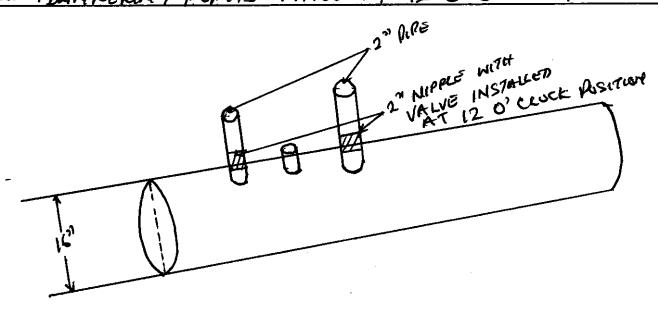

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0016703 073

#### F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

		<u> </u>	(CELI)
	S/N	Northing (METER)	Easting (METER)
	Pfoi	156730.12	480145.18
	Pt02	156728.01	480150.94
$\langle \  $	P403	156717.80	480 154 · 38
	Pt 04	156714.77	480 142 · 06
	Pt 05	156730.15	480135.94
	P6 06	155624.09	480598.39
	P6'07	155627.40	480604.17
,	Pf 08	155636.67	480607.65
	Pf 09	155608.71	480620.23
	PE10	155599.61	480607.99
	4		

#### G. INCIDENT INFORMATION:

20	T	A	T -4-:1	_
ZU.	Impacted	Area	Detail	S

•	Total calculated area of impact	0.06 lta	
•	Impact within SPDC R.O.W	0:06 Ha	
•	Impact outside R.O.W	NIL	

21. Volume of oil recovered before completion of JIV (V<sub>recJ</sub>):

Recovered oil V <sub>rec</sub> r.	NIL	barrels

- 20. Computation of the residual volume on site
- a. Computation of volume of pool of free phase oil (on land or confined water body).
  - i. Area (m²) occupied by pool of free phase oil

    NOT APPLICABLE

    ii. Average Depth (m) of pool of free phase oil

iii. Emulsification factor:\_\_\_\_\_\_

iv.	Volume of pool of free phase oil. V pool:	ML	barrels

		VELOPMENT CO	MPANY OF NIGERIA LIMITI T NO: 0016 7030	
b. Computation of	of volume of infiltr	ated oil in the soil (Vi	inf).	
	i. Area (m²) cove	ered by the oil:	600	
i	i. Area of the poo	ol of free phase oil in	touch with soil:	
ii	i. Average Depth	(m) below ground su	rface of infiltration of oil:	05
i	v. Soil type: C			<del></del>
•		orosity of the soil)	82	
i	v. Volume o	f infiltrated oil. Vinf	1.5	barrels
i. Total area o	of oil on open wate erage depth of oil o Thickness			
Barely Visible	(mm) 0.00004	coverage	Volume (m3)	$\neg$
Silvery	0.00004	NOT		_
Slight Color				_
Bright Color		<b>A</b> 00		$\neg$
Dull	0.001	#HPV	LICKBL &	
Dark		<b>V 10 1</b>		
Black oil	0.1			
Emulsion (30% Oil)	1			
	Percent Total		100% Total Volume NW	- bbl
	iii. Volume of oi	l on open water. Vwa	" NVL	barrels
22. Calculation of	of evaporated vol	ume:		
	ype: <b>BONA</b> ctor: <b>25 7</b>			
ii	i. Volume of ev	aporated oil. V <sub>evap</sub> :	0.5	barrels
	Transmiss E	actors (E. Factor	r) for SDDC Crude oil	

Evapor	ration Factors (E-Fa	actor) for SPDC Crue	de oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
<u>.</u>	> 7 days	40%	25%


23. Gross Total Estimated Spilled Volume  $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls) = 0.5 + Nul + 1.5 + Nul + Nul = 2 bases 5.$ 

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0016 703073

V <sub>Est</sub> (bbls)= 2BKRELS			
24. Net Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + 0.6*V_{wat}(bbls) + V_{inf}(bbls) + $			
Vpool (bbls) + VrecJ (bbls) = 0.5+ Nut 1.5+ Nut + Nut = 2 BARRELS			
VEst(bbls)= 2 B LIRELS			
*Calculation of the respective estimated volume is to be done using the new spill estimation software on site			
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oil.			
Emidistroution factor for spin on water to consider is 65% of votable of on			
25. GENERAL STATUS OF THE SITE			
A. Joint investigation of the incident site found that there is no residual impact After the			
initial response and therefore recommend that the site be closed out □			
B. Investigation of the incident site showed that there is residual impact on site requiring			
further works			
26 Signatories			
This report was filled and signed on the investigation representatives from			
Host Community			
• Department of Petroleum Resources [DPR]: □			
National Oil Spill Detection and Response Agency [NOSDRA]:			
State Ministry of Environment [SME]:			
Nigeria Police Force [NPF]:			
• Shell Petroleum Development Company [SPDC]:			
Tick as applicable			

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0016 703073

20. Appendix 1: Overview sketch of the site

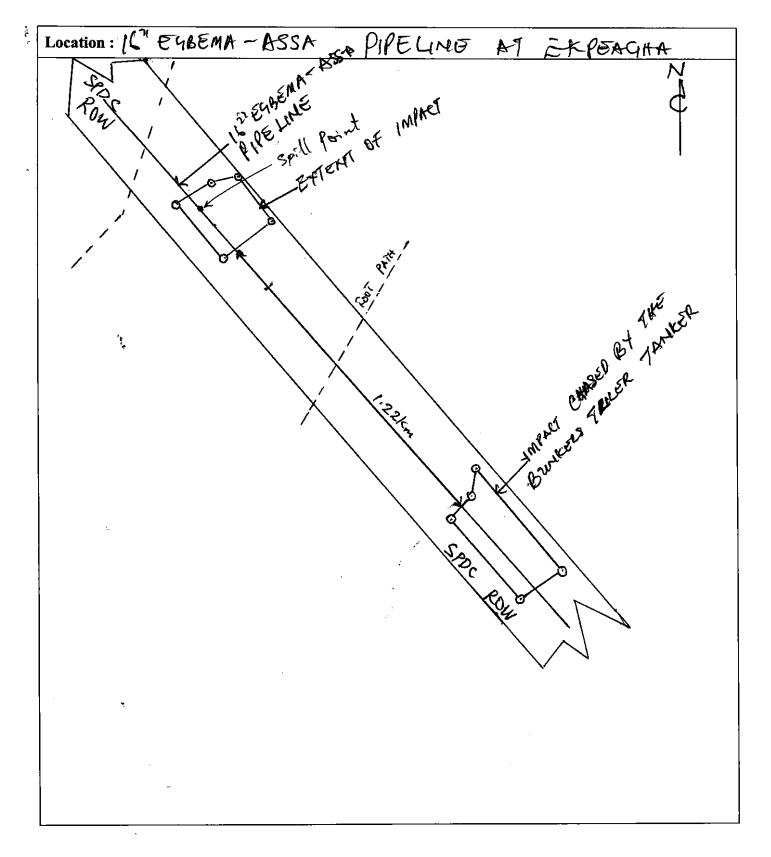

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 7

### 7030 F3

# 21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
<del></del>		7
	4	