

NOTE! SECOND REPORTED SPILL INCIDENT AT ODAGWA

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

- 1. Spill incident Number: 2011-743458 2. Type of incident* OIL SPILL
- 3. Name of Location 12" IMO RIVER I-EBUBU OGALE PIPELINE
- 4. Name of nearest community ODAGWA 5. State: RIVERS 6. LGA ETCHE
- 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District MPE/PH2

B. INCIDENT INFORMATION:

9. Details of incident

a. Date of incident: 21ST, NOVEMBER, 2011

b. Date/Period of investigation: 23RD, NOVEMBER, 2011

c. Description of spill point environment

- Firmed soil Loose soil Previously excavated area
- Under water Swampy Exposed pipe surface
- Well Platform (on Water) Rig

d. Description of leak point (tick as applicable);

- Drilled hole Hack saw cut Explosive tear,
- Complete Rupture Inward dent, Well head tampering
- Failed Weld-on illegal hot tap valve, Missing Pipeline/Flowline)
- Crude oil theft (illegal bunkering) point, Third party tampering with Clamp
- Third party tampering with valve setting, Third party tampering with flange,
- External Corrosion Internal Corrosion
- Saver-pit over flow, Surge vessel overflow, Outward dent
- Flare System/Bund wall Failure Valve Failure com unit failure
- Cold vent Relief valve failure Others (specify) NOT APPLICABLE

e. Incident due to:

- Third party interference Operational Others (specify) NOT APPLICABLE

f. Spill point coordinates

Measuring unit (METER)		<u>MINNA MID-BELT</u>	
Northing:		Easting:	
<u>108510.69</u>		<u>523180.74</u>	

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) NOT APPLICABLE

ii. Weather condition

- Raining Sunny

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
 Drinking water source [,m]
 Built up area [,m]
 Farmlands [,m]
 Fish Farm/Pond [,m]
 Fishing net [,m]
 Others (specify). NOT APPLICABLE

12. Containment measures put in place;

- Booms Trench Dyke

Others: NOT APPLICABLE

13. Any pictures or video coverage? [Y] [N]

14. Was there any disruption to the investigation? [Y] [N]

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
<u>NONE WITHIN AREA OF IMPACT</u>					

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
NONE WITHIN AREA OF IMPACT				

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix 1)

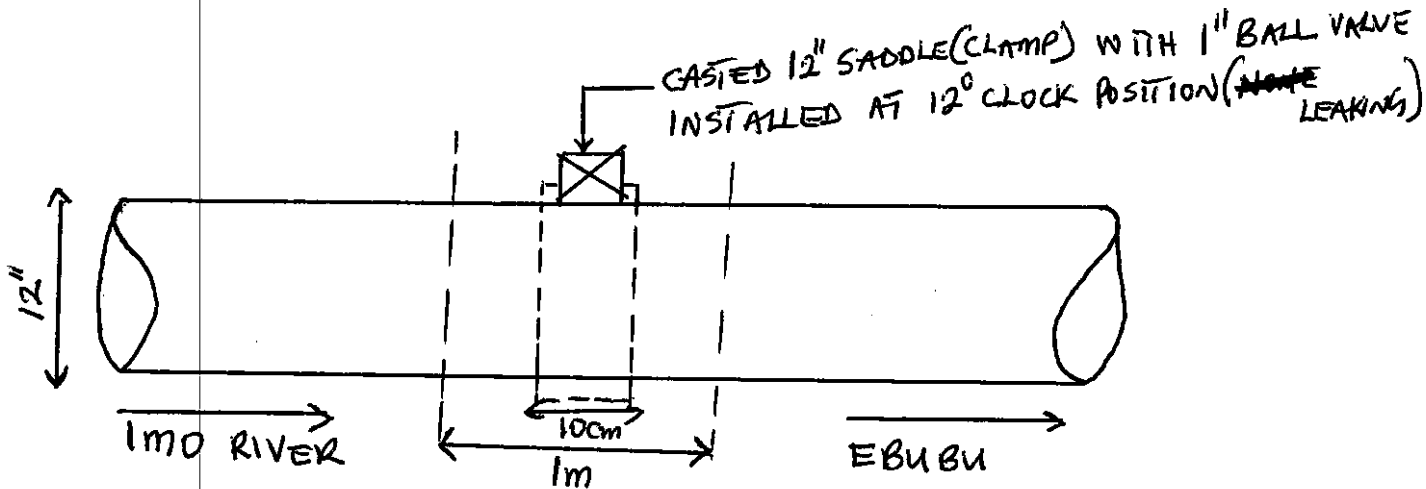

SECTION OF 12" IMO RIVER - EBUBU PIPELINE AT ODASWA, SHOWING LOCATION OF 1 NOS, CRUDE OIL THEFT FITTINGS INSTALLED AT 12° CLOCK POSITION.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

MINNA MID-BELT

S/N	Northing (METER)	Easting (METER)
Pt1	108510.62	523181.99
Pt2	108509.28	523180.62
Pt3	108510.65	523179.10
Pt4	108512.29	523180.72

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.0004 Ha
- Impact within SPDC R.O.W _____
- Impact outside R.O.W _____

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>0.094</u>	barrels
---------------------------	--------------	---------

20. Computation of the residual volume on site

a. Computation of volume of pool of free phase oil (on land or confined water body).

- Area (m^2) occupied by pool of free phase oil N/A
- Average Depth (m) of pool of free phase oil N/A
- Emulsification factor: 0%

iv. Volume of pool of free phase oil. V_{pool} :	<u>NIL</u>	barrels
--	------------	---------

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157743458

b. Computation of volume of infiltrated oil in the soil (V_{inf}).

- i. Area (m^2) covered by the oil: 4
- ii. Area of the pool of free phase oil in touch with soil: NIL
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.02
- iv. Soil type: MEDIUM SAND
- v. P_e (effective porosity of the soil): 25%

iv. Volume of infiltrated oil. V_{inf}	<u>0.126</u>	barrels
--	--------------	---------

21. Computation of volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL
- ii. Table of average depth of oil on water based on coloration *

	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004	NOT APPLICABLE	
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		
Percent Total		100%	Total Volume bbl

iii. Volume of oil on open water. V_{wat}	<u>NIL</u>	barrels
---	------------	---------

22. Calculation of evaporated volume:

- i. Oil type: BONNY MEDIUM
- ii. E-Factor: 15%

iii. Volume of evaporated oil. V_{evap}	<u>0.039</u>	barrels
---	--------------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

23. Gross Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{rec}(bbls) = 0.039 + NIL + 0.126 + NIL + 0.094 = 0.259BBL$

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

$V_{Est}(bbls) =$	<u>0.259 BBLs</u>
24. Net Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + 0.6 * V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recl}(bbls) = 0.039 + NIL + 0.126 + NIL + 0.094 = 0.259$	
$V_{Est}(bbls) =$	<u>0.259 BBLs</u>

- *Calculation of the respective estimated volume is to be done using the new spill estimation software on site
- *Conversion of m3 to barrels is Total volume VT (m3) x 6.29
- *Emulsification factor for spill on water to consider is 60% of volume of oil.

25. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact After the initial response and therefore recommend that the site be closed out <input checked="" type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input type="checkbox"/>


26 Signatories

<p>This report was filled and signed on the <u>23/11/2011</u> at incident site by joint investigation representatives from</p> <ul style="list-style-type: none"> • Host Community <input checked="" type="checkbox"/> • Department of Petroleum Resources [DPR]: <input checked="" type="checkbox"/> • National Oil Spill Detection and Response Agency [NOSDRA]: <input checked="" type="checkbox"/> • State Ministry of Environment [SME]: <input checked="" type="checkbox"/> • Nigeria Police Force [NPF]: <input checked="" type="checkbox"/> • Shell Petroleum Development Company [SPDC]: <input checked="" type="checkbox"/> <p style="text-align: right;"><i>Tick as applicable</i></p>

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0157 743458

20. Appendix 1: Overview sketch of the site

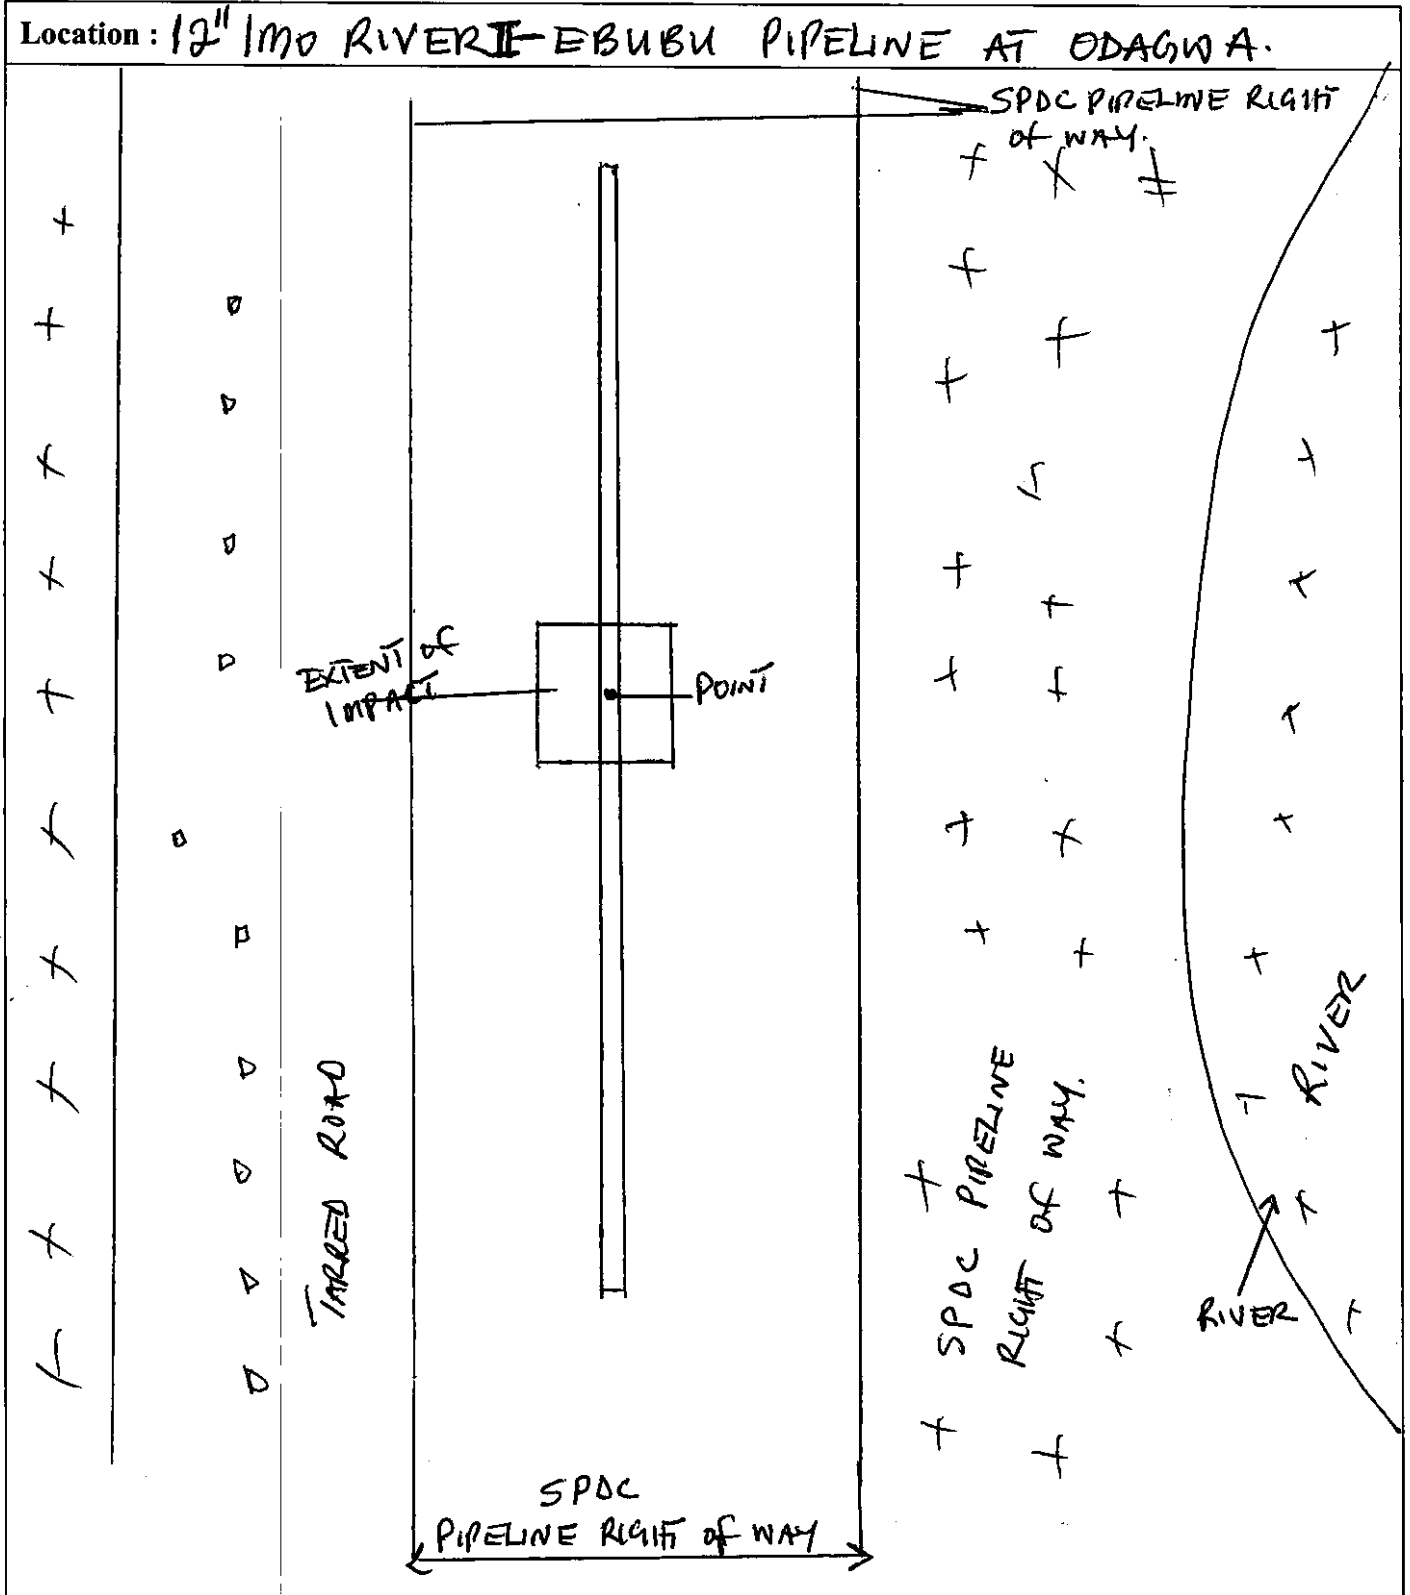

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: _____

0157 743458

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting