JOINT INVESTIGATION REPO	RT FOR INCIDENT NO	0279824763
(Note: As practicable as possible the JIT re	port is to be signed in the	field by all the participating parties)
A. GENERAL INFORMATION:		
1. Spill incident Number: 8247	63 2.Type o	of incident * OIL SPILL
3. Name of Location 10 01 E	SU CREEK	PifeLine
4. Name of nearest community ONYO n	1 A 5. State: <b>RA</b>	1 ELSA 6. LGA SOUTHERN IJAM
7. Type of Production facility/Installation C	ML PIPELINE 8.A	sset owner/ District NESP/SWAMM 1
B. INCIDENT INFORMATION:		
9. Details of incident  a. Date of incident: 7th 520  b. Start date/time of investigation: 2  c. Investigation End date: 23 RD  d. Description of spill point environm	340 JUNE 2012	n2
☐Firmed soil	Loose soil	Previously excavated area
Under water	$\square_{\text{Swampy}}$	Exposed pipe surface
☐ Well Plateform (on Water)  e. Description of leak point (tick as a)	onlicable):	$\square_{Rig}$
Drilled hole	Hack saw cut	☐Explosive tear,
Complete Rupture	☐ Inward dent,	☐ Well head tampering
☐Failed Weld-on illegal hot tap v	alve,	☐ Missing Pipeline/Flowline)
Crude oil theft (illegal) bunkeri	ng) point,	☐ Third party tampering with Clamp
☐Third party tampering with val-	ve setting,	☐ Third party tampering with flange,
Corrosion	☐Saver-pit over flow,	☐Surge vessel overflow
Outward dent	☐ Flare System/Bund w	rall failure
□Valve Failure	com unit failure	☐ Cold vent
Relief valve failure	Others (specify)	
f. Incident caused by:  Third party interference	Поi1	Път
M nird party interference	☐ Operational	□Mystery
g. Spill point coordinates  Measuring unit	Mio-Bi	ELT (MINNA)
Northing:		Easting:
SP1: 8 4084.9	3	404726.11
SP1: 84084.9.	2	404726.11 404732.39
*		

Page 1 of 9

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 10279 824763

C.	RISK ASSESS	MENT			
	10. T	ype of environment:			
	Land	□ Swamp	□ Water	Seasonal swamp	
	î. Ty	pe of environment to	which oil has sp	pread:	
	Land	□ Swamp	₩ater	☐ River (identify)	
	ii, We	eather condition			
	Raining	g Sunny om the nearest sensitiv	ve habitat		
	☐ Drinkir☐ Built up☐ Farmla:☐ Fish Fa☐ Fishing☐ Others	nds rm/Pond	NOT	[ ,m] [ ,m] [ ,m]	
	□ Booms	☐ Trench	Dyke		
	☐ Others:	NATURAL	PEPRE	M01225	
	13. Any picture	s or video coverage?		[N] [N]	
	14. Was there a	ny disruption to the ir	ivestigation?	[Y] <b>NY</b>	
If y	es give brief desc	eription:			
	N0	TA	PPLI	CABLE	

#### D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

#### 15. Structures / Properties

S/N	Type of Structures	Description	Size	Number		Comments
		<del>                                     </del>	<del>                                     </del>	-		
	MANT	11.TH1	W A	EA-	AT	IMPACT
		MILLIA	7 1	<del>/~/</del> /	07	1111911 4
	1					

JOINT INVESTIGATION REPORT FOR INCIDENT NO:

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	YOA	IE I	WITHIN	AREI	<del>1</del> 0 <del>7</del> 1	MPACT

#### 17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description		Quantity/S	ize	Comments
					<del></del>	
	NONE	HITHIN	ARE	A	<del>/  </del>	TMPA-CT
	140110	<del>                                      </del>				

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE	WITHIN	AREA OF	IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

A SECTION OF 10 DIEBU CREEK PIPELINE AT ONYOMA SHOWING TWO NUMBER HACK SAM CUT AT I AND 2 O'CLOCK POSITION RESPECTIVELY.

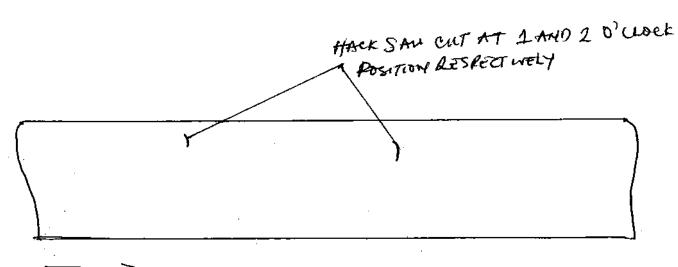

DIEBU FLOWSTATION

NUN RIVER MANIFOLD

# 

#### F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

MID-BELT (MINNA)

	TIV-BELL CIVINIA
Northing METERS	Easting Meters
83986.62	404713.43
83959.91	404709.08
83928-25	404703.98
839 63.22	404705.77
83994 - 31	404 709.08
84017.36	404 710.45
84042.02	404 692 .04
840.38.96	404 685.86
84054 .47	404 645 83
84060.71	404 618 . 10
840 85-27	404 627 43
84106.73	404642.93
84128.23	404 649 17
	Northing METERS  83986.62  83959.91  83928.25  83994.31  84017.36  84042.02  84038.96  84054.47  84060.71  84085.27  84106.73

#### G. INCIDENT INFORMATION:

<ol><li>Impacted Area Detail</li></ol>	ls
--	----

•	Total calculated area of in	mpact	SMa.	
	Impact within SPDC R.O	.w		
•	Impact outside R.O.W			<del></del>
21. <u>Volum</u>	e of oil recovered before	completion of JIV (V <sub>rec.)</sub>	):	
	market the	Recovered oil V	NIL	barrels
20. <u>Compu</u>	tation of the residual yol	ume on site		
a. Compu	tation of volume of pool of i. Area (m²) occupied by	free phase oil (on land or o y pool of free phase oil		
	ii. Average Depth (m) o	f pool of free phase oil	0.005m	

THE SHELL PE	IKOLEUM DI	EVELOPMENT	ONIFA	NT OF N	79 82	14740	
JOINT INVES	STIGATION REF	ORT FOR INCIDE	ON TH	04	13 2	4763	
iii. Emulsification	factor: NL						
iv.	Volume of	pool of free phase oil	$V_{pool}$ :	2	4.8		barrels
b. Computation of		rated oil in the soil (		16 22			
i	Area *(m²) co	vered by the oil:	/	6000			
ii	i Area of the po	ool of free phase oil i	n touch	with soil:_	80	<u> </u>	
ži	ii Average Dept	h (m) below ground	surface (	of infiltrati	on of oil:_	0-007	
i	_	· ·	_				
у	P <sub>e</sub> (effective	porosity of the soil).	8	%			
<b>i</b> :	v. Volume	of infiltrated oil. Vi	nf	8,	45		barrels
21. Computation	of volume of oil	on open water bas	ed on s	tandard co	oloration.		
-	f oil on open wate	_		<u>.</u>			
ii. Table of ave	rage depth of oil o	n water based on color	ation ••				
	Thickness	Percentage	•		4		
Barely Visible	(mm) 0.00004	coverage		Volu	ıme (m3	<del>''</del>	
Silvery	0.00008	1/1/0	$\tau$				
Slight Color			1				
Bright Color	0.0003	1 1			<del></del>		
. Dull	0.001		$\Omega$	1	- 1 0 1		
Dark	0.002		T		MOI		
Blackoil	0.1	<b>'</b>	• •				
Emulsion (30% Oil)	1	1					1
	Percent Total		100%	Total	Volume	MIL bbl	<u> </u>
iii.	Volume of o	il on open water. V	wat:		Nu		barrels
22. Calculation o			•	_			
i. Oil t	ype: BONNY						
ii. E-Fa	ictor: 40%						
iii.	Volume of e	vaporated oil. V ersp:	grad Grad	22	2:15		barrels
Fyanora	tion Factors (F.Fac	tor) for SPDC Crude	oil				
Oil Type	Days on site	Bonny Light	Bonny				
	_	_	Mediur	n I			

Evapor	ration Factors (E-F	actor) for SPDC Crud	e oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
_	> 7 days	40%	25%


<sup>\*</sup>If area is not same as the total area of impact, please indicate in the overview sketch
\*\* Spill Factor from USCG FOG (2000 Edition)

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1273 824463
23. Gross Total Estimated Spilled Volume
$V_{\text{Est}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{rec}J}(\text{bbls})$
VER (bbls) = 22.15 + NIL + 8.45+24.8+ NIL = 55.4 BARREL
24. Net Total Estimated Spilled Volume
$V_{\text{Est}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + 0.6*V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{recJ}}(\text{bbls})$
VESt(bbis)= 22.15 + Nu + 8.45+24.8+ NIL = 55.4 BARREL
*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oil.
25. GENERAL STATUS OF THE SITE
A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
B. Investigation of the incident site showed that there is residual impact on site requiring further works
26 REPRESENTATIVES
This report was filled and signed on the 22 / 06 /20 12 at incident site by joint investigation representatives from
Host Community
• Department of Petroleum Resources [DPR]: □
• National Oil Spill Detection and Response Agency [NOSDRA]: ₩
• State Ministry of Environment [SME]: 📈
Nigeria Police Force [NPF]:
Shell Petroleum Development Company [SPDC]:   ✓
i e

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0279 824763

27. Appendix 1: Overview sketch of the site

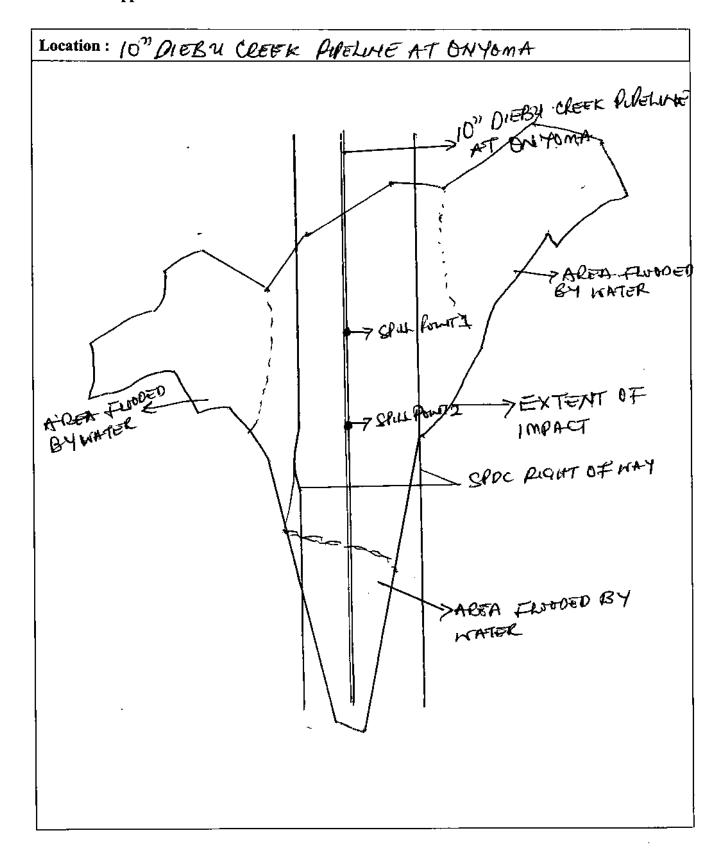

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1279 824763

# 21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION (MID-BELT) MINNA.

Easting S/N Northing METERS METERS. 404667.69 84134.31 14 404687.91 84151.07 15 404 715.03 84175.55 16 841 92.47 404 735 . 73 17 404 751. 23 84217.01 18 404 770.60 84229.12 84241.47 404 788.32 20 84238 - 35 404 800 65 21 404816.03 84229.08 20 84210.66 404809.80 23 2\$ 404 800 46 84186.10 404797.32 84167.67 25 104778.79 26 84161.59 84152.41 104766.43 27 84127.91 404741.67 26 29 404736.20 84100.14 404 726.94 30 84055.82 31 404 719.00 84014.81