JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 JIV report S/N: 0129

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

of incident* OIL SPILL
MANIFOLD
YELSA6. LGA YENAGOA
Asset owner/District LAND 2
3. IST, 2013/13:22 Ho URS stigation duration, days: ONE (1) MY
Recently excavated area
Exposed pipe surface
□Drill Rig
☐ Tear (),
☐Well head tampering
☐Missing Pipeline/Flowline
☐Third party tampering with Clamp
☐ Third party tampering with flange,
Surge vessel overflow,
vall failure Accidental 3 rd party equipment
m unit failure
MED GASKET
T FLANGED JOINT.
TEMPLE CONT.
eft□; Accidental 3 rd party damage□)
Belt)
Easting:
451447.97mE

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 _ JIV report S/N: C. RISK ASSESSMENT 10. Type of environment: Land Swamp □ Water ☐ Seasonal swamp☐ Shoreline/Waterfront Type of environment to which oil has spread: □Water ☐River (identify)___ Weather condition Sunny \square_{Dry} □Wet **□**Windy □Hot □cool 11. Distance from the nearest sensitive habitat ☐ Government reserved and designated protected area □ Drinking water source ☐ Built up area m, □ Farmlands ,m] ☐ Fish Farm/Pond ,m) ☐ Fishing net Others (specify). PALM TREES 12. Containment measures put in place; Booms Trench Dyke ☐ Natural depression □Pit DOthers: RAFFIA PALM 13. Any pictures or video coverage? 14. Was there any disruption to the investigation? If yes give brief description: D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
			<u> </u>		
\Box	DVIE K	11771	$\perp \Delta C$	EN NE	IN ADM ATT
	A OIAL K	At itan	4 7 ID	CH UF	MITALI

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 JIV report S/N:

1	6.	Crops/Economic	Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1 1						
N	ONE	Alletina	\ \\	0 F A	mr la	MACT.
1 4	OIAL	AATIHIN	4 1	KEA	שון אט	MAC I


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description		Quantity/Size	Comments
h			2		
#	ONE 1	MITHIN	ARE	Α	FIMPACT
	ONE 1	MITHIN	ARE	<u>A</u> €	F IMPACT

18. Others (Specify) i.e. Animal Traps

S/N Othe	rs	Description		Quantity/Size	Comments
			1		
Mor	JF. W	titin /	KEA	OF	IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak point sketch of the site should be added as an appendix 1)

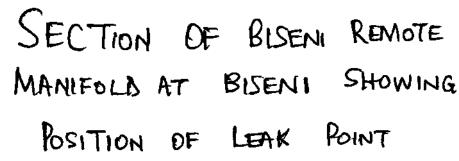

AT FLANGED JOINT.

INLET

CHECK, VALVE

LEAK POINT

(FAILED GASKET
AT FLANGED JOINT).

Page 3 of 9

DISUSED 3" FLOWLINE OF ATT TIME OF THE PROPERTY OF THE PROPERT

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 JIV report S/N:

0129

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19.	Impacted	area boundary	Coordinates (lf more, Print and	l attach as an appendix)
	1.4	· · · · · ·	`	,	- upp - initially

M	NNA (MID-BELT) Northing	re, i rua una adaen as an appenaix)
S/N	Northing	Easting
WP841	139256.47mN	4-51444 . 90ME
WP842	139250.32mN	451444.88ME
WP845	139247.25MN	451444.87ME
wP846	139247.24 MN	451447.95mE
WP855	139244 ·14MN	451457.18mE
WP856	139244·16mN	451451 - 02 mE
wp858	139250.29mN	451454 · 12 ME
WP 859	139259·51mN	451454 · 15mE
wP260	139259.54mN	451444.91ME
WP865	139231·43mN	451467.29ME
	139228.81mN	451463.31mE
WP867	139234.92mN	451458.23ME
wP868	139236.75mN	451462-68mE
WP869	139241-11mN	451459.11ME
WP870	139239 · 92 mN	45/453.95ME
 		
_		
-		

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 JIV report S/N: 0129	
G. INCIDENT INFORMATION:	
20. Impacted Area Details	
Total calculated area of impact 0.022 Ha	
Impact within SPDC R.O.W YES	
Impact outside SPDC R.O.W	
21. Volume of oil recovered before completion of JIV (V _{recJ}):	
Recovered oil V _{rec.j} : NIL Barrels	
22. Computation of estimated residual volume on site	
a. Computation of estimated volume of pool of free phase oil (on land or confined water body).	
i. Area (m²) occupied by pool of free phase oil	
ii. Average Depth (m) of pool of free phase oil	
iii. Emulsification factor:	
iv. Estimated Volume of pool of free phase oil. V _{pool} : 36.23 barrels	
b. Computation of estimated volume of infiltrated oil in the soil (V _{inf}). 1. Estimated Volume of infiltrated oil at spill point (Vinf a) i. Area* (m²) of soil covered by the oil:	_
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)	
i. Area* (m²) of soil covered by the oil:	
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline:	
iii. Soil type: iv. P. (effective poroso) or the soil ABLE	
v. Cause of spill: Oil type:	
vii. Oil Residence time on site, day.	
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:	
ix. Estimated depth of infiltration around spill point:	
Estimated Volume of infiltrated oil at spill point. V _{inf_b} : barrels	
3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)	

i. A	rea (m2) of soil o	covered by the oil:		43		
ii. A	rea (m²) of the p	ool of free phase oi	l in touch with	soil:	<u>Nı</u> L	
iii. A	verage Depth (m) below ground sur	face of infiltrat	ion of oil:_	0.004	-1
iv. S	oil type:	AY				
,,, ,,	2 (affective noro	sity of the soil)	8%			
	(effective polo	sity of the son)				barrel
v	i. Estimat	ed Volume of infil	rated on. At V	/ inf ¹	0.09	Darren
23. Computation	of estimated vo	lume of oil on or	en water hase	d on stand:	ard coloration	
		ter: NIL	cii watei base	a on stand	ard coloration:	
		il on water based o	n coloration (**\$nill F/	actors from USCG	FOG (200
				Edition)	iciora from 0000	100 (200
	Thickness	Percentage	¥2-1			
Barely Visible	0.00004	coverage	Volume (m3	<u>,</u>		
Silvery	0.00004	1.		-		
Slight Color	0.00015	No		\dashv		
Bright Color	0.00073	, 10		_		
Dull	0.003	1 001	0.015	_		
Dark	0.002	- MYYL II	CARFE	ᅱ		
Black oil	0.002		<u> </u>	-		
Diack on	0.1					
Emulsion (30% Oil)	1					
` _	Percent Total	100%			D	arrels
iii.	•	me of oil on open v	vater. V _{wat} :	NiL	B	arieis
24. Calculation of	of evaporated vo	olume:				
i. Estir	natad Valuma a	vailable for evap	oration within	curface an	a. 26.30	RADD
i, Estii	nated volume a	variable for evap	oration within	Surrace an		>14/1/
ii. E-Fa	ctor: 25%					
		-		-		
iii.	Estimated V	olume of evaporate	d oil. V _{evap} :	12-1) B	arrels
				<u> </u>		
		(E-Factor) for SF				
Oil Type	Days on site	Bonny Light	Bonny Mo	5%		
Oil Residence time	< 1 day 1-7 days	10% 25%	<u> </u>	15%		
	> 7 days	40%		25%		
				- 1		
		ume V _{Est} (bbls)	77 (111)	. 17 d.t.	1-1 . 37 /LL1-) , 1 7

49 BARRELS

Estimated Reported Volume** V_{rep}(bbls)=

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation to: Conversion of m' to harrels is Valume (m3) x 6.29: **Round up estimated volume to next whole number using the f

AITLE	on suc, conversion of me to ou	**C13 13	rotante (no) x 0.22,	Nomina up commenca i	Other to next	millore amander H	÷
follo	wing rules:						
•	Any spill volume in excess of	I bbl	is rounded up to the	next whole number.			

Any spill volume in less than I bbl is rounded up to the next 0.1 bbl.

Calculated volume = 15.3 bbl ------ Reported volume = 16 bbl Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
- B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 92/08/2013 by joint investigation representatives from

- **Host Community:** \(\overline{\Omega}\)
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]: [S
- State Ministry of Environment [SME]: E
- Nigeria Police Force [NPF]: 🗔
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1023895 JIV report S/N: (14)

28. Appendix 1: Overview sketch of the site

