JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N: 0092

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

Troic. The practicable as possible the STI To	eport is to be signed in the	jiena by an ine paracepaints paraces,
A. GENERAL INFORMATION:		
1. Spill incident Number: 1022 08	2.Type	of incident* OIL SPILL
3. Name of Location 14" OKORS	DIA - RUMINER	DE PIPELINE
4. Name of nearest community Ikak	AMA 5. State: BA	YELSA 6. LGA YENAGOR.
7. Type of Production facility/Installation	OIL PIPELINE 8. A	Asset owner/District PIPFLIME
B. INCIDENT INFORMATION:		
9. Details of incident a. Date of incident: 27H Aug b. Start date/time of investigation: c. Investigation End date: 15 d. Description of spill point environ	MST, 2013 13 TH August, 20 tugust, 20 Agual inve	estigation duration, days: 1 DAY
Firmed soil	☐Loose soil	Recently excavated area
☐Under water	□Swampy	Exposed pipe surface
☐Well Platform (on Water)		□Drill Rig
e. Description of leak point (tick as	applicable);	-
Drilled hole	☐Hack saw cut	☐ Tear (),
Complete Rupture	☐Inward dent,	☐Well head tampering
Failed Weld-on illegal hot tap val		☐ Missing Pipeline/Flowline
Crude oil theft (illegal bunker		☐Third party tampering with Clamp
		☐ Third party tampering with flange,
Third party tampering with va		
Corrosion		Surge vessel overflow,
☐Bulging Outward	_	wall failure Accidental 3 rd party equipment
impact □Valve Failu	re Llco	m unit failure
Relief valve failure	Others (specify)	
	e□; crude theft□; Line th (including Mystery spills)_	eft□; Accidental 3 rd party damage□)
g. Spill point coordinates/ Measuring unit (M)	Minna- Mic	ed belt- Easting:
Northing: SP 12709	82.95	444295.83

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N: 0092

C. F	RISK ASS	ESSMEN	ľ							
	10.	Type of	f environmen	t:			:			
	1 □La	nd	□Swamp	\square_{W}	/ater		Seasonal swa	ımp□Sho	oreline/Wa	terfront
	i.	Type of	environment	to which o	oil has s	pread:				
	□ La	nd	□Swamp	□w	/ater		River (identi	fy)		
	ii.	Weather	condition							
	□Rai 11. Distan		Sunny e nearest sens	□D itive habit	-	□Wet	□win	ıdy	□Hot	□cool
☐ Government reserved and designated protected area ☐ Drinking water source ☐ Miv,m] ☐ Built up area ☐ Farmlands ☐ Fish Farm/Pond ☐ Fishing net ☐ Others (specify). ☐ Containment measures put in place;										
	□во	ooms	☐Trench	Z í)yke		lNatural depr	ession	□Pit	•
	13. Any p	ictures or v	rideo coverag	e?			M	[N]		
	14. Was th	nere any di	sruption to th	e investiga	ation?		[Y]	W)		
If ye	es give brie	f description	n:							
	NOT APPLICABLE									
D. 1	TYPE/NUI	MBERS O	F PROPER	TIES, IF A	ANY, F	OUND	· WITHIN TH	E AREA	OF SPRE	AD OF OIL
	15. Struc	tures / Pro	perties							
S/N	Type of	Structur	es Des	cription	Size		Number		Comm	ents
	1								+	
	112	<u> </u>	1	14.1		N 20	<u>CM</u>	05	1001	7481
H	MOV	1-	MI	HIM		- FYA	<u></u>	77	<u> </u>	<u> </u>

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N: 0092

	i		i	
			l	
			l	
	/ A BA !			
	Crops/Economic Tree	~		
	O. CHODS/FEGURORIEC FIEC	S .		
_	o. Grope Eronoma 1100	~		

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
<u> </u>	10.10	1 / 5,,,	1	h		
⊢ /	JUME	ALIIMA		LE17	OF IN	PACI
		• •	, .,		سند ،	
L						·•·

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	•	Quantity/	Size	Co	mments		
X	10ME	VITHIN	_A	2€24	<u> </u>	7	Im	pact	

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	lone h	Minim A	RA 07	INTPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SteTion	οF	14" OKORSIA	- Rumuekpt	PIPELINE	AT IKARAMA	SHOWING
			AT 60° CL			

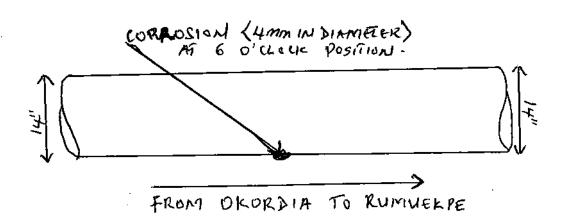

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 10 22 085 JIV report S/N:

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION
19. Impacted area boundary Complinates (If more, Printland attack as anyappendix)

		- Will Self
S/N	Northing (M)	Easting (M)
WP592	127086.04	444292.76.
wp 593	127089.69	444298.93
NP 594	127076.78	444305.05.
W595	127073-72	444 301 96
WP 597	127098.32	444 295 88
WP 598	127089.06	444 308.17.
WP 599	127076.76	444 311 . 22 .
WP 600	127076.82	444 292 . 73
	49	
	/	

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N: 0092
G. INCIDENT INFORMATION:
20. Impacted Area Details
• Total calculated area of impact 0.026036 ha (0.026ha)
Impact within SPDC R.O.W
Impact outside SPDC R.O.W ———————————————————————————————————
21. Volume of oil recovered before completion of IIV (V _{recJ}):
Recovered oil V _{recj} : NIL Barrels
22. Computation of estimated residual volume on site
 a. Computation of estimated volume of pool of free phase oil (on land or confined water body). i. Area (m²) occupied by pool of free phase oil
ii. Average Depth (m) of pool of free thate en
iii. Emulsification factor:
Estimated Volume of pool of free phase oil. V _{pool} : barrels
 b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}). 1. Estimated Volume of infiltrated oil at spill point (Vinf a)
i. Area* (m²) of soil covered by the oil:
ii. Average Depth (m) above leaking facility i.e. pipeline/flowline:
iii. Soil type: CLAY iv. Pe (effective porosity of the soil). 8 %
v. Cause of spill: On a strange vi. Oil type: BUNUY MERIUM
vii. Oil Residence time on site, day: 4 DAYS
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.001 //
ix. Estimated depth of infiltration around spill point: 2.0019
Estimated Volume of infiltrated oil at spill point. V _{inf. a} . 2.01 barrels
2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)
i. Area* (m²) of soil covered by the oil:
ii. Average Depth (m) above leaking facility i.e. pip (ii) a three:
iii. Soil type: iv. R. (effective porosity of the soil)
v. Cause of spile vi. Oil type:
vii. Oil Residence time on site, day:
viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline:
ix. Estimated depth of infiltration around spill point:
Estimated Volume of infiltrated oil at spill point. V _{inf,b} : WIL barrels

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

		AI DEVELOPINE!				
INT INVESTIGATION F	REPORT FOR II	NCIDENT NO: 10	28025	JIV report	$t_{S/N}$: 00	92
i. <i>i</i>	Area (m2) of soil	covered by the oil: _	25	8		
ii.	Area (m²) of the p	ool of free phase oil	n touch with s	oil:	et a sa	<u> </u>
iii. <i>i</i>	Average Depth (m	i) below ground surfa	ce of infiltration	on of oil:	<u> 10-5</u>	
iv. S	Soil type:	7~/			·	
v.	$P_{\rm c}$ (effective poro	sity of the soil)	6 %			
		ed Volume of infiltra				barrels
				nt.	0.18	- Daniers
23. Computation	of estimated vo	lume of oil on oper	ı water based	on standard	coloration	1.
	of oil on open wa			on susionia	COTOTACION	
	•.	l on water based on	coloration (— **Spill Facto	rs from USC	G FOG (2000
	TPL:	The second second		Edition)		
	Thickness (mm)	Percentage coverage	Volume (m3)			
Barely Visible	0.00004					
Silvery	0.00008					
Slight Color	0.00015	13	٨			
Bright Color	0.0003	101	27-1			
Dull	0.001	^ ~ ~ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \	70			
Dark	0.002	101/ 1-1 41				
Black oil	0.1	11				
Emulsion (30% Oil)						
Endision (50% On)	D Tl	1000		J		
iii.	Percent Total Estimated Volum	100% me of oil on open wa	ter. V _{wat} :	M	14	Barrels
24. Calculation of			7.41	/V/	164	
	_					
i. Estir	nated Volume a	vailable for evapor	ation within s	urface area:	<u>2·19</u>	BARK
	. ~ -					
ii. E-Fa	ictor: 157	<u> </u>				
iii.	EstimatedVo	olume of evaporated	oil. V _{evan} :	<i>p</i> .	39	Barrels
<u> </u>				<u>U'</u>	31	
Evan	oration Factors	(E-Factor) for SPD	C Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Med	lium		
Oil Residence time	< 1 day	10%		5%		
	1-7 days	25%		5%	_	
	> 7 days	40%	2	25%		
25 Not Estimat	ted Spilled Vol	ume V _{Est} (bbls) =	V (bble) ±	V (bble)	+ V (bb	ls) + V
(bbls) + V _{rec}						~~/ · * pool
(UUIS) + V rec.	(00ts) — C	39 twic 4	- 4.171	- MIG +	MIL	
		= 2.58	BARRY	-2.5		
Estimated Reported	Volume** V _{rep} (b)	bls)= ? R	ADDEN	ē.		
		<u></u>	TONTH	* '		

	THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMTED.
JO	INT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N: 0092
	Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m ³ to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:
٠.	 Any spill volume in excess of 1 bbl is rounded up to the next whole number.
•	Any spill valume in less than I bbl is rounded up to the next 0.1 bbl.
	Examples: Calculated volume = 15.3 bbt Reported volume = 16 bbl Calculated volume = 0.35 bbl Reported volume = 0.4 bbl
•	Calculated volume = 0.01 bbl Reported volume = 0.1 bbl.
	Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use approprie steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report. 26. GENERAL STATUS OF THE SITE
	A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
	B. Investigation of the incident site showed that there is residual impact on site requiring further works
	27. REPRESENTATIVES This report was filled, agreed and signed on the 13/05/2013 by joint investigation representatives from
	Host Community:
	Department of Petroleum Resources [DPR]: □
	National Oil Spill Detection and Response Agency [NOSDRA]:
	State Ministry of Environment [SME]:
	Nigeria Police Force [NPF]: □
	Shell Petroleum Development Company [SPDC]:
	Signatories agree with reported findings:
	Separate DPR form has been filled out with same findings□
	Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1022085 JIV report S/N:

0092

28. Appendix 1: Overview sketch of the site

