JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report SAN: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 1056541 2. Type of incident* OIL SPILL OTUMARA - ESCRAVOS PIPELINE 4. Name of nearest community UGBOEGUNGUND. State: DELTA 6. LGAWARRI SOUTH-WEST 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District PIPELINE B. INCIDENT INFORMATION: tails of incident

a. Date of incident: 5 TH OCTOBER 2013

b. Start date/time of investigation: 18 TH OCTOBER 2013 AT 1242 HRS Details of incident Actual investigation duration, days: 1 DAY c. Investigation End date:_ d. Description of spill point environment ☐Firmed soil Loose soil Recently excavated area Swampy Under water Exposed pipe surface ☐ Well Platform (on Water) Drill Rig e. Description of leak point (tick as applicable); ☐Drilled hole Hack saw cut ☐ Tear (______), ☐Inward dent, Complete Rupture Well head tampering Failed Weld-on illegal hot tap valve, Failed Clamp ☐Missing Pipeline/Flowline ☑Crude oil theft (illegal bunkering) point. ☐Third party tampering with Clamp ☐ Third party tampering with valve setting. Third party tampering with flange, Corrosion ☐Surge vessel overflow, ☐ Saver-pit over flow, □Flare System/Bund wall failure □Accidental 3rd party equipment ☐Bulging Outward impact ☐Valve Failure Com unit failure Cold vent Relief valve failure Others (specify)_ f. Incident caused by: ☐ Third party interference (Sabotage□; crude theft ☐; Line theft ☐; Accidental 3^{nt} party damage ☐) Operational Others (including Mystery spills)_ g. Spill point coordinates Measuring unit METERS Northing: 304198.39 MF 179936.08 MN

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 10.56541 JIV report \$/N: 0.195

C.	RISK ASS	ESSME	AT.								
	10.	Туре	of enviro	nment:							
	□La	ınd	⊠Śwa	mp [Water	Ī	∃Seasonal	swamp[Sho	reline/Wat	erfront
	i.	Туре о	f environ	ment to whic	h oil has	spread:					
	□La	ınd	₩Swa	mp [Water		River (ide	entify)_		<u>_</u>	
	ii.	Weathe	r conditi	on							
	□Rai 11. Distan		⊠ Sunn ne nearesi	y E sensitive ha	lDry bitat	□We	t 🗖	Windy		□Hot	□cool
	0 Di 0 Bi 0 Fi 0 Fi 0 Fi	overnmen rinking wa nilt up are rmlands sh Farm/F shing net thers (spec	ater source a Pond	t and designa te	ited prote	ected are	a [[[[[m, m, m, m, m,		NONE THE I	MITHIN II CINITY
	12. Contai	nment me	asures pt	it in place;							
		oms hers:			Dyke	5	Natural d	epressio	n	□Pit	
	13. Апу рі	ctures or	video cov	verage?			V	1] }	1]		
	14. Was th	ere any d	isruption	to the investi	gation?		[Y		T		
If y	es give brief	description	on:								
		•	Λ	IOT	AP	PLI	CABL	E			
D.	TYPE/NUM	IBERS C	F PROF	PERTIES, IF	' ANY, I	FOUND	WITHIN'	THE AR	REA C	OF SPREA	D OF OIL
	15. Struct	ures / Pro	perties								
S/N	Type of	Structui	res	Description	Size		Number			Comme	ents
	MANA	F 1.	11-74	1N A1	2 F-A	- NF	IMU7	ET.			
	The view		 								

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report S/N: 0195

10	Crops/Economic Tree:	3	

S/N Type of crops Young	Medium	Matured	Quantity	Comments
NONE WITHIN A	REA OF	IMPAC	7	


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description Quantity/Size		Comments		
	NONE WI	THIN AREA	OF IMPA	<u>c7</u>		

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments	
<u></u>	110.17	THAI ADEA I	T IMPA	7	
	NUNC M	1 T1 1 TT C-17 - 1) 		

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

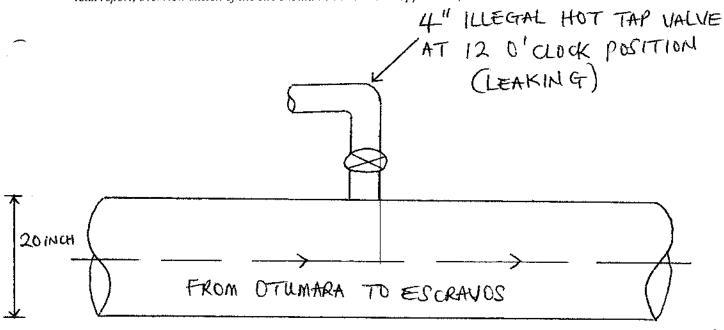

20" OTUMARA - ESCRAVOS PIPELINE AT UGBOEGUNGUN

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report S/N: C195

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING HV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and	attach as an appendix)
せいいん ひきげ のちてて	` ` `

S/N Northing (M) Easting (M)	
S/N Northing (M) Easting (M)	
WPO1 179900.96 304271.02	
W102 179862.06 304259.90	
WP03 179876.35 304208.31	
WPO4 179912.07 304165.85	
WP05 179954.93 304157.11	
WP06 179974.38 304166.64	
WPO7 179950·67 304219·4	2
	/
	<u>-</u>

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report S/N: 0135 G. INCIDENT INFORMATION: 20. Impacted Area Details Total calculated area of impact Impact within SPDC R.O.W Impact outside SPDC R.O.W 21. Volume of oil recovered before completion of JIV (V_{rect}): Recovered oil V_{reel}: NIL Barrels 22. Computation of estimated residual volume on site a. Computation of estimated volume of pool of free phase oil (on land or confined water body).
 i. Area (m²) occupied by pool of free phase oil 5350 m² Average Depth (m) of pool of free phase oil 8.002 M Emulsification factor: 30 Estimated Volume of pool of free phase oil. Vpool: barrels Computation of estimated volume of infiltrated oil in the soil (Vint). 1. Estimated Volume of infiltrated oil at spill point (Vinf a)

i.	Area* (m²) of soil covered by the oil: 30 m²
ñ.	Average Depth (m) above leaking facility i.e. pipeline/flowline: 0 - 3 m
iii.	Soil type: $ATERITE$ iv. P_c (effective porosity of the soil). 20 %
ν.	Soil type: LATERITE iv. P _e (effective porosity of the soil). 20 % Cause of spill: IN TERFERIEVI. Oil type: BONNY MEDIUM
vii.	Oil Residence time on site, day: 3 DAYS
viii.	Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0 - 002 7 m

Estimated depth of infiltration around spill point: 0.3027 Estimated Volume of infiltrated oil at spill point. V_{inf a}: barrels

MIL

2. Estimated Volume of infiltrated oil at second spill point [if applicable] (Vinf b)

ix.

	Area* (m²) of soil covered by the oil: Average Depth (m) above leaking facility i. peline/flowline:	_
	Soil type: iv. P_e (effective porosity of the soil)	
	Cause of spill:vn\oil type:Oil type:Oil Residence time on site, day:	
	Oil Residence time on site, day: X	
	Average depth of infiltration below leaking facility i.e. pipeline/flowline:_	
	Estimated depth of infiltration around spill point:	
_	Estimated Volume of infiltrated oil at spill point, V _{off, b} :	barro

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (Vinf c)

NT INVESTIGATION F	REPORT FOR I	NCIDENT NO: 📙	<u> </u>	JIV re	port S/N()	195	
i. /	Area (m2) of soil	covered by the oil:	1650	M2			
	ŕ	ool of free phase o			114		
		n) below ground su			0.001	27-M	
	Soil type: LATE		race or miniman	IOII OI OII		[
	••		กก ⊌/.				
v.		osity of the soil)	20 %	 -			
`	/i. Estima	ted Volume of infi	trated oil. At V	ind÷	5.69	1	barrels
23. Computation	of estimated ve	olume of oil on o	en water based	d on stanc	lard colora	tion.	
		iter: NOT AP					
ii. <u>Table of a</u>	verage depth of c	il on water based o	n coloration (**Spill I Edition)	Factors from	USCG FO	G (2000
	Thickness (mm)	Percentage coverage	Volume (m3)				
Barely Visible	0.00004	COTTENE	· ordine (me)	7			
Silvery	0.00008			1			
Slight Color	0.00015		$\sqrt{\mathcal{N}}$	1			
Bright Color	0.0003	· (*	()				
Dull	0.001	RAPLI					
Dark	0.002	KYI	•				
Black oil	0.1	<u> </u>					
Emulsion (30% Oil)	1	170					
	Percent Total	100%		_			
iii.	Estimated Volu	me of oil on open v	vater. V _{wat} :	MI	L	Barrel	s
24. Calculation of	of evaporated vo	olume:	··· · · · · · · · · · · · · · · · · ·				
i. Estir	nated Volume a	vailable for evap	oration within:	surface ar	ea: 64	. 22	BBL
	ctor: 15 °/						
			·	 .	_		
iii.	EstimatedV	olume of evaporate	d oil. V _{evap} :	11.	33	Barrel	ls
Evap	oration Factors	(E-Factor) for SF	DC Crude oil				
Oil Type	Days on site	Bonny Light	Воппу Мес	dium			
Oil Residence time	< I day	10%		5%			
	1-7 days	25%		15%			
	> 7 days	40%		25%			
25. Net Estimat (bbls) + V _{ree1}	1-7 days > 7 days ed Spilled Vol	25% 40% ume V _{Est} (bbls) 33 + 19.11	= V _{evap} (bbls) + ナ4牙・川	15% 25%	ls) + V _{inf} -5. 56	(bbls) + BBLS	V _{po}

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report S/N: 0195

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site: Conversion of m^3 to barrels is Volume (m3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of -1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 hbl ----- Reported volume = 16 bbl

Calculated volume = 0.35 bbl Reported volume = 0.4 bbl

Calculated volume = 0.01 bbl ------ Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

- A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
- B. Investigation of the incident site showed that there is residual impact on site requiring further works

27. REPRESENTATIVES

This report was filled, agreed and signed on the 18/10/2013 by joint investigation representatives from

- Host Community:

 ✓
- Department of Petroleum Resources [DPR]: ☑
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]: □
- Shell Petroleum Development Company [SPDC]:
- 🔹 Signatories agree with reported findings: 🗹
- Separate DPR form has been filled out with same findings

Tick as applicable

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1056541 JIV report S/N: 0195

28. Appendix 1: Overview sketch of the site

