

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: 00814

*(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)*

**A. GENERAL INFORMATION:**

1. Spill incident Number: 1322775      2. Type of incident\* OIL SPILL  
 3. Name of Location NEMBE 1 WELL 11(6)4" FLOWLINE  
 4. Name of nearest community NEMBE CREEK. State: BAYELSA 6. LGA NEMBE  
 7. Type of Production facility/Installation FLOWLINE      8. Asset owner/District SWAMP II | NEMBE

**B. INCIDENT INFORMATION:**

9. Details of incident  
 a. Date of incident: 20<sup>th</sup> JANUARY, 2015  
 b. Start date/time of investigation: 29<sup>th</sup> JANUARY, 2015  
 c. Investigation End date: 29<sup>th</sup> JANUARY, 2015 Actual investigation duration, days: ONE DAY  
 d. Description of spill point environment

- |  |  |  |
|--|--|--|
| <input type="checkbox"/> Firmed soil                         | <input type="checkbox"/> Loose soil        | <input type="checkbox"/> Recently excavated area |
| <input checked="" type="checkbox"/> Under water              | <input checked="" type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface    |
| <input checked="" type="checkbox"/> Well Platform (on Water) |  | <input type="checkbox"/> Drill Rig               |

Additional observations around the spill point:

**NOT APPLICABLE**

- e. Description of leak point (tick as applicable);
- |   |   |   |
|---|---|---|
| <input type="checkbox"/> Drilled hole                               | <input type="checkbox"/> Hack saw cut                   | <input type="checkbox"/> Tear (_____),                              |
| <input type="checkbox"/> Complete Rupture                           | <input type="checkbox"/> Inward dent,                   | <input type="checkbox"/> Well head tampering                        |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve,      | <input type="checkbox"/> Failed Clamp                   | <input type="checkbox"/> Missing Pipeline/Flowline                  |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, |   | <input type="checkbox"/> Third party tampering with Clamp           |
| <input type="checkbox"/> Third party tampering with valve setting,  |   | <input type="checkbox"/> Third party tampering with flange,         |
| <input checked="" type="checkbox"/> Corrosion                       | <input type="checkbox"/> Saver-pit over flow,           | <input type="checkbox"/> Surge vessel overflow,                     |
| <input type="checkbox"/> Bulging Outward                            | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 <sup>rd</sup> party equipment |
| impact  | <input type="checkbox"/> Valve Failure                  | <input type="checkbox"/> com unit failure                           |
| <input type="checkbox"/> Relief valve failure                       | <input type="checkbox"/> Others (specify) _____         | <input type="checkbox"/> Cold vent                                  |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3<sup>rd</sup> party damage   
 Operational       Others (including Mystery spills) \_\_\_\_\_

*\*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,*

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: 00814

g. Spill point coordinates

Measuring unit	M	<u>MINNA (MID BELT)</u>
Northing:		Easting:
	<u>48632.84</u>	<u>429799.60</u>
	/	/

**C. RISK ASSESSMENT**

10. Type of environment:

- Land
  Swamp
  Water
  Seasonal swamp
  Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land
  Swamp
  Water
  River (identify) \_\_\_\_\_

ii. Weather condition

- Rain
  Sunny
  Dry
  Wet
  Windy
  Hot
  Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [ ,m]
  - Drinking water source [ ,m]
  - Built up area [ ,m]
  - Farmlands [ ,m]
  - Fish Farm/Pond [ ,m]
  - Fishing net [ ,m]
  - Others (specify). [ ,m]
- } NONE SEEN  
} WITHIN  
} VICINITY

12. Containment measures put in place;

- Booms
  Trench
  Dyke
  Natural depression
  Pit
  None
- Others: \_\_\_\_\_

13. Any pictures or video coverage?

[ Y ]  [ N ]

14. Further response/repair initiated as at the time of JIV?

[ Y ] [ N ]

If yes to item 14, give brief description:

NOT APPLICABLE

15. Was there any disruption to the investigation?

[ Y ] [ N ]

If yes to item 15 give brief description:

NOT APPLICABLE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: 00814

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	NONE WITHIN AREA OF IMPACT				

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

18. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			


19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTIONAL VIEW OF NEMBE 1 WELL U/L FLOWLINE AT NEMBE CREEK

SHOWING CORROSION LEAK FROM A PIN HOLE

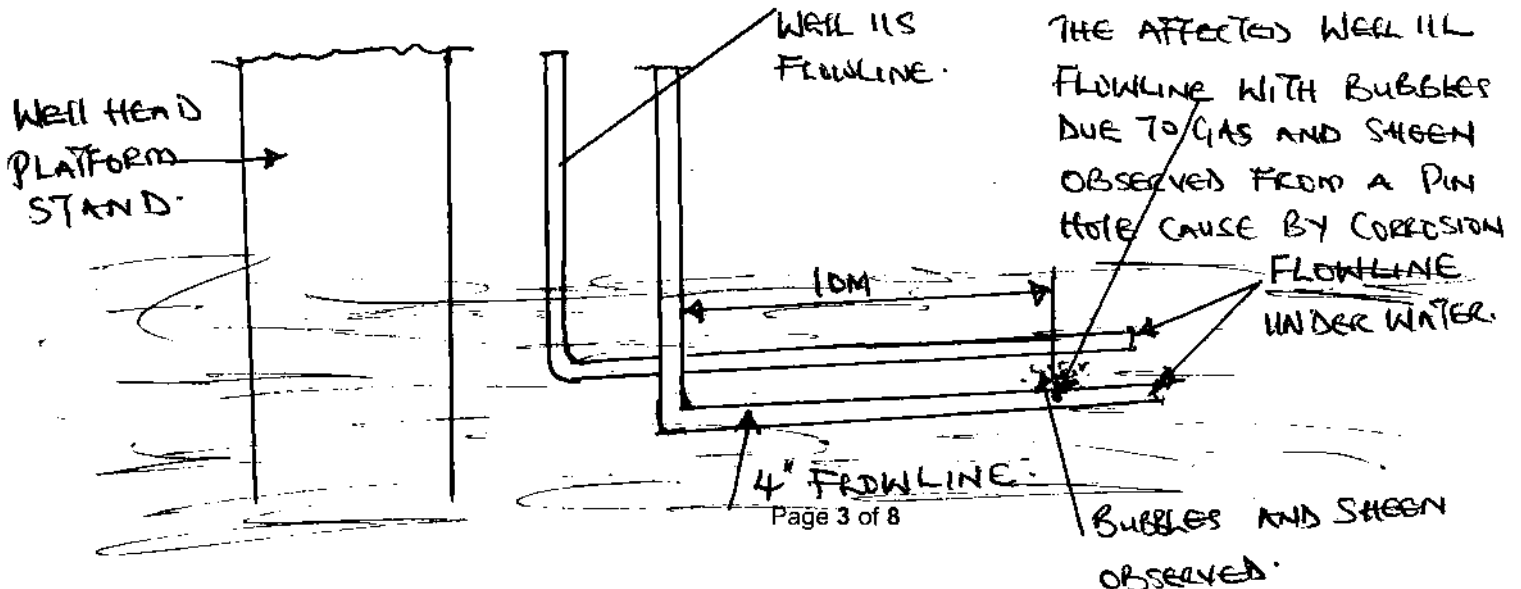

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: **00814**

**F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION**

20. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

S/N	Northing (M)	Easting (M)
	48635.67	429797.38
	48635.67	429801.72
	48630.27	429801.72
	48630.27	429797.38

NINNA (M) - BELT

**ESTIMATION OF OIL SPILL VOLUME**

FID =1322775 AT NEMBE 1 WELL 11 L FLOWLINE AT NEMBE CREEK JIV VOLUME CALCULATION REPORT

**A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)**

**Impacted Area Details**

- Total Calculated Area of Impact
- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

24.00	m <sup>2</sup>
	m <sup>2</sup>
	m <sup>2</sup>

**1 Volume of oil recovered before completion of JIV (V<sub>rec,i</sub>)**

- i Estimated Recovered oil (Net)

	bbbls
--	-------

<b>Estimated Recovered oil (Net) V<sub>rec,i</sub></b>	<b>0.00 bbbls</b>
--	-------------------

**2 Computation of estimated residual volume on site**

**a Computation of volume of free phase oil (on land or confined water body)**

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (If applicable, else 0%)

	m <sup>2</sup>
	m
	%

<b>Estimated Volume of pool of free phase oil, V<sub>pool</sub></b>	<b>0.00 m<sup>3</sup></b>
<b>Estimated Volume of pool of free phase oil, V<sub>pool</sub></b>	<b>0.00 bbbls</b>

**b Computation of estimated volume of infiltrated oil in the soil (V<sub>inf</sub>)**

**1 Volume of infiltrated oil at spill point (V<sub>inf,a</sub>)**

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P<sub>e</sub> (effective porosity of the soil)

	m <sup>2</sup>
	m
Clay	▼
	%

- v Cause of spill

Operational	▼
-------------	---

Calculation of days for infiltration below the leaking point on pipeline or flowline		
Incident Date	JIV Date	Days on Site
1/20/2015 13:40	1/29/2015 14:45	9
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.			
Oil type	Approximate time to reach 1m depth below ground level		
Soil type	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

- vii Oil type
- viii Average depth of infiltration below leaking facility i.e. pipeline/flowline
- ix Total depth below ground surface of infiltration of oil

Bonny Light	▼
	m
	m

<b>Estimated Volume of infiltrated oil, V<sub>inf,a</sub></b>	<b>0.08 m<sup>3</sup></b>
<b>Estimated Volume of infiltrated oil, V<sub>inf,a</sub></b>	<b>0.50 bbbls</b>

**2 Volume of infiltrated oil at second spill point [if applicable] (V<sub>inf,b</sub>)**

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P<sub>e</sub> (effective porosity of the soil)
- v Average depth of infiltration below leaking facility i.e. pipeline/flowline

	m <sup>2</sup>
	m
Clay	▼
	%

	m
	m

<b>Estimated Volume of infiltrated oil, V<sub>inf,b</sub></b>	<b>0.00 m<sup>3</sup></b>
<b>Estimated Volume of infiltrated oil, V<sub>inf,b</sub></b>	<b>0.00 bbbls</b>

**3 Volume of infiltrated oil outside immediate spill point(s) region (V<sub>inf,c</sub>)**

- i Total Area covered by the oil (infiltration)
- ii Total Area of the pool of free phase oil in touch with soil

	m <sup>2</sup>
	m <sup>2</sup>

iii Soil type Clay  
 iv  $P_s$  (effective porosity of the soil) 8%  
 v Average depth below ground surface of infiltration of oil 0.002 m  
 Estimated Volume of Infiltrated oil,  $V_{inf,c}$  0.00 m<sup>3</sup>  
 Estimated Volume of Infiltrated oil,  $V_{inf,c}$  0.01 bbls

4 Volume of infiltrated oil outside immediate spill point(s) region (superficial impact,  $V_{inf,d}$ )  
 i Total Area covered by the oil (infiltration) m<sup>2</sup>  
 ii Total Area of the pool of free phase oil in touch with soil m<sup>2</sup>  
 iii Average depth below ground surface of infiltration of oil 0.002 m  
 Estimated Volume of Infiltrated oil,  $V_{inf,d}$  0.00 m<sup>3</sup>  
 Estimated Volume of Infiltrated oil,  $V_{inf,d}$  0.00 bbls  
 Estimated Total Volume of Infiltrated oil,  $V_{inf}$  0.08 m<sup>3</sup>  
 Estimated Total Volume of Infiltrated oil,  $V_{inf}$  0.51 bbls

c Computation of volume of oil on open water based on standard coloration  
 i Total area of oil on open water 15.00 m<sup>2</sup>  
 ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Aid	
		Percentage coverage (%)	Volume (m3)
Barely Visible	0.00004		0.0000
Silvery	0.00008		0.0000
Slight Color	0.00015		0.0000
Bright Color	0.0003		0.0000
Dull	0.001	60%	0.0000
Dark	0.002	40%	0.0000
Black oil	0.1		0.0000
Emulsion (30% Oil)	1		0.0000
Percent Total:		100%	0.0000

Estimated Volume of oil on open water,  $V_{wet}$  0.00 m<sup>3</sup>  
 Estimated Volume of oil on open water,  $V_{wet}$  0.00 bbls

3 Calculation of evaporated volume

Evaporation Factors (E-Factor) for SPDC Crude oil		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

i Was oil recovery before JIV completion done before JIV date? No  
 ii Estimated volume available for evaporation 0.51 bbls  
 iii E-factor 40%  
 Estimated Volume of evaporated oil,  $V_{evap}$  0.34 bbls  
 Net Total Estimated Spilled Volume,  $V_{Est}$  0.86 bbls

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: 00814

**G. INCIDENT INFORMATION:**

**20. Impacted Area Details**

- Total calculated area of impact 0.0024 m<sup>2</sup> (24.38 m<sup>2</sup>)
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W No

**21. Volume of oil recovered before completion of JIV (V<sub>rec</sub>):**

Recovered oil V <sub>rec</sub> :	<u>NIL</u>	Barrels
----------------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

**22. Net Estimated Spilled Volume V<sub>est</sub>(bbls)\* =**

0.86 BBLs

---

**Estimated Reported Volume\*\* V<sub>rep</sub>(bbls)=** 1 BARRELS.

**\*Notes:**

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

AT THE TIME OF JIV, SHEEN AND GAS BUBBLES WERE OBSERVED FROM THE AFFECTED PART OF THE FLOORLINE.

NOTE: - ~~WHA~~ COMMUNITY DID NOT SIGN REPORT. THE NEMBE CHAIRMAN OF OIL AND GAS ASSOCIATION HAD MANDATED HIS JIV REPRESENTATIVE TO PARTICIPATE IN THE JOINT INVESTIGATION VISIT (JIV), BUT NOT TO SIGN REPORT OR ANY REPORTS GENERATED FROM THIS INVESTIGATION.

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m<sup>3</sup> to barrels is Volume (m<sup>3</sup>) x 6.29; \*\*Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl  
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl  
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

**THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.**

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: **00814**

**23. GENERAL STATUS OF THE SITE**

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input checked="" type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input type="checkbox"/>

**24. REPRESENTATIVES**

**This report was filled, agreed and signed by the following joint investigation representatives:**

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

*Tick as applicable*



THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1322775 JIV report S/N: 00814

25. Appendix 1: Overview sketch of the site

