

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0007 695700

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 695700 2. Type of incident* SPILL
 3. Name of Location 12" ADIBAWA-OKORDIA PIPELINE
 4. Name of nearest community IKARAMA 5. State: BAYELSA 6. LGA YENAGOA
 7. Type of Production facility/Installation OIL PIPELINE 8. Asset owner/District NESP/LAND 2

B. INCIDENT INFORMATION:

9. Details of incident

a. Date of incident: 3RD AUGUST 2011

b. Date/Period of investigation: 8TH AUGUST 2011

c. Description of spill point environment

- | | | |
|---|--|---|
| <input type="checkbox"/> Firmed soil | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Previously excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Rig |

d. Description of leak point (tick as applicable);

- | | | |
|---|--|---|
| <input type="checkbox"/> Drilled hole | <input checked="" type="checkbox"/> Hack saw cut | <input type="checkbox"/> Explosive tear, |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve, | | <input type="checkbox"/> Missing Pipeline/Flowline) |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> External Corrosion | | <input type="checkbox"/> Internal Corrosion |
| <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, | <input type="checkbox"/> Outward dent |
| <input type="checkbox"/> Flare System/Bund wall Failure | <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure |
| <input type="checkbox"/> Cold vent | <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Others (specify) _____ |

e. Incident due to:

- Third party interference Operational Others (specify) _____

f. Spill point coordinates

Measuring unit <u>(M)</u> <u>MID-BELT</u>	
Northing: <u>129364.14</u>	Easting: <u>445883.65</u>

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0007695700

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Raining Sunny

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [NULL ,m]
- Drinking water source [NULL ,m]
- Built up area [NULL ,m]
- Farmlands [2140 ,m]
- Fish Farm/Pond [NULL ,m]
- Fishing net [NULL ,m]
- Others (specify).

12. Containment measures put in place;

- Booms Trench Dyke

Others: NATURAL DEPRESSION

13. Any pictures or video coverage? [N]

14. Was there any disruption to the investigation? [Y]

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	<u>NONE WITHIN AREA OF IMPACT</u>				

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED
 JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0001695700

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			


18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (Overview sketch of the site should be added as an appendix)

A SECTION OF 12" ADIBAWA - OKORDIA PIPELINE

SHOWING HACK SAW CUT AT 2 O'CLOCK POSITION

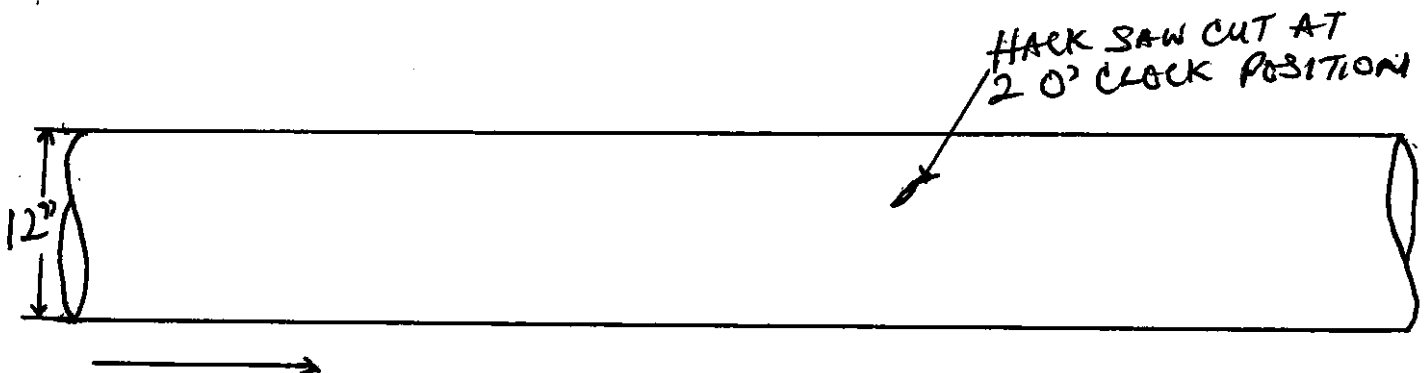

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0007 695700

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

S/N	Northing	Easting
1.	129364.14	445883.65
2.	129367.10	445884.16
8.	129361.60	445891.33
4.	129362.92	445878.81
5.	129364.18	445871.33
6.	129354.93	445880.54
7.	129342.66	445874.34
8.	129339.61	445865.09
9.	129330.56	445854.93
10.	129338.10	445849.56
11.	129345.77	445862.03
12.	129358.05	445865.15
13.	129326.93	445838.48

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.06 Ha
- Impact within SPDC R.O.W 0.05 Ha
- Impact outside R.O.W 0.006 Ha

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>NIL</u>	barrels
---------------------------	------------	---------

20. Computation of the residual volume on site

a. Computation of volume of pool of free phase oil (on land or confined water body).

- Area (m^2) occupied by pool of free phase oil 495
- Average Depth (m) of pool of free phase oil 0.02
- Emulsification factor: _____

iv. Volume of pool of free phase oil. V_{pool} :	<u>62.3</u>	barrels
--	-------------	---------

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0007 695700

b. Computation of volume of infiltrated oil in the soil (V_{inf}).

- i. Area (m^2) covered by the oil: 127
- ii. Area of the pool of free phase oil in touch with soil: 495 m^2
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.02
- iv. Soil type: CLAY
- v. P_e (effective porosity of the soil): 8%

iv. Volume of infiltrated oil. V_{inf}	<u>6.3</u>	barrels
--	------------	---------

21. Computation of volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL
- ii. Table of average depth of oil on water based on coloration *

	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004	<u>NOT</u>	
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003	<u>APPLICABLE</u>	
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		
Percent Total		100%	Total Volume <u>NIL</u> bbl

iii. Volume of oil on open water. V_{wat} :	<u>NIL</u>	barrels
---	------------	---------

22. Calculation of evaporated volume:

- i. Oil type: BONNY MEDIUM
- ii. E-Factor: 15%

iii. Volume of evaporated oil. V_{evap} :	<u>12.1</u>	barrels
---	-------------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

23. Gross Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{rec}(bbls) = 12.1 + NIL + 6.3 + 62.3 + NIL = 80.7 \text{ BARREL}$

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0007695700

$V_{Est}(bbls) = 80.7 \text{ BARRELS}$
24. Net Total Estimated Spilled Volume $V_{Est}(bbls) = V_{evap}(bbls) + 0.6 * V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recf}(bbls) = 12.1 + Nil + 6.3 + 62.3 + Nil =$
$V_{Est}(bbls) = 80.7 \text{ BARRELS}$

*Calculation of the respective estimated volume is to be done using the new spill estimation software on site

*Conversion of m3 to barrels is Total volume VT (m3) x 6.29

*Emulsification factor for spill on water to consider is 60% of volume of oil.

25. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact After the initial response and therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

26 Signatories

This report was filled and signed on the <u>08 / 08 / 20 11</u> at incident site by joint investigation representatives from
<ul style="list-style-type: none">• Host Community <input checked="" type="checkbox"/>• Department of Petroleum Resources [DPR]: <input type="checkbox"/>• National Oil Spill Detection and Response Agency [NOSDRA]: <input checked="" type="checkbox"/>• State Ministry of Environment [SME]: <input checked="" type="checkbox"/>• Nigeria Police Force [NPF]: <input checked="" type="checkbox"/>• Shell Petroleum Development Company [SPDC]: <input checked="" type="checkbox"/>
<i>Tick as applicable</i>

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: ⁰⁰⁰⁷095700

20. Appendix 1: Overview sketch of the site

Location: 12" ADIBAWA-OKORDIA PIPELINE AT IKARAMA

