JOINT INVESTIGATION REPORT FOR INCIDENT NO: ______0216 798452

Note: As practicable as possible the JIT rep	oort is to be signed in the l	field by all the participating parties)
A. GENERAL INFORMATION:		
. Spill incident Number: 79845	2.Type of	fincident* Oll SPILL
3. Name of Location 6" EGB	EMA - ASS	SA PIPELINE
Name of nearest community ASSA	4 5. State:	10 6. LGA OHATI-EGBEI
7. Type of Production facility/Installation	II PIPEL INE 8. As	sset owner/ District NPE/EGBEMA
B. INCIDENT INFORMATION:		
Details of incident	APRIL, 2012.	012.
Firmed soil Under water Well Plateform (on Water) e. Description of leak point (tick as application) Drilled hole Complete Rupture Failed Weld-on illegal hot tap vate oil theft (illegal) bunkering Third party tampering with valve of the corrosion Outward dent Valve Failure	Loose soil Swampy plicable); Hack saw cut Inward dent, alve, ng) point, e setting, Saver-pit over flow, Flare System/Bund wa	□ Previously excavated area □ Exposed pipe surface □ Rig □ Explosive tear, □ Well head tampering □ Missing Pipeline/Flowline) □ Third party tampering with Clamp □ Third party tampering with flange, □ Surge vessel overflow all failure □ Cold vent
f. Incident caused by: Third party interference	Operational	□ _{Mystery}
g. Spill point coordinates Measuring unit(METER) Northing:	Е	D-BELT Easting: 481327.15

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0216 798452

C.	RISK ASSESSMEN	IT		:- -	
	10. Type o	of environment:			
	Land	☐ Swamp	□ Water	☐ Seasonal swamp	
	i. Type of	environment to w	hich oil has sprea	d:	
	Land	□ Swamp	☐ Water	☐ River (identify)	
	ii. Weather	r condition			
	☐ Raining 11. Distance from th	✓Sunny ne nearest sensitive	e habitat		
	Government Drinking wa Built up area Farmlands Fish Farm/P Fishing net Others (spec	ater source a Pond cify).	ignated protected :	area [,m]	
	□ Booms	Trench	•		
	☐ Others:			<u> </u>	
	13. Any pictures or	video coverage?		[Y] [N]	
	14. Was there any d	isruption to the in	vestigation?	[Y] [N]	
If	yes give brief descripti	on:	λ		
_	110	+	TPP	LICABLE	

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N Type of Structur	es Description	Size	Number		Comments
NONE	WITH	N /	REA	OF	IMPACT

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 798452

16. Crops/Economic Trees

S/N Type of crops	Young	Medium	Matured	Quantity	Comments
NONE	WITHI	V AR	EA C	FM	PACT

17. Fish/Nets/Ponds

MOUT WITHIN ACT OF HAR ST	S/N	Fish/Nets/	Ponds	Description		Quantity/Size	Comments
NOME MILLERY AREA DE MARACI	No	ME	\\\\	 	AREA	0 F 1	MPACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Desc	ription		Quan	tity/Size	Comn	ients
	· · · · ·			_t	<u> </u>		<u> </u>	
H/H	}	\ 	418	$\Delta D \Box$	A	U E 1	NDA	C
1 1	<u> </u>	y 		1 112F	-T	\cup	11117	
		<u> </u>			<u> </u>		J	

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF 16" EGBEMA - ASSA PIPELINE AT ASSA SHOWING POSITION OF FAILED CLAMP LEAK POINT.

FAILED 16"X 14" CLAMP.

ASSA

EGBEMA

Page 3 of 9

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0216 798452

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19.	Impacted area boundary	Coordinates	(If more than 12 points,	Attach as an appendix 2)
	Impacted area boundary	INA	MID-RIFLT	,

		<u>-15/2/1</u>
S/N	Northing (METER)	Easting (METER)
PI	153933.99	481319.68
P2	153937.06	481322.77
P3	153924.74	481331.97.
P4	153921.69	481325-80
		nita
		(1) = 0.01Ha
		a
	AREA DE IMPACT = 0.00801	
	APALT =	
	JE IBI	
	AREN	

G. INCIDENT INFÓRMATION:

20	Impacted	Area	Details
20	imnacied	AICA	DEIAIIS

	Total calculated area of impact	_
	Impact within SPDC R.O.W	- -
	Impact outside R.O.W	_
21.	Volume of oil recovered before completion of JIV (V _{rec.I}):	
	Recovered oil Val.	barrels
20.	Computation of the residual volume on site	
a.	Computation of volume of pool of free phase oil (on land or confined water body). i. Area (m²) occupied by pool of free phase oil Average Penth (m) of pool of free phase oil	TCABLE

				NY OF NIGERIA LIMITEI	•
JOINT INVE	STIGATION REI			<u> </u>	52
iii. Emulsification	factor:	DI APP	LICA	BLE	
iv.	Volume o	f pool of free phase o	il.V _{pool} :	NIL	barrels
b. Computation	of volume of infil	trated oil in the soil	(Vine).		
i		overed by the oil:	C - Bity	100	
i	•	ool of free phase oil	in touch	with soil:	
i	_	<u> </u>		of infiltration of oil: 0 r 0	12
-	v Soil type:	PI AY	i bui iuoo (A TANKE OF ON OF TANKE	
		porosity of the soil)		Q0/	
				<u>\(\begin{array}{c} \\ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ \ </u>	
	v. Volume	of infiltrated oil. N	inf	0. 25	barrels
21. Computation	of volume of oi	l on open water ba	sed on st	andard coloration.	
i. Total area o	of oil on open wat	er: NIL			
ii. Table of ave	rage depth of oil	on water based on cold	ration **		
	Thickness (mm)	Percentag coverage		Volume (m3)	
Barely Visible	0.00004]			
Silvery	0.00008	11			
Slight Color	0.00015				
Bright Color		1 4 0	' '		
Dull -	0.001	1		_ 	
Dark		1 ADD1	10	ADI E	
Blackoil	0.1	 		ADLL	
Emulsion (30% Oil)					\neg
· · ·	Percent Total		100% [Total Volume	bbl
iii.		il on open water. \	/wat	NIL NIL	barrels
22. Calculation o	f evaporated vo	lume:			
i. Oil t	Abe: RONN,	Y LIGHT			
ii. E-Fa	ctor: 25°/	<u></u>			
iii.	Volume of e	vaporated oil. V _{evap} :		0-08	barrels
***		4400 0 10 0 10 0 0 10 0 10 0 10 0 10 0	2-44-00-00-00-00-00-00-00-00-00-00-00-00-		
		tor) for SPDC Crude			
Oil Type	Days on site	Bonny Light	Bonny Medium		
Period Since Oil	< 1 day	10%	5%		
Spill					
	1-7 days	25%	15%	6	

Evaporation Factors (E-Factor) for SPDC Crude oil							
Oil Type	Days on site	Bonny Light	Bonny Medium				
Period Since Oil Spill	< 1 day	10%	5%				
	1-7 days	25%	15%				
	> 7 days	40%	25%				

^{*}If area is not same as the total area of impact, please indicate in the overview sketch
** Spill Factor from USCG FOG (2000 Edition)


THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

IOINT INVESTIGATION REPORT FOR INCIDENT NO: 0216 798 452

SOMY INVESTIGATION TO THE STATE OF THE STATE	
23. Gross Total Estimated Spilled Volume	25
$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls) = 0.58 + NiL + 0.19 = 0.58 + 0.58$. 45 1. 52
y (bbls)	<i></i>
24. Net Total Estimated Spilled Volume	
$V_{\text{Est}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + 0.6*V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{recJ}}(\text{bbls}) + V_{\text{recJ}}(\text{bbls}$	0.25
	0.52
VEst(bbls)= 0.5 BARREL	
*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volumestimation software on site	ne
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29	
*Emulsification factor for spill on water to consider is 60% of volume of oil.	
25. GENERAL STATUS OF THE SITE	
A. Joint investigation of the incident site found that there is no residual impact after	the
initial response and therefore recommend that the site be closed out	
B. Investigation of the incident site showed that there is residual impact on site requifurther works	ing
Turther works	
26 REPRESENTATIVES	
This report was filled and signed on the 67/04/20 2 at incident site by j	oint
investigation representatives from	
Host Community	
1	
Department of Petroleum Resources [DPR]: ✓	
• National Oil Spill Detection and Response Agency [NOSDRA]:	
State Ministry of Environment [SME]:	
Nigeria Police Force [NPF]:	
• Shell Petroleum Development Company [SPDC]:	
• Shen Petroleum Development Company [SI DC].	
Tok as applie	abla

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0216 798452

27. Appendix 1: Overview sketch of the site

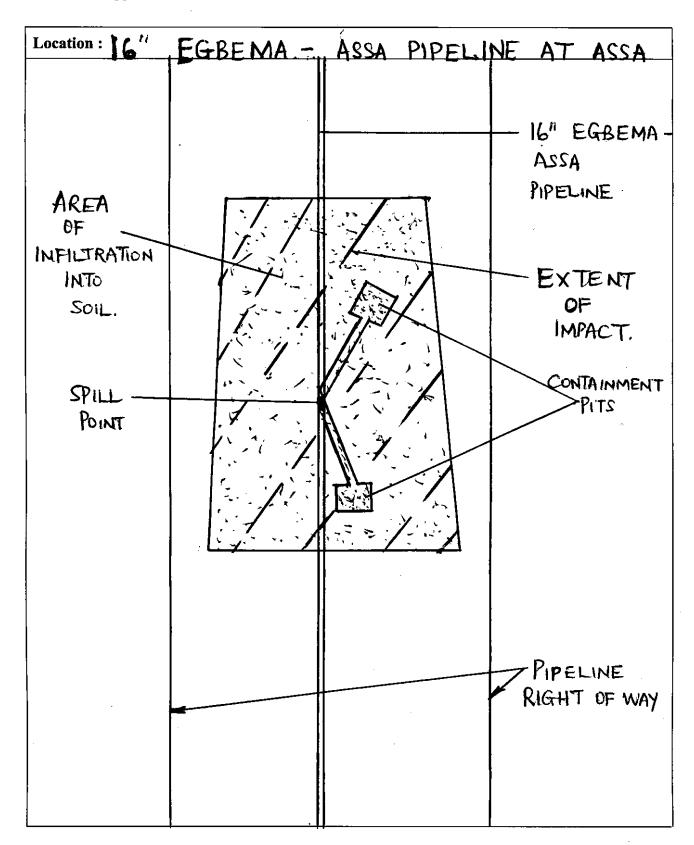

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0216 798452

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
~~.		7
		
,		
	. /	
-		