THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: (Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 84-5601 2. Type of incident * OIL SPILL 3. Name of Location 10 INCH UTORGEU-UPS TRUNKLINE 4. Name of nearest community <u>UTU-JEREMI</u> 5. State: <u>DELTA</u> 6. LGA <u>UGHELLI</u> <u>5001H</u> 7. Type of Production facility/Installation TRUNKLINE 8. Asset owner/ District PIPELINE **B. INCIDENT INFORMATION:** 9. Details of incident a. Date of incident: 26 b. Start date/time of investigation: c. Investigation End date: 28 7 12 012 d. Description of spill point environment □Firmed soil Loose soil Previously excavated area Under water Swampy Exposed pipe surface ☐ Well Plateform (on Water) \square_{Rig} e. Description of leak point (tick as applicable); Drilled hole Hack saw cut ☐ Explosive tear, Complete Rupture ☐ Inward dent. ☐ Well head tampering Failed Weld-on illegal hot tap valve, ☐ Missing Pipeline/Flowline) □Crude oil theft (illegal) bunkering) point, Third party tampering with Clamp Third party tampering with valve setting, Third party tampering with flange, □Corrosion ☐ Saver-pit over flow, ☐ Surge vessel overflow Outward dent ☐ Flare System/Bund wall failure □Valve Failure Com unit failure Cold vent Relief valve failure Others (specify) f. Incident caused by: Third party interference □ Operational □_{Mystery} g. Spill point coordinates Measuring unit Northing: Easting: 384106m 159059

Page 1 of 9

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0313 845601

C.	RI	SK ASSI	ESSMEI	TV							
		10.	Type	of enviror	ıment:					*	
		Lai	nd	Swa	mp		/ater		Seasonal sw	amp	; 3,
		i.	Туре о	f environ	ment to w	hich e	oil has s	pread:			
		Lai	nd	□ Swa	mp		, √ater		River (identi	ify)	
		ii.	Weatho	er conditio	on						
	11	□ Rai L. Distand		Suni he nearest		: habit	at				
	12	□ Dr □ Bu E Fa □ Fis □ Fis	rinking wailt up are rmlands sh Farm/lishing net hers (special)	Pond	ce		d protec	eted area	[[[2 6	[m, m, [m, [m, [m, [m,	
		⊠ Bo	oms	□ Tren	nch		yke				
		□ Ot	hers:				the state of the				
	1.	3. Any pi	ctures or	video cov	verage?					[N]	
	1	4. Was th	iere any o	lisruption	to the inv	vestiga	ation?		[Y]		
If y	/es	give brief	descript	ion:							
	•										
D.		YPE/NUN 5. Struct			PERTIES	 S, IF A	ANY, F	OUND '	WITHIN TH	E AREA OF	SPREAD OF OIL
S/I	V	Type of	Structu	ires	Descrip	tion	Size		Number		Comments
1	\	101	1E	W	HH	1/1	0	AI	2CA	OF	IMPACT
							1				•

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	PALM TREES		YES .		12	/
	RUBBER			405	7	7
				/	1	


17. Fish/Nets/Ponds

	Description	Quantity/Size	Comments
NONE WITH	IN AREA	OF IM	PACT

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
		·····		
	ONG	NITHAL ADE	1 AF 1111	PAC
100	C PO W	11111/1/1/1/1/1/1/1/1/1/1/1/1/1/1/1/1/1/		
L		-		

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

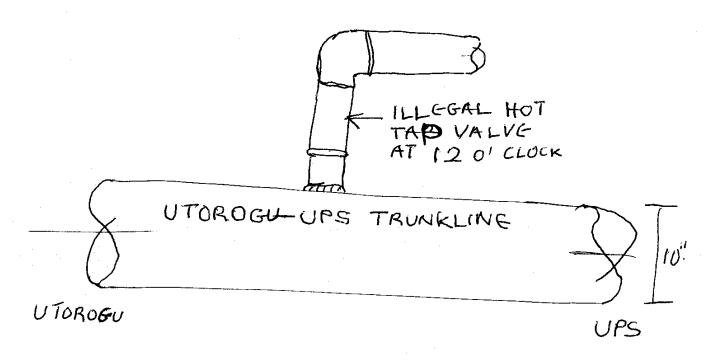

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0213 84560

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

S/N	Northing	Easting
	159080	384166
•	159080	384135
	159093	384-199
	159099	384122
	159102	384115
	159106	384096
	159147	384137
	159112	384124
	159089	384168
	159087	384066
	159092	384157
	159091	384150
	159099	384146

G. INCIDENT INFÓRMATION:

/11	 140160	АІСЯ	Details

	 Total calculated area of impact Impact within SPDC R.O.W Impact outside R.O.W 50 M² 	
21. <u>V</u>	olume of oil recovered before completion of JIV (V _{rec} j):	
	Recovered oil V rec.J. N.L. ba	ırrels
20. <u>C</u>	omputation of the residual volume on site	
a. C	i. Area (m²) occupied by pool of free phase oil	
	ii Average Depth (m) of pool of free phase oil	

THE SHELL PE	TROLEUM DE	EVELOPMENT C	OMPANY		
JOINT INVES	STIGATION REE	ORT FOR INCIDE	NT NO:	0313 8	54560L
	4	60%		00.00	2,700
iii. Emulsification	factor:	10 70			
iv.	Volume of	pool of free phase oil	.V _{pool} :	•	4.62 barrels
b. Computation of	of volume of infilt	rated oil in the soil (V _{inf}).		; ••
i	Area *(m²) co	vered by the oil:	54	-0M2	
ii	Area of the po	ool of free phase oil	in touch with	soil: <i>N</i>	
ii	i Average Dept	h (m) below ground	surface of in	filtration of oil:	0.15m
ir	v Soil type:	LAY			
V	$P_{\rm e}$ (effective	porosity of the soil).	8	0/0	
i:		of infiltrated oil. V			(1 () 7 barrels
	<u> </u>				4075 barrels
_		on open water bas	sed on stand	lard coloration.	
	f oil on open wate				
ii. Table of ave	rage depth of oil o	on water based on color	ration **		
	Thickness	Percentage	е		
Barely Visible	(mm) 0.00004	coverage		Volume (m3	3)
Silvery	0.00008			015	/
Slight Color				1100	
Bright Color	0.0003		· OPT	/	
Dull	0.001	7.	XXX		
Dark	0.002	101	T		
Black oil	0.1	1/10			
Emulsion (30% Oil)	1	<u> </u>			
	Percent Total		100%	Total Volume	NILM
iii.	Volume of o	il on open water. V	/wat:		N L barrels
22. Calculation o				· · · · · · · · · · · · · · · · · · ·	
i. Oil t	ype:BONNY	MEDIUM			
	ctor:15°	_			
	•		i, san a si		
iii.	Volume of e	vaporated oil. V _{evap} :			8/0/ barrels
Evapora	tion Factors (E-Fac	etor) for SPDC Crude	oil		
Oil Type	Days on site	Bonny Light	Bonny Medium		
Period Since Oil Spill	< 1 day	10%	5%		
	1-7 days	25%	15%		•

Evapor	ration Factors (E-F	actor) for SPDC Crue	de oil
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

^{*}If area is not same as the total area of impact, please indicate in the overview sketch ** Spill Factor from USCG FOG (2000 Edition)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED


JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0313 845601

23. Gross Total Estimated Spilled Volume							
•							
$V_{\text{Est}}(bbls) = V_{\text{evap}}(bbls) + V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{\text{pool}}(bbls) + V_{\text{recJ}}(bbls)$							
$V_{\text{Cut}}(\text{bids}) = 53.48\text{LS}$							
24. Net Total Estimated Spilled Volume							
$V_{Est}(bbls) = V_{evap}(bbls) + 0.6*V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recl}(bbls)$							
VEst(bbls)= 534BBLS							
*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site							
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oil.							
25. GENERAL STATUS OF THE SITE							
A. Joint investigation of the incident site found that there is no residual impact after the							
initial response and therefore recommend that the site be closed out 🗖							
B. Investigation of the incident site showed that there is residual impact on site requiring							
further works							
26 REPRESENTATIVES							
This report was filled and signed on the 28/07/20/2 at incident site by joint investigation representatives from							
Host Community							
• Department of Petroleum Resources [DPR]: □							
• National Oil Spill Detection and Response Agency [NOSDRA]: 🖾							
State Ministry of Environment [SME]:							
Nigeria Police Force [NPF]:							
Shell Petroleum Development Company [SPDC]:							
Tick as applicable							

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0313 845601

27. Appendix 1: Overview sketch of the site

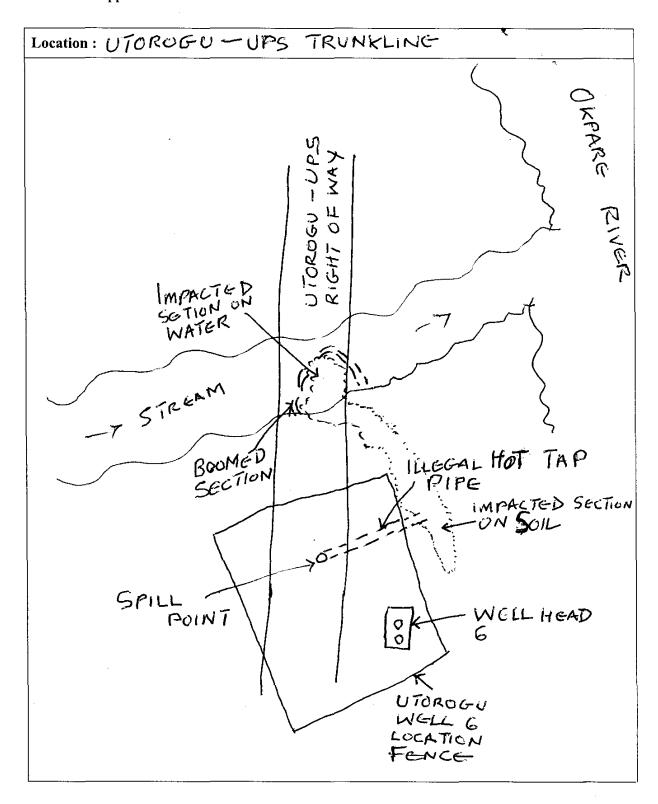

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

		•
S/N	Northing	Easting
	159102	384143
	159107	384124
· 		
	/	
		
 		
<u></u>	4	