

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1155040 JIV report S/N: 00752

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

- 1. Spill incident Number: 1155040 2. Type of incident* OIL SPILL
- 3. Name of Location AKIOBA WELL 8T FLOWLINE
- 4. Name of nearest community BILLE 5. State: RIVERS 6. LGA DEBITIA
- 7. Type of Production facility/Installation OIL FLOWLINE 8. Asset owner/District SWAMP 2

B. INCIDENT INFORMATION:

- 9. Details of incident
 - a. Date of incident: 5TH APRIL, 2014
 - b. Start date/time of investigation: 31ST OCTOBER, 2014 / 11:35 AM
 - c. Investigation End date: 31ST OCTOBER, 2014 Actual investigation duration, days: ONE DAY
 - d. Description of spill point environment

- | | | |
|---------------------------------------------------|-------------------------------------|--------------------------------------------------|
| <input type="checkbox"/> Firmed soil | <input type="checkbox"/> Loose soil | <input type="checkbox"/> Recently excavated area |
| <input checked="" type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |

Additional observations around the spill point: NO RESIDUAL IMPACT WAS OBSERVED ON SITE AS AT THE TIME OF JOINT INVESTIGATION VISIT. TEAR WAS OBSERVED AT CORRODED SECTION OF THE FLOWLINE WHICH WAS SUBMERGED.

- e. Description of leak point (tick as applicable);

<input type="checkbox"/> Drilled hole	<input type="checkbox"/> Hack saw cut	<input checked="" type="checkbox"/> Tear (ON CORRODED PART OF THE FLOWLINE)
<input type="checkbox"/> Complete Rupture	<input type="checkbox"/> Inward dent,	<input type="checkbox"/> Well head tampering
<input type="checkbox"/> Failed Weld-on illegal hot tap valve,	<input type="checkbox"/> Failed Clamp	<input type="checkbox"/> Missing Pipeline/Flowline
<input type="checkbox"/> Crude oil theft (illegal bunkering) point,		<input type="checkbox"/> Third party tampering with Clamp
<input type="checkbox"/> Third party tampering with valve setting,		<input type="checkbox"/> Third party tampering with flange,
<input checked="" type="checkbox"/> Corrosion	<input type="checkbox"/> Saver-pit over flow,	<input type="checkbox"/> Surge vessel overflow,
<input type="checkbox"/> Bulging Outward	<input type="checkbox"/> Flare System/Bund wall failure	<input type="checkbox"/> Accidental 3 rd party equipment
impact	<input type="checkbox"/> Valve Failure	<input type="checkbox"/> com unit failure
<input type="checkbox"/> Relief valve failure	<input type="checkbox"/> Others (specify) _____	<input type="checkbox"/> Cold vent

- f. Incident caused by:
 - Third party interference (Sabotage; crude theft; Line theft; Accidental 3rd party damage
 - Operational Others (including Mystery spills) _____

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1155040 JIV report S/N: 00752

g. Spill point coordinates

Measuring unit <u>M</u> <u>MINNA MID BELI COORDINATE</u>	
Northing:	Easting:
<u>58884.00m N</u>	<u>485303.84m E</u>

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
- Drinking water source [,m]
- Built up area NO RESIDUAL [,m]
- Farmlands IMPACT WAS OBSERVED [,m]
- Fish Farm/Pond ON SITE AS AT THE [,m]
- Fishing net TIME OF JOINT [,m]
- Others (specify) INVESTIGATION VISIT

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit None

Others: BOOMS WERE DEPLOYED AT TIME OF INITIAL RESPONSE BUT LATER REMOVED WHEN RECOVERY ACTIVITIES COMPLETED.

13. Any pictures or video coverage?

NY [N]

14. Further response/repair initiated as at the time of JIV?

[Y] NY

If yes to item 14, give brief description:

THE REPAIR WORK PLANNED.

15. Was there any disruption to the investigation?

[Y] NY

If yes to item 15 give brief description:

NOT APPLICABLE.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1155040 JIV report S/N: 00752

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

16. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	NONE FOUND TO BE IMPACTED				

17. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE FOUND TO BE IMPACTED					

18. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE FOUND TO BE IMPACTED			

19. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE FOUND TO BE IMPACTED			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

SECTION OF AWJOBA WELL BT FLOWLINE AS BILLIE SHOWING POSITION OF CORROSION WITH TEAR AT 12 O' CLOCK POSITION.

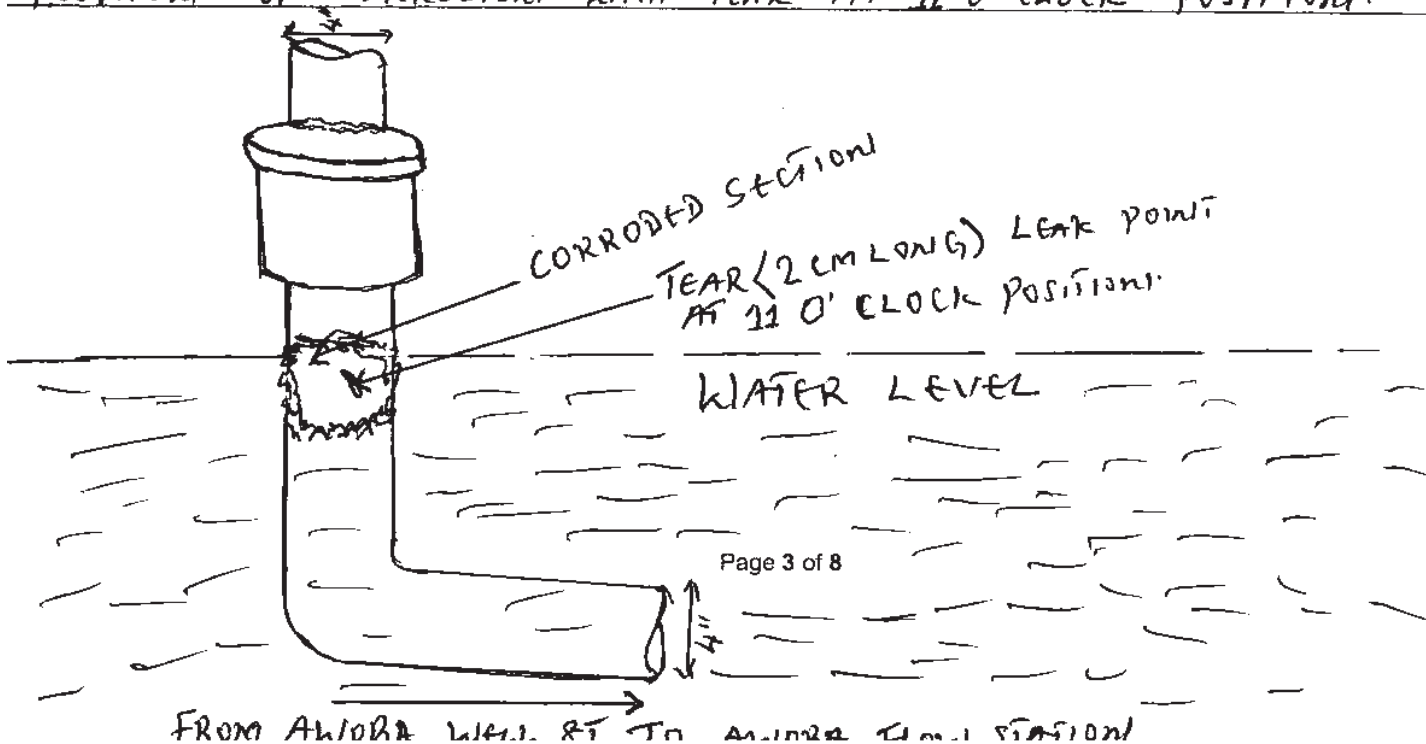

ESTIMATION OF OIL SPILL VOLUME

A OIL SPILLED ONSHORE/OFFSHORE (Leak stopped at source)

Impacted Area Details

Total Calculated Area of Impact

- i Impact within SPDC R.O.W
- ii Impact outside SPDC R.O.W

	m ²
	m ²
	m ²

1 Volume of oil recovered before completion of JIV (V_{rec})

- i Estimated Recovered oil (Net)

0.50	bbls
------	------

Estimated Recovered oil (Net) V_{rec}	0.50 bbls
------------------------------------------------------	------------------

2 Computation of estimated residual volume on site

a Computation of volume of free phase oil (on land or confined water body)

- i Total area occupied by pool of free phase oil
- ii Average depth of pool of free phase oil
- iii Emulsification factor (If applicable, else 0%)

	m ²
	m
0	%

Estimated Volume of pool of free phase oil, V_{pool}	0.00 m³
---------------------------------------------------------------------	---------------------------

Estimated Volume of pool of free phase oil, V_{pool}	0.00 bbls
---------------------------------------------------------------------	------------------

b Computation of estimated volume of infiltrated oil in the soil (V_{inf})

1 Volume of infiltrated oil at spill point (V_{inf a})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

	m ²
	m
- Select -	
0	%

- v Cause of spill

Operational	
-------------	--

vi Calculation of days for infiltration below the leaking point on pipeline or flowline

Incident Date	JIV Date	Days on Site
4/5/2014 14:50	10/31/2014 11:35	209
If 'cause of spill' is operational, use 1 week as worst case scenario except where 'days on site' exceeds 7.		7

Infiltration of oil types in various soil types vs time.			
Soil type	Approximate time to reach 1m depth below ground level		
Oil type	Sand	Loam	Clay
Bonny Medium	3 weeks	3 years	> 10 years
Bonny Light	2 days	2 months	> 10 years

- vii Oil type

Bonny Light	
-------------	--

- viii Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.000	m
-------	---

- ix Total depth below ground surface of Infiltration of oil

0.000	m
-------	---

Estimated Volume of infiltrated oil, V_{inf a}	0.00 m³
---------------------------------------------------------------	---------------------------

Estimated Volume of infiltrated oil, V_{inf a}	0.00 bbls
---------------------------------------------------------------	------------------

2 Volume of infiltrated oil at second spill point [if applicable] (V_{inf b})

- i Total area covered by the oil (infiltration)
- ii Average depth of infiltration above leaking facility i.e. pipeline/flowline
- iii Soil type
- iv P_e (effective porosity of the soil)

	m ²
	m
- Select -	
0	%

- v Average depth of infiltration below leaking facility i.e. pipeline/flowline

0.000	m
-------	---

- vi Total depth below ground surface of infiltration of oil

0.000	m
-------	---

Estimated Volume of infiltrated oil, V_{inf b}	0.00 m³
---------------------------------------------------------------	---------------------------

Estimated Volume of infiltrated oil, V_{inf b}	0.00 bbls
---------------------------------------------------------------	------------------

3 Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf,c}$)

i Total Area covered by the oil (infiltration) m²

ii Total Area of the pool of free phase oil in touch with soil m²

iii Soil type

iv P_e (effective porosity of the soil) %

v Average depth below ground surface of infiltration of oil m

Estimated Volume of infiltrated oil, $V_{inf,c}$ m³

Estimated Volume of infiltrated oil, $V_{inf,c}$ bbls

4 Volume of infiltrated oil outside immediate spill point(s) region (superficial impact, $V_{inf,d}$)

i Total Area covered by the oil (infiltration) m²

ii Total Area of the pool of free phase oil in touch with soil m²

iii Average depth below ground surface of infiltration of oil m

Estimated Volume of infiltrated oil, $V_{inf,d}$ m³

Estimated Volume of infiltrated oil, $V_{inf,d}$ bbls

Estimated Total Volume of infiltrated oil, V_{inf} m³

Estimated Total Volume of infiltrated oil, V_{inf} bbls

c Computation of volume of oil on open water based on standard coloration

i Total area of oil on open water m²

ii Table of average depth of oil on water based on coloration

[Link to Coverage Visual Aid](#)

Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage (%)	Volume (m ³)
Barely Visible	0.00004		0.0000
Silvery	0.00008		0.0000
Slight Color	0.00015		0.0000
Bright Color	0.0003		0.0000
Dull	0.001	65%	0.0042
Dark	0.002	30%	0.0038
Black oil	0.1	5%	0.0320
Emulsion (30% Oil)	1		0.0000
Percent Total:		100%	0.0399

Estimated Volume of oil on open water, V_{wat} m³

Estimated Volume of oil on open water, V_{wat} bbls

3 Calculation of evaporated volume

<i>Evaporation Factors (E-Factor) for SPDC Crude oil</i>		
Residence time of spilled oil (days on site)	Oil type	
	Bonny Light	Bonny Medium
< 1 day	10%	5%
1-7 days	25%	15%
> 7 days	40%	25%

i Was oil recovery before JIV completion done before JIV date?

ii Estimated volume available for evaporation bbls

iii E-factor %

Estimated Volume of evaporated oil, V_{evap} bbls

Net Total Estimated Spilled Volume, V_{Est} bbls

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1155040 JIV report S/N: 00752

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact NIL
- Impact within SPDC R.O.W NIL
- Impact outside SPDC R.O.W NIL

NO RESIDUAL IMPACT OBSERVED ON SITE AS AT TIME OF JOINT INVESTIGATION VISIT.

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>0.5</u>	Barrels
---------------------------	------------	---------

Controlled recovery/evacuation from source with no impact to environment:

<u>NIL</u>	Barrels
------------	---------

22. Net Estimated Spilled Volume V_{est} (bbls)* =

0.92 BARREL

Estimated Reported Volume** V_{rep} (bbls)=

1 BARREL.

*Notes:

- Volume estimation was done using an excel based tool. (see attached for details on the calculation)
- Reported spilled volume is an estimate

Write other relevant notes taken into consideration for estimating the spilled in the box below:

NO RESIDUAL IMPACT WAS OBSERVED ON SITE AS AT TIME OF JOINT INVESTIGATION VISIT. THE SPILL VOLUME ESTIMATION WAS BASED ON THE AREA OF IMPACT CAPTURED WITH OVERFLY PICTURE TAKEN ON THE INCIDENT DATE 5TH APRIL, 2014. SEE ATTACHED.

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m^3 to barrels is Volume (m^3) x 6.29; **Round up estimated volume to next whole number using the following rules:

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

AWOBA WELL 8T FLOWLINE AT BILLE

FID: 2014_1155040



THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 11550.40 JIV report S/N: **00752**

23. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and JIT therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

24. REPRESENTATIVES

This report was filled, agreed and signed by the following joint investigation representatives:

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1155040 JIV report S/N: **00752**

25. Appendix 1: Overview sketch of the site

