JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0448 891646

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:		
1. Spill incident Number: 8916	2.Type	of incident* OIL SPILL
3. Name of Location $8''$ 081	GBO NORTH	L - KOMKOM PIPELINI
4. Name of nearest community LIMUO	Kolobo 5. State: Ri	VERS 6. LGA <u>OYIGBO</u>
7. Type of Production facility/Installation	OIL PIPELINES. A	sset owner/ District NPE/PH 1
B. INCIDENT INFORMATION:		·
Description of spill point environ Date of incident: Date of incident: Date of incident: Investigation: C. Investigation End date: Description of spill point environ Firmed soil Under water	H NOVENBER	2D12. MBER 2012. 2012. Previously excavated area Exposed pipe surface
☐ Well Plateform (on Water) e. Description of leak point (tick as ☐ Drilled hole	applicable); □Hack saw cut	□Rig □Explosive tear,
☐Complete Rupture ☐Failed Weld-on illegal hot tap ☑Crude oil theft (illegal) bunke		☐ Well head tampering ☐ Missing Pipeline/Flowline) ☐ Third party tampering with Clamp
☐Third party tampering with va☐Corrosion		☐ Third party tampering with flange, ☐ Surge vessel overflow
Outward dent	☐Flare System/Bund w	vall failure
Relief valve failure	☐com unit failure☐Others (specify)	☐ Cold vent
f. Incident caused by: Third party interference	Operational	□ _{Mystery}
g. Spill point coordinates Measuring unit Northing: 96194.		ID BELT Easting: 519285.25m

JOINT INVES	HIGAHON REP	ORTFORING	IDENT NO: 87,646
C. RISK ASSESSME	NT		
10. Type	of environment:		
Land	☐ Swamp	□ Water	☐ Seasonal swamp
i. Type	of environment to	which oil has sp	oread:
Land	☐ Swamp	□ Water	☐ River (identify)
ii. Weatl	ner condition		
☐ Raining 11. Distance from	Sunny the nearest sensit	ive habitat	
Governme Drinking Built up a Farmlands Fish Farm Dothers (sp	rea s n/Pond et oecify).		ted area [,m] [,m] [,m] [,m] [,m] [,m]
□ Booms	Trench	Dyke	
☐ Others:			
13. Any pictures of	or video coverage	?	[X] [N]
14. Was there any	disruption to the	investigation?	[X] [N]
If yes give brief descri	ption:		ı
	$\overline{}$	$\sqrt{a}\sqrt{a}$	DITOVOIT
11/	} 	177	LILABLE _
D. TYPE/NUMBERS	S OF PROPERT	TES, IF ANY, F	OUND WITHIN THE AREA OF SPREAD OF OIL

D.

15. Structures / Properties

C.

S/N Type of Structures	Description	Size	Number	Comments
NONE	WIT	HIN	AREA C	MPACT

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1448 891646

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1						
	-	\ \ \ \—	\ \frac{1}{2} \cdot \frac{1}{2	- × <	- 1.40	10 A
	I()NE	VVIIHIN	HKK	1(3 (1,1	- 11912	\mathcal{H}
	• • • • • • • • • • • • • • • • • • • •		, ,,	,		

17. Fish/Nets/Ponds


S/N	Fish/Nets/Por	ıds	Description		Quantity/Size	Comments
				ì		
	クンロ	\	Tilail	Λ_{Ω}	A 00	· · · · · · · · · · · · · · · · · · ·
		VVI	I HIN 1	TK F	/ \ (-)\	MYAC
, ,	O 1 10	, ,,	' ' '	,, ,		

18. Others (Specify) i.e. Animal Traps

S/N	Others		Description		Quantity/S	Size	Comments
M	DNE	W	THIN	ARE	A O	F	IMPACT

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

SECTION (SHOWING PLAN) OF 8" OBIGBO NORTH -KOMKOM PIPELINE AT UMUOKOLOBO SHOWING POSITION OF CRUDE OIL THEFT FITTING.

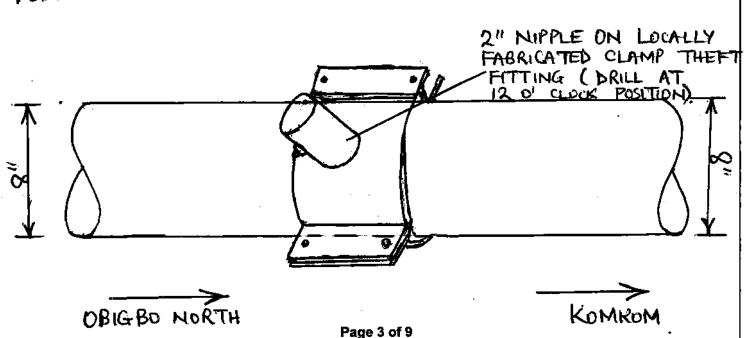

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0448891646

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area bo	oundary Coordinates	(If more than 12 points,	Attach as an appendix 2)
--	---------------------	--------------------------	--------------------------

	MN/NA	MID BELT
S/N	Northing	Easting
1	96240.50m	579291.51m
2	96209.79m	519288.36m
3,	96194.43m	519288.33m
4.	96185,22m	519285.23m
5.	96215.95m	519279.13m
6.	96222.09m	519279.14m
7	96228.24m	519279.16m
8	96231.30m	519282.24m
9	96234.36m	519288. 41m
_	<u> </u>	
		14/11/20/2
_		
	<u> </u>	

G. INCIDENT INFORMATION:

	20 . I	Impacted	l Area	Detai	İS
--	--------	----------	--------	-------	----

•	Total calculated area of impact <equation-block></equation-block>	04-Hg	
•	Impact within SPDC R.O.W	YES	
•	Impact outside R.O.W	N 0	
21. <u>Volu</u>	me of oil recovered before completion of	of JIV (V _{rec} j):	
	Recovered of	NIL NIL	barrels
20. <u>Com</u>	putation of the residual volume on site		
a. Com	putation of volume of pool of free phase oil i. Area (m²) occupied by pool of free	(on land or confined water body).	
	ii Average Depth (m) of pool of free	$\Omega \sim 0.0$	

	INE SHELL PE	IROLEUM D	EVELOPMENT	OMPA			——	
	JOINT INVE	STIGATION REF	PORT FOR INCIDE	ENT NO:	บ	<u>448 891</u>	646	
	iii. Emulsification	factor:	HL					
	iv.	Volume of	pool of free phase oil	l. $\mathbf{v}_{ ext{pool}}$:	1	3-08		barrels
VOLUM INFIE SPIL AREP DEPTO VOLUM = [M	PUTATION OF ME OF OIL TRATION AT L POINT: 1 = 1M ² . 1 = 1M. 1E 21. Computation 2 i. Total area of	Area *(m²) con in Area of the position in Average Depth value of Volume and of oil on open water	porosity of the soil). of infiltrated oil. V	in touch v surface o	f infiltration 8%	79 Nofoil: 0 VOLUME OUTSIDE POINT RI	OF OIL	.ΔTE /10.
X IM FEC OF d	x Stive Porosity		Percentage		Volu	ne (m3)	· 	
K 6.2	Barely Visible	0.00004 0.00008	\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \\ \					
F 0-5	Slight Color	0.00015	1/10				\exists	
BARA	Bright Color Dull	0.0003 0.001	- λ		-		\exists	
	Dark Black oil	0.002 0.1	APP	LIC	ABL	- 	\blacksquare	
	Emulsion (30% Oil)						<u> </u>	1
		Percent Total		100%	Total V	olume N	<u> Б</u>	<u> </u>
		No. of the second second	il on open water. V	wat:	NIL.			barreis
		ype: BONN actor: 15%						
	iii.	Volume of e	vaporated oil. V evap	2		2.93		barrels
	Evapora	tion Factors (E-Fac	ctor) for SPDC Crude	oil				
	Oil Type	Days on site	Bonny Light	Bonny Medium				
	Period Since Oil	< 1 day	10%	5%				

25% 40%

15%

1-7 days > 7 days

Spill

Page 5 of 9

^{*}If area is not same as the total area of impact, please indicate in the overview sketch
** Spill Factor from USCG FOG (2000 Edition)

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 18448 891646

23. Gross Total Estimated Spilled Volume	= 2-93 + NIL + 3-5 +
$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{o}$	ed (bbls) 13.08 + NIL = 19.51
V _{Est} (bbls)= 20 BARRELS	
24. Net Total Estimated Spilled Volume	= 293+ NIL+ 3.5
24. Net Total Estimated Spilled Volume $V_{\text{Est}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + 0.6*V_{\text{wat}}(\text{bbls}) + V_{\text{inf}}(\text{bbls}) + V_{\text{pool}}(\text{bbls})$	+ V _{recJ} (bbls) + 13.08 + NIL =
VEst(bbls)= 20 BARRELS	

25. GENERAL STATUS OF THE SITE

Α.	Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
В.	Investigation of the incident site showed that there is residual impact on site requiring further works

26 REPRESENTATIVES

This report was filled and signed on the 14/11/2019 at incident site by joint investigation representatives from

- Host Community
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]: ☑
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:

Tick as applicable


^{*}Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site

^{*}Conversion of m3 to barrels is Total volume VT (m3) x 6.29

^{*}Emulsification factor for spill on water to consider is 60% of volume of oil.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0448 891646

27. Appendix 1: Overview sketch of the site

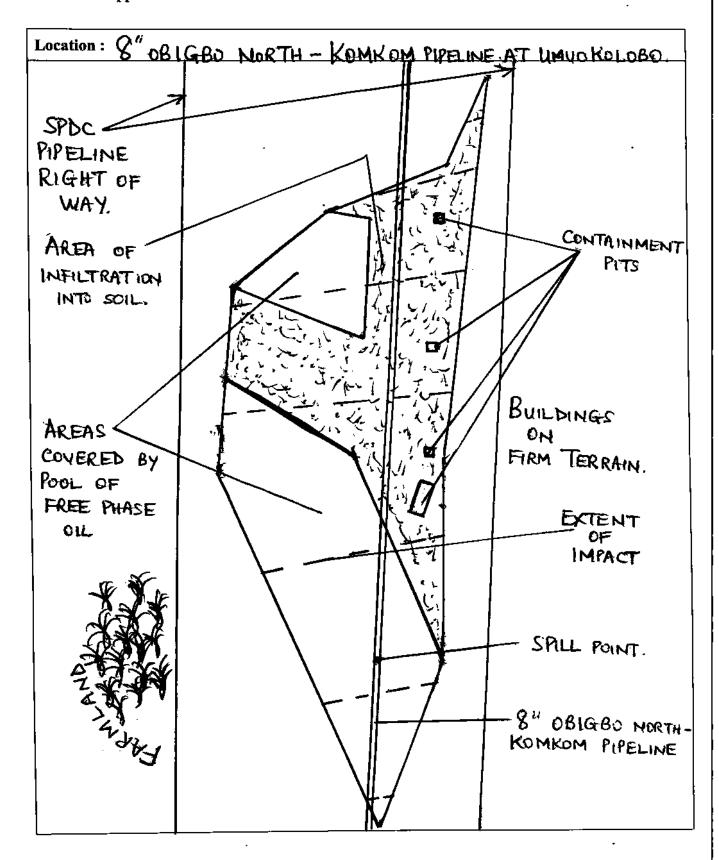

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 291646

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
_		
		A Real
- .		
-	<u> </u>	14/11/2012
		
	 	
	 	
		<u></u>
	 	
	<u> </u>	