

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0506

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 882480 2. Type of incident * OIL SPILL
 3. Name of Location 12 INCH AFIESERE - ERIEMU DELIVERY LINE - AT ERIEMU MANIFOLD
 4. Name of nearest community GANA 5. State: DELTA 6. LGA UGHELLI - NORTH
 7. Type of Production facility/Installation DELIVERY LINE 8. Asset owner/ District PIPELINE

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 22/10/2012
 b. Start date/time of investigation: 23/10/2012 AT 1415 HRS
 c. Investigation End date: 23/10/2012
 d. Description of spill point environment
 Firmed soil Loose soil Previously excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on Water) Rig
 e. Description of leak point (tick as applicable);
 Drilled hole Hack saw cut Explosive tear,
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve, Missing Pipeline/Flowline)
 Crude oil theft (illegal) bunkering) point, Third party tampering with Clamp
 Third party tampering with valve setting, Third party tampering with flange,
 Corrosion Saver-pit over flow, Surge vessel overflow
 Outward dent Flare System/Bund wall failure
 Valve Failure com unit failure Cold vent
 Relief valve failure Others (specify) LEAK FROM VENT VALVE
 f. Incident caused by:
 Third party interference Operational Mystery _____

g. Spill point coordinates

Measuring unit	
Northing: <u>168864</u>	Easting: <u>402680</u>

*This can be a) Oil spill b) Drilling fluid/Chemical c) siltation d) construction e) Encroachment f) Fire,

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0.506 882480

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Raining Sunny

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
 Drinking water source [,m]
 Built up area [0 ,m]
 Farmlands [0 ,m]
 Fish Farm/Pond [,m]
 Fishing net [,m]
 Others (specify) [,m]

12. Containment measures put in place;

- Booms Trench Dyke

Others: SAVER PIT

13. Any pictures or video coverage? [N]

14. Was there any disruption to the investigation? [Y]

If yes give brief description:

.....

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL.

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
1	HOUSE	RESIDENTIAL	/	2	/
	/	/	/	/	/
	/	/	/	/	/
	/	/	/	/	/
	/	/	/	/	/

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0506 882480

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
1	PLANTAIN			YES		
	PINEAPPLE			YES	12	
	VEGETABLE FARM			YES	6	
	ORANGE TREE			YES	2	


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT *While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)*

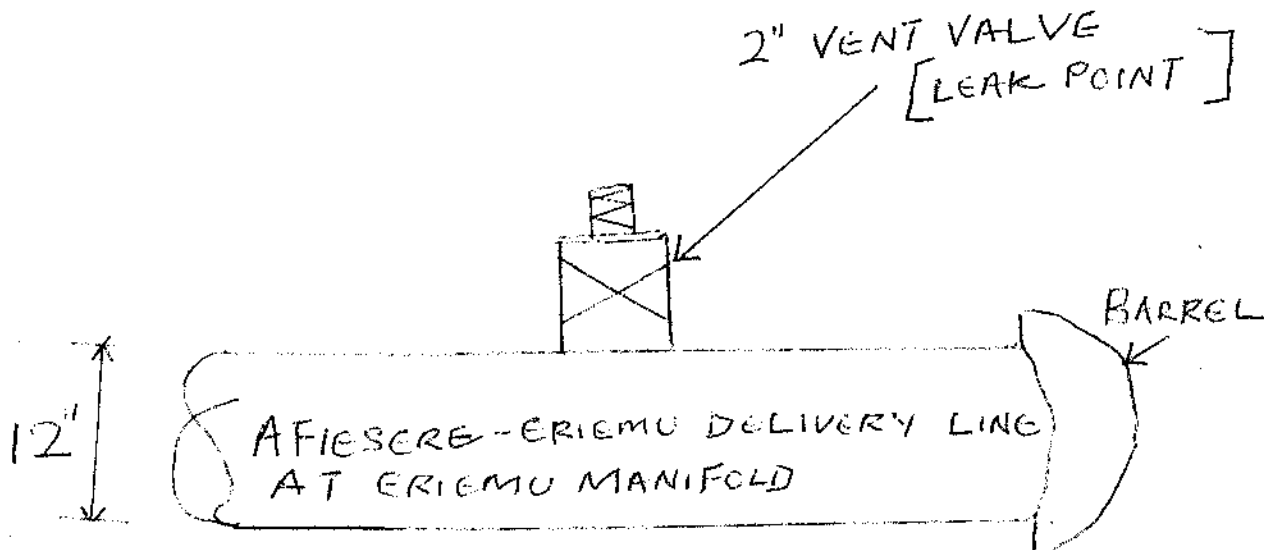

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0506 882480

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

S/N	Northing	Easting
SP	168864	402680
1	168865	402682
2	168865	402684
3	168872	402692
4	168879	402693
5	168887	402683
6	168897	402684
7	168884	402679
8	168882	402670
9	168877	402663
10	168868	402637
11	168864	402632
12	168875	402625

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 518.5m²
- Impact within SPDC R.O.W 366.5m²
- Impact outside R.O.W 151.96

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>NIL</u>	barrels
---------------------------	------------	---------

20. Computation of the residual volume on site

- a. Computation of volume of pool of free phase oil (on land or confined water body).
- Area (m²) occupied by pool of free phase oil NIL
 - Average Depth (m) of pool of free phase oil NOT APPLICABLE

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

0506 882480

JOINT INVESTIGATION REPORT FOR INCIDENT NO: _____

iii. Emulsification factor: NOT APPLICABLE

iv.

Volume of pool of free phase oil, V_{pool} :	NIL	barrels
--	-----	---------

b. Computation of volume of infiltrated oil in the soil (V_{inf}).

- i Area *(m²) covered by the oil: 518.5 m²
- ii Area of the pool of free phase oil in touch with soil: NIL
- iii Average Depth (m) below ground surface of infiltration of oil: 0.01m
- iv Soil type: CLAY
- v P_c (effective porosity of the soil): 8%

iv.

Volume of infiltrated oil, V_{inf}	261	barrels
--------------------------------------	-----	---------

21. Computation of volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: NIL
- ii. Table of average depth of oil on water based on coloration**

	Thickness (mm)	Percentage coverage	Volume (m ³)
Barely Visible	0.00004		
Silvery	0.00008		
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001		
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		
Percent Total		100%	Total Volume <u>NIL m³</u>

NOT APPLICABLE

iii.

Volume of oil on open water, V_{wat} :	NIL	barrels
--	-----	---------

22. Calculation of evaporated volume:

- i. Oil type: BONNY MEDIUM
- ii. E-Factor: 15%

iii.

Volume of evaporated oil, V_{evap} :	0.46	barrels
--	------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Period Since Oil Spill	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

*If area is not same as the total area of impact, please indicate in the overview sketch
 ** Spill Factor from USCG FOG (2000 Edition)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0506 882480

23. Gross Total Estimated Spilled Volume

$$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{urf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls)$$

$V_{Est}(bbls) =$ 3 BBLs

24. Net Total Estimated Spilled Volume

$$V_{Est}(bbls) = V_{evap}(bbls) + 0.6 * V_{wat}(bbls) + V_{urf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls)$$

$V_{Est}(bbls) =$ 3 BBLs

*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site

*Conversion of m3 to barrels is Total volume VT (m3) x 6.29

*Emulsification factor for spill on water to consider is 60% of volume of oil.

25. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out

B. Investigation of the incident site showed that there is residual impact on site requiring further works


26 REPRESENTATIVES

This report was filled and signed on the 23/10/2012 at incident site by joint investigation representatives from

- Host Community
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:

Tick as applicable

27. Appendix 1: Overview sketch of the site

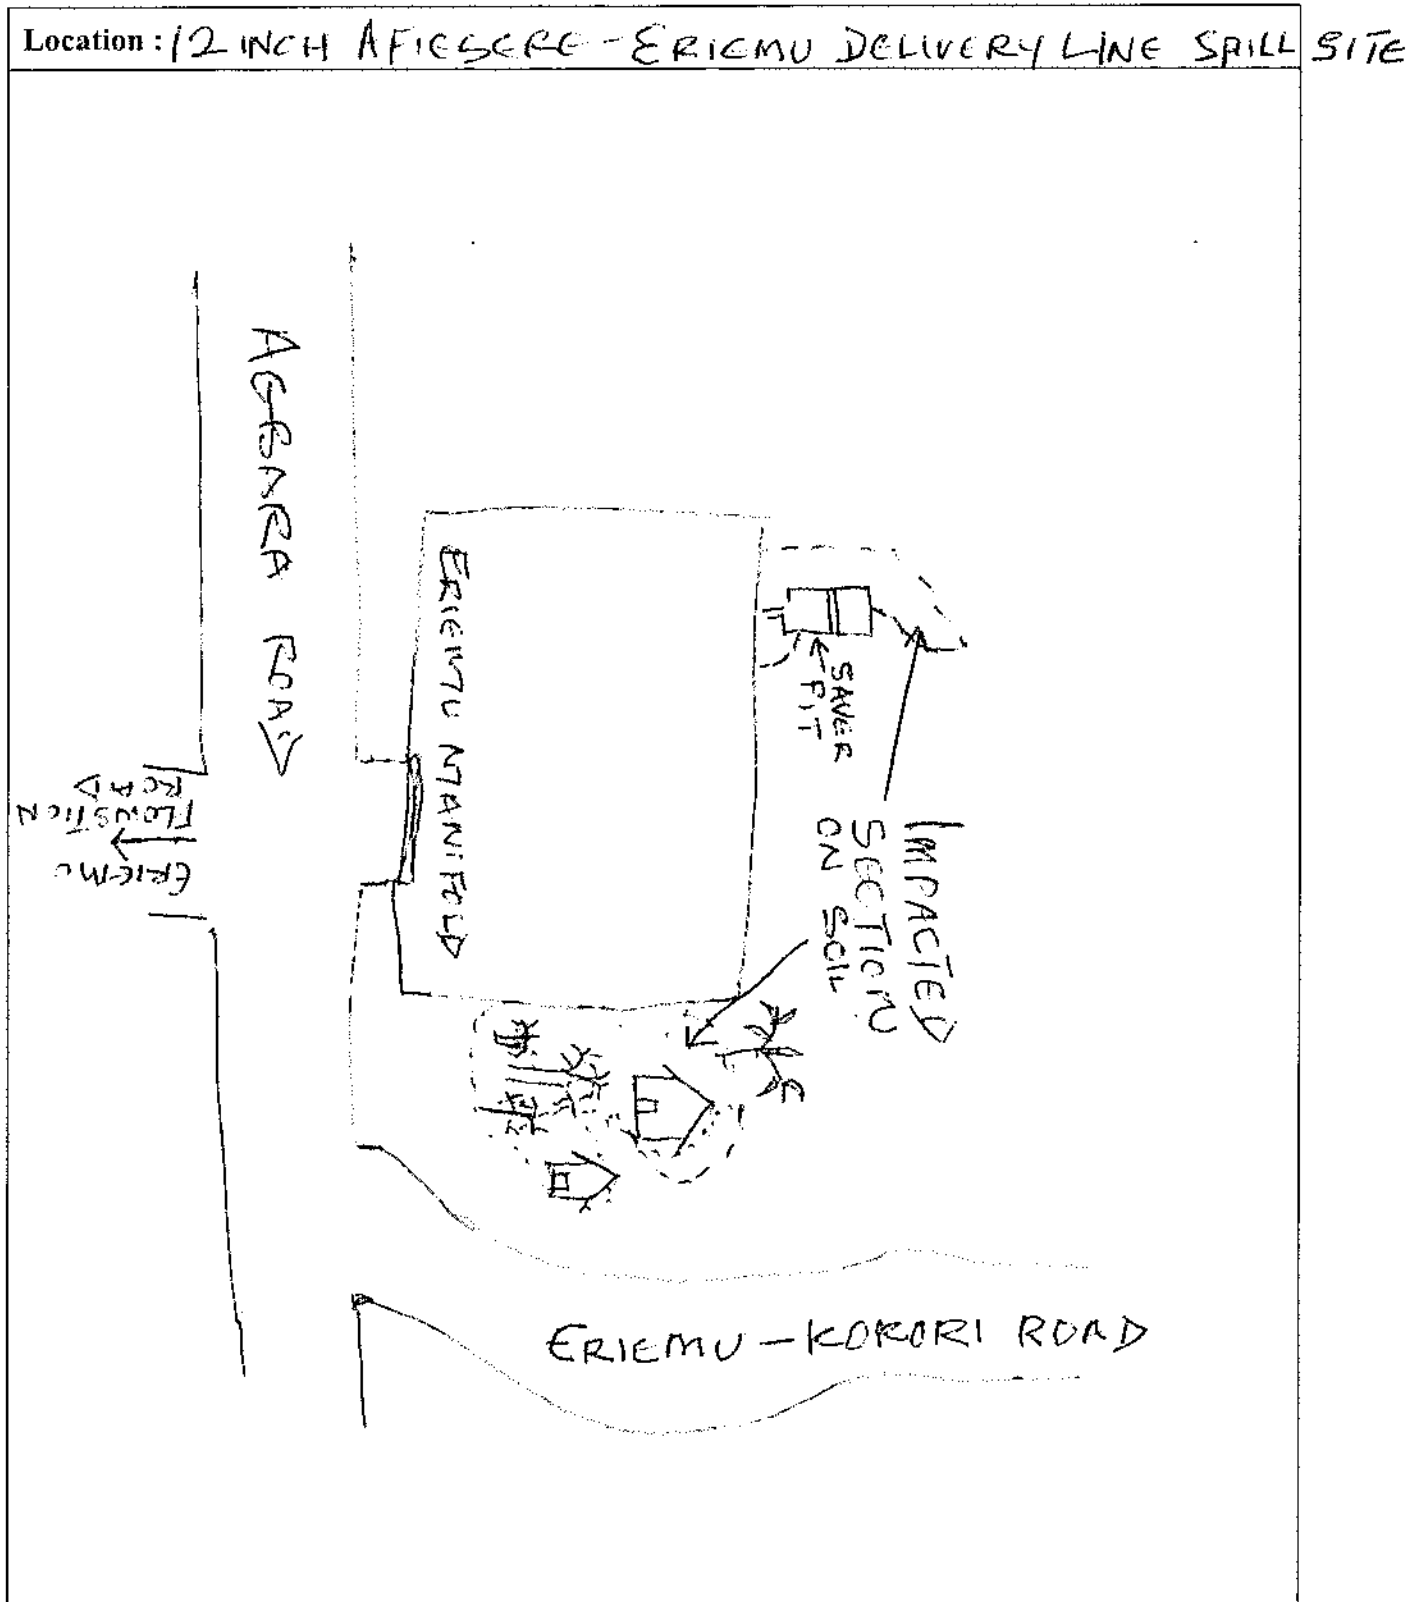

21. Appendix 2: TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
13	168878	402629