THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: $\underline{0355-8}67427$

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties) A. GENERAL INFORMATION: 1. Spill incident Number: 867427 2. Type of incident * OIL SPILL 3. Name of Location 20" BUGUMA - ALAKIRI 4. Name of nearest community BYKUMA 5. State: RIVERS 7. Type of Production facility/Installation PIPELINE 8. Asset owner/ District NESP **B. INCIDENT INFORMATION:** 9. Details of incident a. Date of incident: 15 TH SEPTEMBER, 2012.
b. Start date/time of investigation: 22 NO SEPTEMBER, 2012.
c. Investigation End date: 232 SEPTEMBER, 2012. d. Description of spill point environment Loose soil ☐Firmed soil Previously excavated area □Under water Swampy ☐Exposed pipe surface ☐ Well Plateform (on Water) e. Description of leak point (tick as applicable); ☐Drilled hole Hack saw cut ☐ Explosive tear, Complete Rupture ☐ Inward dent. ☐ Well head tampering ☐Failed Weld-on illegal hot tap valve, ☐ Missing Pipeline/Flowline) Crude oil theft (illegal) bunkering) point, ☐ Third party tampering with Clamp Third party tampering with valve setting, ☐ Third party tampering with flange, □ Corrosion ☐ Saver-pit over flow, ☐ Surge vessel overflow Outward dent ☐ Flare System/Bund wall failure □Valve Failure Com unit failure Cold vent ☐Relief valve failure Others (specify) f. Incident caused by: Third party interference ☐Mystery_ ☐ Operational g. Spill point coordinates ANNIM Measuring unit Northing: Easting:

Page 1 of 9

^{. *}This can be a) Oil spill b) Drilling fluid/Chemical c) siltation d) construction e) Encroachment f) Fire,

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0355 - 267427

C.	RISK ASSESSME	NT			
	10. Type	of environment:			
	□ Land	Swamp	□ Water	☐ Seasonal swar	mp
	i. Type o	f environment to	which oil has sp	read:	
	□ Land	∠ Swamp	□ Water	☐ River (identif	y)
	ii. Weathe	er condition			ı
	☐ Raining 11. Distance from the	Sunny ne nearest sensiti	ive habitat		
	☐ Governmen ☐ Drinking w ☐ Built up are ☐ Farmlands ☐ Fish Farm/l ☐ Fishing net ☐ Others (spe	ater source a Pond cify).	esignated protecto	ed area [[[[[[m] NOT MOT APPLICABLE m] m]
	□ Booms	☐ Trench	□ Dyke		
	Others:				
	13. Any pictures or	vidco coverage?		[Y] /	[N]
	14. Was there any d	lisruption to the i	investigation?	[Y]	[N] ✓
f y	es give brief descripti	on:			
	NoT	AF	PLIC	ABLE	
	TVDE/NITIADEDS /)E DEADERTH	EC LEANIZ EO	HAIP SS/ITHING TRAFF	ABELOECBRELD OF OU

D. TYPE/NUMBERS OF PROPERTIES, IFANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
		 -		 	
	No.	571	N C	1-6/CA	X MOUT
	NONC		77	1 1/2 1	CI MINT
-	1 6-1 -1 -				
					-

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0355 - 867427

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE	WI (tt	NY	TREA	CT 1	MPACT
F						·

17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
7	1 1			
T		Tillion AVC	A -7	[N(0)]
	ALIAN VA		11/ 01-	

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	70	THEN!	PA RI	MONZT
	ICAL KII		T CI	14)1/7/C_(·
				<u> </u>

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix I)

SECTION (SECTION (PLAN) VIEW OF 20" BURGUMA.

- ALAKARI PIRELINE AT BUKUMA.

1112-CAL BUNKERING THEFT

FITTING AT 12° CLOCK POSITION

EN 20" BUGUMA - ALAKRI

PIRELINE AT BUKUMA.

20"

ALAKRI

DIRELINE AT BUKUMA.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0355-867427

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than 12 points, Attach as an appendix 2)

(N) INNA MID — LG-(1)

	(k)INNY WID -	
S/N	Northing (MeTex)	Easting (MR-7 EX)
	82280.88	494057.08
	82271.67	494057.06
	82254.99	494057.15
	82262.02	494012.69
	82286.89	494015.44
	82279.31	4 94028 33
	 	
_		

G. INCIDENT INFÓRMATION:

20. I	mpacted Area Details		
	Total calculated area of impact Total calculated area of impact		-
	Impact within SPDC R.O.W Impact outside R.O.W		- -
21. <u>V</u>	olume of oil recovered before completion of IIV (V _{rec.}):		
	Recovered oil V	NIL	barrels
20. <u>C</u>	omputation of the residual volume on site		
a. C	omputation of volume of pool of free phase oil (on land or confined i. Area (m²) occupied by pool of free phase oil	water body).	5 . 6
	Average Death (m) of nool of free whose oil	TATALI CYT	シ ムだ

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED 0355-867427 JOINT INVESTIGATION REPORT FOR INCIDENT NO: iii, Emulsification factor: ív. Volume of pool of free phase oil. V rool: barrels b. Computation of volume of infiltrated oil in the soil (V_{inf}). 980m2 Area *(m²) covered by the oil: COMPUTATION OF I O. Colm Area of the pool of free phase oil in touch with soil: Volume of oil Average Depth (m) below ground surface of infiltration of oil: D CO Im INFILTRATION AT Soil type: __CL+Y SPILL POINT ARGAY P_c (effective porosity of the soil). AREA = 2m2 Volume of infiltrated oil. Vint barrels 6.48 ben = 0.8m 21. Computation of volume of oil on open water based on standard coloration. Porcs: 12 = 1 Total area of oil on open water: N(1_ ไง [ฟุกเซฺ นาวาร์ส เรือที่เสียง of average depth of oil on water based on coloration •• 15 9X SC1.0 = Thickness Percentage e 81 BARRELD (mm) coverage Volume (m3) Barely Visible 0.00004 Silvery 0.00008 Slight Color 0.00015 **Bright Color** 0.0003 Dull 0.001 Dark 0.002 Blackoil 0.1 Emulsion (30% Oil) NiL bbl Percent Total 100% **Total Volume** Volume of oil on open water. V barrels 22. Calculation of evaporated volume: Oil type: BONNY LIGHT E-Factor: 25 7. ii.

iii.	Volume of	evaporated oil. V_{ev}	ap-	0.60	BARREL
Evapor	ation Factors (E-Fa	actor) for SPDC Crue	de oil		
Oil Type	Days on site	Bonny Light	Bonny Medium		
3 1 2 2 2 2		100/			

barrels

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 8355 - \$67427

23. Gross Total Estimated Spilled Volume	
$V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recJ}(bbls)$	
VEST(bbls) = 0.68+ NIL + (0.98+ 0.81) + NIL + NIL = 2.395 BARKELS	
24. Net Total Estimated Spilled Volume	
$V_{\text{Est}}(bbls) = V_{\text{evap}}(bbls) + 0.6*V_{\text{wat}}(bbls) + V_{\text{inf}}(bbls) + V_{\text{pool}}(bbls) + V_{\text{recJ}}(bbls)$	
VEST(bbls)= 2.40 BARREIS.	

25. GENERAL STATUS OF THE SITE

A.	Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out
₿.	Investigation of the incident site showed that there is residual impact on site requiring further works

26 REPRESENTATIVES

This report was filled and signed on the $\frac{23}{9}/9/2012$ at incident site by joint investigation representatives from

- Host Community ☑
- Department of Petroleum Resources [DPR]: ☑
- National Oil Spill Detection and Response Agency [NOSDRA]:√

 ✓
- State Ministry of Environment [SME]:

 ✓
- Nigeria Police Force [NPF]:

 ✓
- Shell Petroleum Development Company [SPDC]: ☑

Tick as applicable


^{*}Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site

^{*}Conversion of m3 to barrels is Total volume VT (m3) x 6.29

^{*}Emulsification factor for spill on water to consider is 60% of volume of oil.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0355 - \$67427

27. Appendix 1: Overview sketch of the site

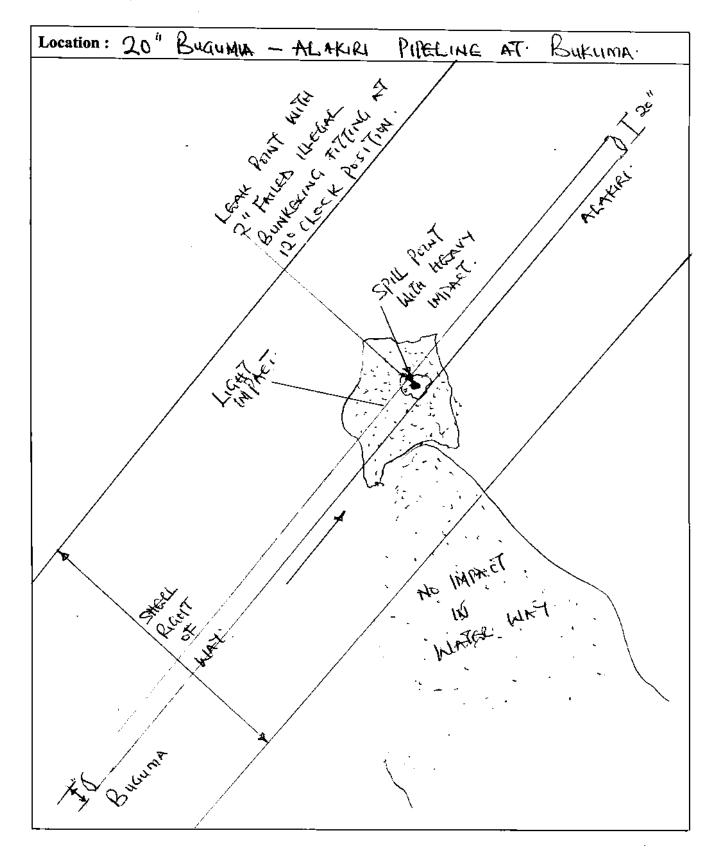

21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

/N	Northing (MASTOR)	Easting (MEXER)
7.4.	Northing (MCTGC)	Easting (MEXER)
	 	
	•	
	<u> </u>	
		2)
	<u> </u>	
		\X0
		S. C. H.M. (10120m²)
		c. Y
		- X/
		_×/
	1	87
	<u> </u>	
	IMPACTE TO	
	18/	
	000	
		<u> </u>
_	 / 	<u>-</u>
		i e
_		
/	7	1
$-\!\!\!/-$	-	