## THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: $\frac{0337867208}{}$

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

Note. As practicable as possible the orrito	port is to be signed in the	note by an are particulations of particular
A. GENERAL INFORMATION:		
. Spill incident Number: $86726$ Name of Location $4^n$ SANTA	<u> 58 2.Type o</u>	of incident * OU SPUL
Name of Location 4" SANTA	BARBARA NE	411T FLOWLINE
Name of nearest community KEG IM	AKIRI 5, SLATE: BAY	GLSA 6. LGA NEMBE
7. Type of Production facility/Installation	JUL FLOWLINGS. A	sset owner/ District NEMBE DISTRUT STORY
B. INCIDENT INFORMATION:		
Details of incident	-C-THREER 28	ที่ใ
<ul> <li>a. Date of incident: 15 × E</li> <li>b. Start date/time of investigation: 1</li> <li>c. Investigation End date: 27 × E</li> </ul>	SEPTEMBER 2	
<ul> <li>d. Description of spill point environm</li> <li>Description of spill point environm</li> </ul>	nent Loose soil	Previously excavated area
Under water	Swampy	Exposed pipe surface
Well Plateform (on Water)	C=Swampy	□Rig
e. Description of leak point (tick as a	pplicable);	
Drilled hole	☐Hack saw cut	Explosive tear,
Complete Rupture	☐Inward dent,	☐ Well head tampering
☐Failed Weld-on illegal hot tap v	valve,	☐ Missing Pipeline/Flowline)
Crude oil theft (illegal) bunker	ing) point,	☐ Third party tampering with Clamp
☐Third party tampering with val	ve setting,	☐ Third party tampering with flange,
Corrosion	☐Saver-pit over flow,	☐ Surge vessel overflow
Outward dent	☐ Flare System/Bund w	vall failure
☐Valve Failure	Com unit failure	Cold vent
Relief valve failure	Others (specify)	HING FROM A WELDED JOINT
f. Incident caused by:		_
☐Third party interference	Operational	Mystery
g. Spill point coordinates  Measuring unit	$M_{10}-b$	OELS ) MINNA
Northing:		Easting:
6098	36:26	452477.50
	<u> </u>	
		<u></u>

Page 1 of 9

<sup>. \*</sup>This can be a) Oil spill b) Drilling fluid/Chemical c) siltation d) construction e) Encroachment f) Fire,

#### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0337867208

					·	
C.	RISK ASSE	ESSME	NT			•
	10.	Туре	of environment:			
	□ Lar	nd	Swamp	□ Water	☐ Scasonal swamp	
	i.	Type o	of environment to	which oil has s	spread:	
	□ Lar	nd	Swamp	□ Water	☐ River (identify)	
	ii.	Weath	er condition			
	□ Rain 11. Distanc		Sunny he nearest sensitiv	e habitat		
	□ Pri □ Bu □ Far □ Fis □ Fis	inking will up are mlands the Farm/shing net the hers (special)	Pond A	MOT	cted area [ ,m] [ ,m] [ ,m] ,m] ,m]	
	Boo	oms	☐ Trench	□ Dyke		
	□ Oth	ners:				
	13. Any pic	ctures or	video coverage?		M [N]	
	14. Was the	ere any o	lisruption to the in	vestigation?	[Y] [W]	
Ify	es give brief	descript	ion:			
	40.	7	A	PPL	ICABLE	

#### D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

#### 15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
			· <u> </u>		
•.	1 3		1-11		x F INICAL
	VIVC	14		1 7 12 7	TOT MIPHE
	10,10	V	10 1 1 1		
	<u> </u>				

#### 

#### 16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
			_	·		
	1/5215	174,	. <i>A∠</i> /)≡	A AI	1000000	-8
	740740		75100	7 91	mpre	71
			-	· <del>-</del>	<u> </u>	

#### 17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Fish/Nets/Ponds Description		Comments
<u> </u>				
<u> </u>	MANG	VILLEL ARE	MATIN	111
	WORL N	ILLE WAR	4 04 11	(hate)

#### 18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	MAJE	CITHILD A DA	M AT 1	MAACT
	A( ) [ A C	VIIII TOPE	M OT I	111913

E. GRAPHIC DESCRIPTION OF LEAK POINT While detail report of the leak point should be contained in the Leak report, overview sketch of the site should be added as an appendix 1)

A'S ECTION OF 4" SANTA BARBARA WELL IIT FLOWLINE SHOWING LEAK CRUBE OU LEAK FROM A NELDED FOUNT AT 5 O'CLOCK POSITION

WELL -> LEHE POINT FORM
HEAD

AT 5 D'ELECE POSITION.

# THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: 1337 867208

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more than	n 12 points, Attach as an appendix 2)

		(MID-DELI) MININA
S/N	Northing Mariels	Easting METERS
	6098936	452468:25
	60986.27	452474 41
	60952 53	452452.74
	60996.01	452474.71
	609 46:01	452459:39
	60986.36	452482 12
	609 79 48	45248133
	60963.50	45247088
	60973.75	452466-11

#### G. INCIDENT INFORMATION:

าก	Impacted	Area	Details
711	IMPACION	и пен	TREATING

21.	Total calculated area of impact Impact within SPDC R.O.W Impact outside R.O.W Volume of oil recovered before completion of JIV (Vm Recovered oil VmcI		barrels
20. a.	Computation of the residual volume on site  Computation of volume of pool of free phase oil (on land or  i. Area (m²) occupied by pool of free phase oil		
	ii. Average Depth (m) of pool of free phase oil _	<u></u>	

THE SHELL PET	ROLEUM DE	VELOPMENT CO	MPANY (	OF NIGERIA LIMITED	۶
JOINT INVES	TIGATION REPO	ORT FOR INCIDEN	IT NO:	<u>86720</u>	O
iji Emulsification f	Nu.	<u> </u>			
_		and of the phase oil 1	7 7	0-03	barrels
iv.	Volume of p	ool of free phase oil.	pont _	V V 2	
Somputation of Vot.  Statil Transport Hot SPE  ARCA = In-  BEPTH - O. Com  IN D = ROL  EVALUATION  O'4 BALLEL  Total area o	Area *(m²) cov  Area of the pool  Average Depth  Soil type:  P_e (effective p  Volume of oil  f oil on open water	orosity of the soil).  f infiltrated oil. Vinton open water base	touch with surface of inf	14 0.4 0.65	barrols
ii. Table of aver	rage depth of oil or	water based on colora	uon ••		
	Thickness (mm)	Percentage cove <u>rage</u>		Volume (m3)	
Barely Visible	0.00004				
Silvery	0.00008	*1			
Slight Color	0.00015	-MO+			
Bright Color	0.0003				
Dull	0.001	-A-w-	<del>  -</del> -	x 015	
Dark	0.002		<del>'L                                    </del>	## <b>*</b> ******	
Blackoil	0.1		~;   0		
Emuision (30% Oil)	1	<u> </u>			
	Percent Total		100%	Total Volume NUL	<u>. 661</u>
· ia.	Volume of o	l on open water. V	vai.	Nul	barrela
22. Calculation of	of evaporated vol	ume:			
i Oil 1	type: BtnM actor: 25	Luum			
ii. E-F	actor:2_5_	Ŀ			
iii.	Volume of e	vaporated oil. V evap:		0.23	berreis
<del></del>	. P. A. C. P.	San SDDC Cardo		<del></del>	
	Days on site	tor) for SPDC Crude Bonny Light	Bonny		
Oil Type	ratio on sine	will will be a second	Medium		
Period Since Oil Spill	< 1 day	10%	5%		
Synu	1-7 days	25%	15%		

40%

25%

> 7 days


### 

JOINT INVESTIGATION REPORT FOR INCIDENT NO:

23. Gross Total Estimated Spilled Volume
$V_{\text{fec}}(\text{bbls}) = V_{\text{evap}}(\text{bbls}) + V_{\text{war}}(\text{bbls}) + V_{\text{int}}(\text{bbls}) + V_{\text{pool}}(\text{bbls}) + V_{\text{recl}}(\text{bbls})$
Ver(bbls)- 0.23+ NW+065+0-03+NW = 0-91 BARRELS
24. Net Total Estimated Spilled Volume
$\mathbf{V}_{\rm red}(bbls) = \mathbf{V}_{\rm grap}(bbls) = 0.6*\mathbf{V}_{\rm wal}(bbls) + \mathbf{V}_{\rm out}(bbls) + \mathbf{V}_{\rm peak}(bbls) + \mathbf{V}_{\rm red}(bbls)$
VEST(DDIS) = 0.23+ NUL + 0.65 + 0.03 + NUL = 0.91 BARRELS
*Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site
*Conversion of m3 to barrels is Total volume VT (m3) x 6.29 *Emulsification factor for spill on water to consider is 60% of volume of oil.
25. GENERAL STATUS OF THE SITE
A. Joint investigation of the incident site found that there is no residual impact after the
initial response and therefore recommend that the site be closed out 🗀
B. Investigation of the incident site showed that there is residual impact on site requiring further works
26 REPRESENTATIVES
This report was filled and signed on the 27/69/20/2 at incident site by joint investigation representatives from
Host Community
• Department of Petroleum Resources [DPR]: □
• National Oil Spill Detection and Response Agency [NOSDRA]:
State Ministry of Environment [SME]:
Nigeria Police Force [NPF]:□
• Shell Petroleum Development Company [SPDC]:
Dates a disconsistant and the property of the second secon
Tick as applicable

### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED JOINT INVESTIGATION REPORT FOR INCIDENT NO: \_\_\_\_, 86 720 8

27. Appendix 1: Overview sketch of the site

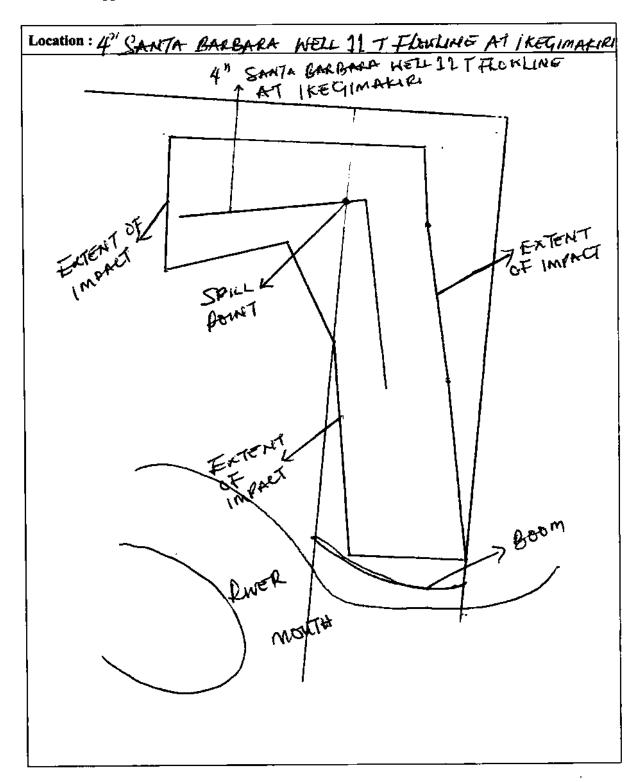

#### THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 0337 86 7208

### 21. Appendix 2:TABLE SHOWING ADDITIONAL COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

S/N	Northing	Easting
	·	<del>                                     </del>
<del> </del>	+	<del> </del> /
	<del> </del>	<del></del>
	<del></del>	
	<del> /</del>	- <del>-</del>
l		