

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 0285

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 967426 2. Type of incident* OIL SPILL
 3. Name of Location BENISEDE WELL 11 FLOWLINE
AMABULOU
 4. Name of nearest community FEDERATED 5. State: BAYELSA 6. LGA EKEREMOR
 7. Type of Production facility/Installation FLOWLINE 8. Asset owner/District SWAMP 2 WEST

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 26TH. APRIL, 2013
 b. Start date/time of investigation: 30TH APRIL 2013 AT 1137HRS
 c. Investigation End date: 30TH APR, 2013 Actual investigation duration, days: ONE
 d. Description of spill point environment
 Firmed soil Loose soil Recently excavated area
 Under water Swampy Exposed pipe surface
 Well Platform (on Water) Drill Rig
 e. Description of leak point (tick as applicable);
 Drilled hole Hack saw cut Tear (_____).
 Complete Rupture Inward dent, Well head tampering
 Failed Weld-on illegal hot tap valve, Failed Clamp Missing Pipeline/Flowline
 Crude oil theft (illegal bunkering) point. Third party tampering with Clamp
 Third party tampering with valve setting. Third party tampering with flange.
 Corrosion Saver-pit over flow, Surge vessel overflow,
 Bulging Outward Flare System/Bund wall failure Accidental 3rd party equipment
 impact Valve Failure com unit failure Cold vent
 Relief valve failure Others (specify) _____

f. Incident caused by:

- Third party interference (Sabotage; crude theft; Line theft; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

g. Spill point coordinates

Measuring unit <u>M</u>	
Northing: <u>110535 MN</u>	Easting: <u>363607 ME</u>

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 0205

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area
 Drinking water source
 Built up area
 Farmlands
 Fish Farm/Pond
 Fishing net
 Others (specify).

[.m] } NONE WITHIN
 [.m] } VISIBILITY
 [.m]
 [.m]
 [.m]

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit
 Others: _____

13. Any pictures or video coverage? [] [N]

14. Was there any disruption to the investigation? [Y] []

If yes give brief description:

 NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
NONE WITHIN AREA OF IMPACT					

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 025

--	--	--	--	--	--

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
NONE WITHIN AREA OF IMPACT						


17. Fish/Nets/Ponds

S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
1	FISH NET	/	31	/
2	FISH TRAP	/	17	/
/	/	/	/	/

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
1	SHRINE	WOOD MATERIA	1	/
/	/	/	/	/

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

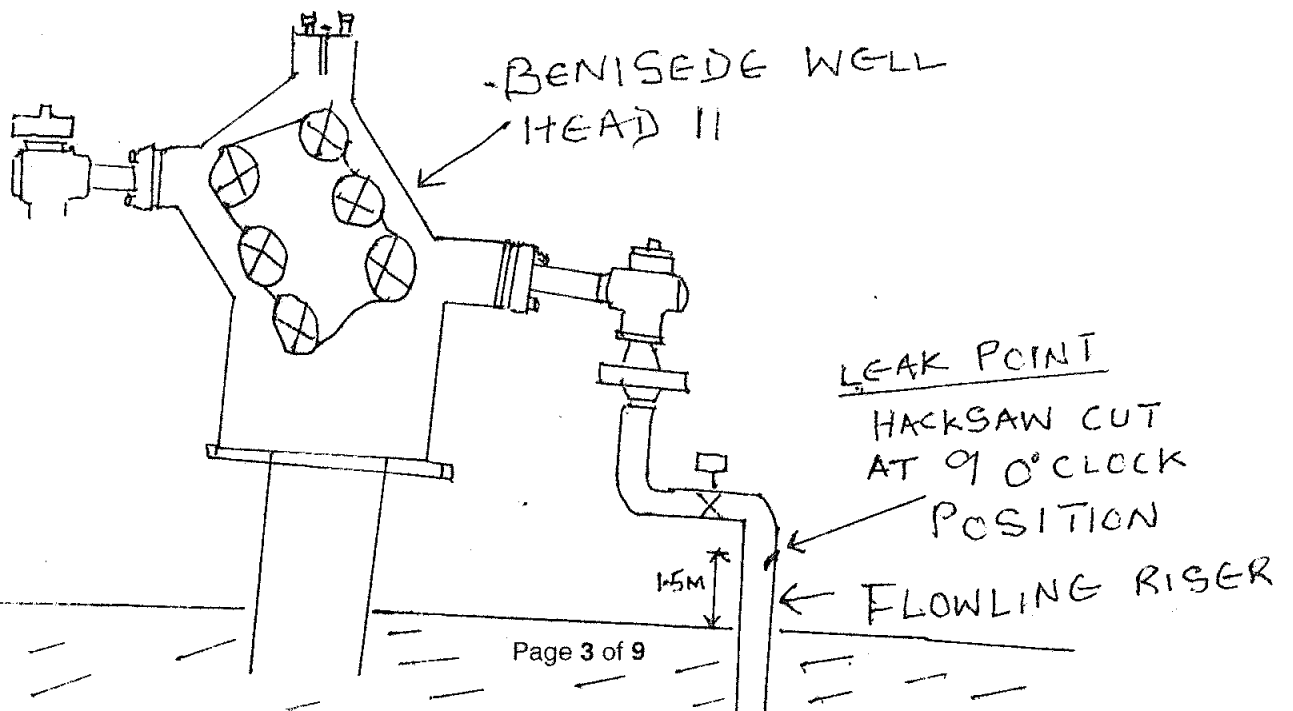

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report, S/N: 0205

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

S/N	Northing	Easting
1	110576	363 609
2	110531	363 645
3	110480	363 591
4	110375	363 700
5	110428	363 726
6	110418	363 532
7	110189	363 264
8	110149	363 268

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N:

G. INCIDENT INFORMATION:

0215

20. Impacted Area Details

- Total calculated area of impact 35,403.17 m²
- Impact within SPDC R.O.W 35,403.17 m²
- Impact outside SPDC R.O.W NIL

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V _{rec} :	NIL	Barrels
----------------------------------	-----	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area (m²) occupied by pool of free phase oil _____
- ii. Average Depth (m) of pool of free phase oil _____
- iii. Emulsification factor: _____

iv. NOT APPLICABLE

Estimated Volume of pool of free phase oil. V _{pool} :	NIL	barrels
---	-----	---------

b. Computation of estimated volume of infiltrated oil in the soil (V_{int}).

1. Estimated Volume of infiltrated oil at spill point (V_{int a})

- i. Area* (m²) of soil covered by the oil: _____
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: _____
- iii. Soil type: _____ iv. P_e (effective porosity of the soil): _____
- v. Cause of spill: _____ vi. Oil type: _____
- vii. Oil Residence time on site, day: _____
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: _____
- ix. NOT APPLICABLE Estimated depth of infiltration around spill point: _____

x. NOT APPLICABLE

Estimated Volume of infiltrated oil at spill point. V _{int a} :	NIL	barrels
--	-----	---------

2. Estimated Volume of infiltrated oil at second spill point [if applicable] (V_{int b})

- i. Area* (m²) of soil covered by the oil: _____
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: _____
- iii. Soil type: _____ iv. P_e (effective porosity of the soil): _____
- v. Cause of spill: _____ vi. Oil type: _____
- vii. Oil Residence time on site, day: _____
- viii. NOT APPLICABLE Average depth of infiltration below leaking facility i.e. pipeline/flowline: _____
- ix. NOT APPLICABLE Estimated depth of infiltration around spill point: _____

Estimated Volume of infiltrated oil at spill point. V _{int b} :	NIL	barrels
--	-----	---------

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region (V_{int c})

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 0205

- i. Area (m²) of soil covered by the oil: _____
- ii. Area (m²) of the pool of free phase oil in touch with soil: _____
- iii. Average Depth (m) below ground surface of infiltration of oil: _____
- iv. Soil type: _____
- v. P_c (effective porosity of the soil): _____

NOT APPLICABLE

vi. Estimated Volume of infiltrated oil. At V_{inf} :	NIL	barrels
---	-----	---------

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: 35,403.17 m²
- ii. Table of average depth of oil on water based on coloration (***Spill Factors from USCG FOG (2000 Edition)*)

	Thickness (mm)	Percentage coverage	Volume (m ³)
Barely Visible	0.00004	40%	0.0005664507
Silvery	0.00008	20%	0.0005664507
Slight Color	0.00015	/	/
Bright Color	0.0003	/	/
Dull	0.001	20%	0.0070806340
Dark	0.002	10%	0.0070806340
Black oil	0.1	/	/
Emulsion (30% Oil)	1	10%	1.0620951000

Percent Total	100%
iii. Estimated Volume of oil on open water. V_{wat} :	6.78 Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 6.78 BARRELS
- ii. E-Factor: 15%

iii. Estimated Volume of evaporated oil. V_{evap} :	1.20 Barrels
---	--------------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume V_{net} (bbbls) = V_{evap} (bbbls) + V_{wat} (bbbls) + V_{inf} (bbbls) + V_{pool} (bbbls) + V_{rec} (bbbls) = 1.2 + 6.78 = 7.98 BBLS

Estimated Reported Volume V_{rep} (bbbls) = 8 BBLS**

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 0205

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; ****Round up estimated volume to next whole number using the following rules:**

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
 Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
 Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

27. REPRESENTATIVES

This report was filled, agreed and signed on the 30/04/2013 by joint investigation representatives from

- Host Community:
- Department of Petroleum Resources [DPR]:
- National Oil Spill Detection and Response Agency [NOSDRA]:
- State Ministry of Environment [SME]:
- Nigeria Police Force [NPF]:
- Shell Petroleum Development Company [SPDC]:
- Signatories agree with reported findings:
- Separate DPR form has been filled out with same findings

Tick as applicable

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 967426 JIV report S/N: 0205

28. Appendix 1: Overview sketch of the site

