

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

(Note: As practicable as possible the JIT report is to be signed in the field by all the participating parties)

A. GENERAL INFORMATION:

1. Spill incident Number: 953753 2. Type of incident* OIL SPILL
 3. Name of Location IMO RIVER 4" WELL 64 L FLOWLINE
 4. Name of nearest community IGIKUKU 5. State: ABIA 6. LGA UKWA WEST
 7. Type of Production facility/Installation OIL FLOWLINE 8. Asset owner/District LADD 1

B. INCIDENT INFORMATION:

9. Details of incident

- a. Date of incident: 1ST APRIL 2013
 b. Start date/time of investigation: 3RD APRIL 2013
 c. Investigation End date: 4TH APRIL 2013 Actual investigation duration, days: TWO (2)

d. Description of spill point environment

- | | | |
|---|--|---|
| <input type="checkbox"/> Firmed soil | <input checked="" type="checkbox"/> Loose soil | <input checked="" type="checkbox"/> Recently excavated area |
| <input type="checkbox"/> Under water | <input type="checkbox"/> Swampy | <input type="checkbox"/> Exposed pipe surface |
| <input type="checkbox"/> Well Platform (on Water) | | <input type="checkbox"/> Drill Rig |
- e. Description of leak point (tick as applicable);
- | | | |
|---|---|---|
| <input type="checkbox"/> Drilled hole | <input checked="" type="checkbox"/> Hack saw cut | <input type="checkbox"/> Tear (_____), |
| <input type="checkbox"/> Complete Rupture | <input type="checkbox"/> Inward dent, | <input type="checkbox"/> Well head tampering |
| <input type="checkbox"/> Failed Weld-on illegal hot tap valve, | <input type="checkbox"/> Failed Clamp | <input checked="" type="checkbox"/> Missing Pipeline/Flowline |
| <input type="checkbox"/> Crude oil theft (illegal bunkering) point, | | <input type="checkbox"/> Third party tampering with Clamp |
| <input type="checkbox"/> Third party tampering with valve setting, | | <input type="checkbox"/> Third party tampering with flange, |
| <input type="checkbox"/> Corrosion | <input type="checkbox"/> Saver-pit over flow, | <input type="checkbox"/> Surge vessel overflow, |
| <input type="checkbox"/> Bulging Outward | <input type="checkbox"/> Flare System/Bund wall failure | <input type="checkbox"/> Accidental 3 rd party equipment |
| impact | <input type="checkbox"/> Valve Failure | <input type="checkbox"/> com unit failure |
| <input type="checkbox"/> Relief valve failure | <input type="checkbox"/> Others (specify) _____ | <input type="checkbox"/> Cold vent |

f. Incident caused by:

- Third party interference (Sabotage ; crude theft ; Line theft ; Accidental 3rd party damage
 Operational Others (including Mystery spills) _____

g. Spill point coordinates

Measuring unit	
Northing: (m)	Easting: (m)
<u>108490.42</u>	<u>524095.66</u>
<u>109025.02</u>	<u>524038.20</u>

MINTWA - MD BBLI

*This can be: a) Oil Spill b) Drilling fluid/Chemical c) Siltation d) construction e) Encroachment f) Fire.

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N:

0030

C. RISK ASSESSMENT

10. Type of environment:

- Land Swamp Water Seasonal swamp Shoreline/Waterfront

i. Type of environment to which oil has spread:

- Land Swamp Water River (identify) _____

ii. Weather condition

- Rain Sunny Dry Wet Windy Hot Cool

11. Distance from the nearest sensitive habitat

- Government reserved and designated protected area [,m]
- Drinking water source [,m]
- Built up area [,m]
- Farmlands [,m]
- Fish Farm/Pond [,m]
- Fishing net [,m]
- Others (specify). [,m]

NOT APPLICABLE

} NOT APPLICABLE

12. Containment measures put in place;

- Booms Trench Dyke Natural depression Pit
 Others: _____

13. Any pictures or video coverage? [N]

14. Was there any disruption to the investigation? [Y] [N]

If yes give brief description:

NOT APPLICABLE

D. TYPE/NUMBERS OF PROPERTIES, IF ANY, FOUND WITHIN THE AREA OF SPREAD OF OIL

15. Structures / Properties

S/N	Type of Structures	Description	Size	Number	Comments
	NONE WITHIN AREA OF IMPACT				

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

--	--	--	--	--

16. Crops/Economic Trees

S/N	Type of crops	Young	Medium	Matured	Quantity	Comments
	NONE WITHIN AREA OF IMPACT					

17. Fish/Nets/Ponds


S/N	Fish/Nets/Ponds	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

18. Others (Specify) i.e. Animal Traps

S/N	Others	Description	Quantity/Size	Comments
	NONE WITHIN AREA OF IMPACT			

E. GRAPHIC DESCRIPTION OF LEAK POINT (while detail report of the leak point should be contained in the leak report, overview sketch of the site should be added as an appendix 1)

A SECTION OF 4" IWD RIVER WELL B4L FLOWLINE SHOWING HACK SAW CUT AND MISSING FLOWLINE AT 191210000.

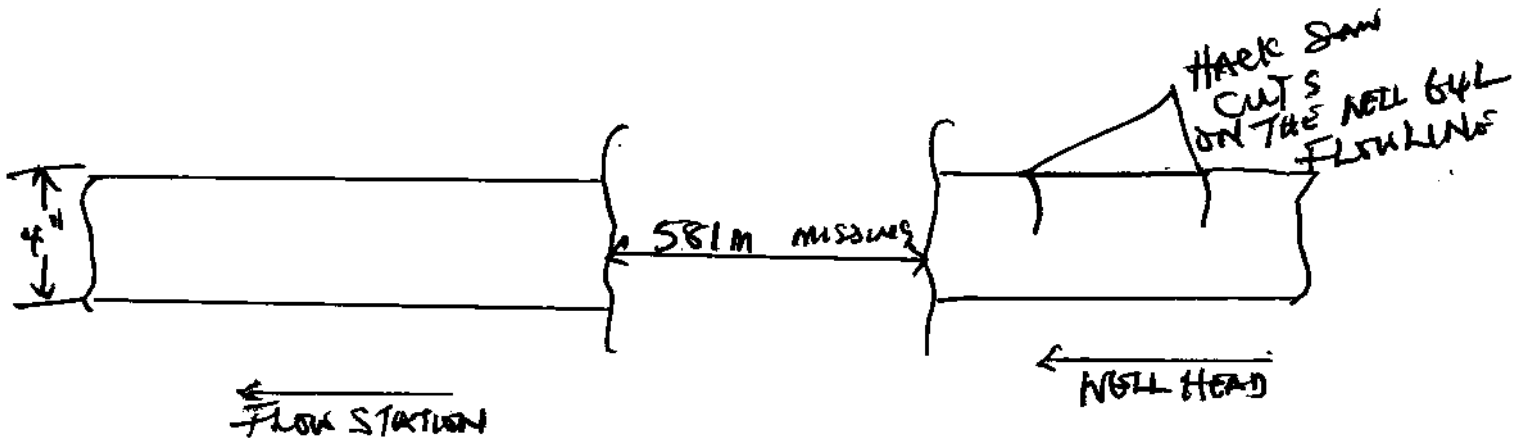

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

F: TABLE SHOWING SOME OF COORDINATES TAKEN DURING JIV FOR AREA CALCULATION

19. Impacted area boundary Coordinates (If more, Print and attach as an appendix)

MINNA MID BELT

S/N	Northing (m)	Easting (m)
82	108533.43	524092.66
83	108532.96	524101.07
58	108413.61	524098.58
59	108410.57	524086.25
60	108422.86	524088.20
61	108429.03	524076.89
63	108456.84	523990.84
65	108484.53	523969.34
64	108487.59	523975.50
66	108499.90	523960.13
67	108506.09	523938.57
68	108515.32	523929.35
69	108524.53	523935.53
70	108502.95	523972.45
72	108469.09	524006.27
74	108444.42	524055.51
75	108441.31	524073.99
76	108430.05	524091.65
89	109031.18	524032.05
90	109037.33	524028.98
91	109040.38	524038.23
92	109031.16	524041.29

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N:

0030

G. INCIDENT INFORMATION:

20. Impacted Area Details

- Total calculated area of impact 0.35 Ha
- Impact within SPDC R.O.W YES
- Impact outside SPDC R.O.W YES

21. Volume of oil recovered before completion of JIV (V_{rec}):

Recovered oil V_{rec} :	<u>1.6</u>	Barrels
---------------------------	------------	---------

22. Computation of estimated residual volume on site

a. Computation of estimated volume of pool of free phase oil (on land or confined water body).

- i. Area (m^2) occupied by pool of free phase oil 1100 m^2
- ii. Average Depth (m) of pool of free phase oil 0.003 m
- iii. Emulsification factor: Nil

iv.

Estimated Volume of pool of free phase oil. V_{pool} :	<u>20.76</u>	barrels
--	--------------	---------

b. Computation of estimated volume of infiltrated oil in the soil (V_{inf}).

1. Estimated Volume of infiltrated oil at spill point ($V_{inf a}$)

- i. Area* (m^2) of soil covered by the oil: 1 m^2
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: 0.5 m
- iii. Soil type: Silt iv. P_e (effective porosity of the soil): 21%
- v. Cause of spill: Third Party interference vi. Oil type: BONNY MEDIUM
- vii. Oil Residence time on site, day: (2) Two
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: 0.0018 m
- ix. Estimated depth of infiltration around spill point: 0.5018 m

x.

Estimated Volume of infiltrated oil at spill point. $V_{inf a}$:	<u>0.66</u>	barrels
---	-------------	---------

2. Estimated Volume of infiltrated oil at second spill point [if applicable] ($V_{inf b}$)

- i. Area* (m^2) of soil covered by the oil: Nil
- ii. Average Depth (m) above leaking facility i.e. pipeline/flowline: Nil
- iii. Soil type: Nil iv. P_e (effective porosity of the soil): Nil
- v. Cause of spill: Nil vi. Oil type: Nil
- vii. Oil Residence time on site, day: Nil
- viii. Average depth of infiltration below leaking facility i.e. pipeline/flowline: Nil
- ix. Estimated depth of infiltration around spill point: Nil

Estimated Volume of infiltrated oil at spill point. $V_{inf b}$:	<u>Nil</u>	barrels
---	------------	---------

3. Estimated Volume of infiltrated oil outside immediate spill point(s) region ($V_{inf c}$)

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

- i. Area (m²) of soil covered by the oil: 2399m²
- ii. Area (m²) of the pool of free phase oil in touch with soil: 1150m²
- iii. Average Depth (m) below ground surface of infiltration of oil: 0.002m
- iv. Soil type: SILT
- v. P_e (effective porosity of the soil): 21%
- vi.

Estimated Volume of infiltrated oil. At V _{inf} :	<u>9.29</u>	barrels
--	-------------	---------

23. Computation of estimated volume of oil on open water based on standard coloration.

- i. Total area of oil on open water: Nil
- ii. Table of average depth of oil on water based on coloration (**Spill Factors from USCG FOG (2000 Edition)

	Thickness (mm)	Percentage coverage	Volume (m3)
Barely Visible	0.00004		
Silvery	0.00008	<u>NOT</u>	
Slight Color	0.00015		
Bright Color	0.0003		
Dull	0.001	<u>APPLICABLE</u>	
Dark	0.002		
Black oil	0.1		
Emulsion (30% Oil)	1		

- iii.

Percent Total	100%	
Estimated Volume of oil on open water. V _{wat} :	<u>Nil</u>	Barrels

24. Calculation of evaporated volume:

- i. Estimated Volume available for evaporation within surface area: 30.66
- ii. E-Factor: 15%
- iii.

Estimated Volume of evaporated oil. V _{evap} :	<u>5.41</u>	Barrels
---	-------------	---------

Evaporation Factors (E-Factor) for SPDC Crude oil			
Oil Type	Days on site	Bonny Light	Bonny Medium
Oil Residence time	< 1 day	10%	5%
	1-7 days	25%	15%
	> 7 days	40%	25%

25. Net Estimated Spilled Volume V_{Est}(bbls) = V_{evap}(bbls) + V_{wat}(bbls) + V_{inf}(bbls) + V_{pool}(bbls) + V_{recd}(bbls) = 5.41 + Nil + 9.90 + 20.76 + 1.6 = 37.67
≈ 38 Barrels

Estimated Reported Volume** V_{rep}(bbls) = 38 Barrels

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

Calculation of the respective estimated volume is to be done on site as far as practicable using the new spill volume estimation software on site; Conversion of m³ to barrels is Volume (m³) x 6.29; ****Round up estimated volume to next whole number using the following rules:**

- Any spill volume in excess of 1 bbl is rounded up to the next whole number.
- Any spill volume in less than 1 bbl is rounded up to the next 0.1 bbl.

Examples: Calculated volume = 15.3 bbl ----- Reported volume = 16 bbl
Calculated volume = 0.35 bbl ----- Reported volume = 0.4 bbl
Calculated volume = 0.01 bbl ----- Reported volume = 0.1 bbl.

Wherever this estimation tool is not applicable please refer to paragraph 6c (Deviations) of the JIV procedure to use appropriate steps for column estimation; record the calculation in a plain sheet of paper and attach to the JIV report.

26. GENERAL STATUS OF THE SITE

A. Joint investigation of the incident site found that there is no residual impact after the initial response and therefore recommend that the site be closed out <input type="checkbox"/>
B. Investigation of the incident site showed that there is residual impact on site requiring further works <input checked="" type="checkbox"/>

27. REPRESENTATIVES

This report was filled, agreed and signed on the <u>04/04/2013</u> by joint investigation representatives from
<ul style="list-style-type: none">• Host Community: <input checked="" type="checkbox"/>• Department of Petroleum Resources [DPR]: <input checked="" type="checkbox"/>• National Oil Spill Detection and Response Agency [NOSDRA]: <input checked="" type="checkbox"/>• State Ministry of Environment [SME]: <input type="checkbox"/>• Nigeria Police Force [NPF]: <input checked="" type="checkbox"/>• Shell Petroleum Development Company [SPDC]: <input checked="" type="checkbox"/>• Signatories agree with reported findings: <input checked="" type="checkbox"/>• Separate DPR form has been filled out with same findings <input type="checkbox"/>
<i>Tick as applicable</i>

THE SHELL PETROLEUM DEVELOPMENT COMPANY OF NIGERIA LIMITED.

JOINT INVESTIGATION REPORT FOR INCIDENT NO: 953753 JIV report S/N: 0030

28. Appendix 1: Overview sketch of the site

Location: IMO RIVER 4" WELL 64L FLOWLINE AT ISIRIUBAY

